



Tel: 781-449-7666

[support@solustan.com](mailto:support@solustan.com)

# User's Manual

December 5, 2018

## **SOFTWARE LICENSE AGREEMENT**

YOU SHOULD CAREFULLY READ THE FOLLOWING TERMS. YOUR INSTALLATION OF THE PROGRAM INDICATES YOUR ACCEPTANCE OF THESE LICENSE TERMS.

PLEASE READ THIS AGREEMENT CAREFULLY BEFORE INSTALLING THE PROGRAM. SOLUSTAN, INC. WILL ONLY LICENSE THE PROGRAM TO YOU IF YOU FIRST ACCEPT THE TERMS OF THIS AGREEMENT BY INSTALLING THE PROGRAM. SOLUSTAN, INC. PROVIDES THE SOFTWARE FOR TRIAL FOR 30 DAYS OR 30 LAUNCHES OF THE DRIVER TO PROVE THE FUNCTIONING OF THE DRIVER ON YOUR PC BEFORE PURCHASING THE LICENSE. ONCE THE LICENSE IS PURCHASED, IT IS NON-REFUNDABLE AND NON-RETURNABLE.

These license terms apply to Your installation and use of the program, which program includes copyrighted materials and programs (collectively referred to as "Program"). This license is granted to You by Solustan, Inc. You may not use the Program contained in this Package to upgrade any existing Programs that You may have. The Programs contained in this package are intended only for the New Users of LinkMotion software product line that user has purchased and not for any other use.

1. License. This Program is licensed and not sold. Title to the Program does not pass to You. Solustan owns copyrights in the Program. You obtain no rights other than those granted You under this Program License Agreement. The term "Program" means the original (including any revisions, enhancements, updates, or the like) and all whole or partial copies of it, including modified copies or portions merged into other programs. You are responsible for the use of, and results obtained from the Program. This Program may be used only on one machine at any one time. You may not reverse assemble or reverse compile the Program, except as specifically provided by law, without the possibility of a contractual waiver. You may not sublicense, rent, lease, or assign the Program.

2. Disclaimer of Warranty and Limitation of Liability. THE PROGRAM AND ANY OTHER PRODUCT WHICH WE PROVIDE TO YOU AS PART OF OUR SERVICE ARE PROVIDED "AS IS." EXCEPT AS SPECIFICALLY SET FORTH HEREIN, NEITHER WE NOR OUR LICENSORS MAKE ANY WARRANTIES, REPRESENTATIONS OR CONDITIONS OF MERCHANTABILITY, QUALITY, AND FITNESS FOR A PARTICULAR PURPOSE RELATING TO OUR PROGRAM, SERVICES, AND/OR RELATED PRODUCTS THAT WE OR OUR LICENSORS PROVIDE.

3. IN NO EVENT SHALL SOLUSTAN BE LIABLE FOR ANY DAMAGES RESULTING FROM THE USE OR MISUSE OF THE SOFTWARE OR THE ACCOMPANYING MANUAL INCLUDING BUT NOT LIMITED TO DAMAGES FOR INJURY TO ANY PERSON OR PROPERTY. THE PROGRAM IS DESIGNED TO WORK WITH MACHINES AND AS SUCH, ANY PART OF THE SYSTEM MAY MISBEHAVE. IT IS IMPORTANT TO TAKE ALL THE NECESSARY PRECAUTIONS IN OREDR TO AVOID EQUIPMENT DAMAGE AND/OR INJURY.

4. WE DISCLAIM ANY WARRANTY OF TITLE OR OTHER WARRANTIES FOR ANY THIRD PARTY'S OFFERING(S) OR PRODUCT(S). ALL SUCH WARRANTIES AND REPRESENTATIONS ARE HEREBY EXCLUDED. WITHOUT LIMITATION, NO WARRANTY IS GIVEN THAT THE PROGRAM OR PRODUCTS ARE ERROR-FREE.

WE, INCLUDING OUR LICENSORS, DISCLAIM ANY LIABILITY OR RESPONSIBILITY ARISING FROM ANY CLAIM THAT YOUR ACCESS OR USE OF THE PROGRAM, SERVICE, AND/OR RELATED PRODUCTS WE PROVIDE INFRINGE ANY THIRD PARTY'S

## INTELLECTUAL PROPERTY RIGHTS.

IN NO EVENT ARE WE OR OUR LICENSORS ARE LIABLE FOR: A) DIRECT, SPECIAL, INDIRECT, CONSEQUENTIAL OR INCIDENTAL DAMAGES EVEN IF WE HAVE BEEN ADVISED OF THE POSSIBILITY THEREOF INCLUDING, BUT NOT LIMITED TO, LOST PROFITS, LOST BUSINESS REVENUE, OR FAILURE TO REALIZE EXPECTED SAVINGS; OR, B) ANY CLAIMS AGAINST YOU BY ANY OTHER PARTY. This Section applies to all claims by You irrespective of the cause of action underlying Your claim, including, but not limited to: a) breach of contract, even if in the nature of a breach of condition or a fundamental term or a fundamental breach, or b) tort including but not limited to negligence or misrepresentation.

In no event are We or Our dealers liable for any damages arising from Your failure to perform Your responsibility in connection with this Program License Agreement, or arising from any cause beyond Our control, including but not limited to delay in the performance of Our obligations or misuse of Your User IDs. All limitations and disclaimers stated in this Section also apply to Our Product Licensors as intended beneficiaries of this Program License Agreement. Any rights or limits stated herein are the maximum for which we are collectively responsible.

5. Termination. This license is effective until terminated. This license will terminate immediately without notice from Solustan, Inc. if fail to comply with any of its provisions. Upon termination you must destroy the Software and all copies thereof, and you may terminate this license anytime by doing so.

6. General. You are responsible for payment of any taxes, including Your personal property taxes, resulting from this Program License Agreement or Your use of the Program. You agree to comply with all export laws and regulations. Neither party may bring an action under this Program License Agreement more than ONE years after the cause of actions arose. This Program License Agreement and all Your rights and obligations are governed by the laws of the State of Massachusetts.

7. LinkMotion driver software is protected with a software protection key. The protection key is tied to your specific PC computer using appropriate Microsoft Operating System. **LinkMotion software license is non transferable. User will be required to pay full price for another license. It is very important to safeguard the PC with the license.**

**8. Free support for LinkMotion software is available for 60 days. User will have to pay for the support charge after 60 days of purchase.**

**9. All of the above terms are effective for complete LinkMotion software product line.**

**Solustan, Inc. 165 Chestnut St., #200, Needham, MA 02492  
Tel: 781-449-7666 EMail: support@solustan.com**

## **Laser Warnings:**

**Solustan** is the provider of LinkMotion driver software and AGNI USB Controller for your laser power based equipment. Extreme caution shall be applied in the use of the machines. Proper safety equipment shall be installed and properly tested to make sure that in case of a failure either in the functioning of the Solustan provided software or other software or the computer hardware associated with the software, proper and safe shut down of the laser power takes place automatically.

This is simply a guide line and not an all-encompassing document for safety and precaution. It is the responsibility of the laser system integrator to make sure that all the safety requirements are met to meet the letter of the law and additional considerations for human safety.

## **Machine use and Safety:**

Buyer acknowledges that the seller does not know of the specific application of said equipment by the buyer, therefore, it is the buyer's (user's) responsibility to provide proper safety devices and equipment to safeguard the operator from harm for any particular use, operation, or set up, and to adequately safeguard the machine or machines to conform to all federal, state and local government safety standards and all industry safety standards, including, without limitation, the 1970 Occupational Health and Safety Act, as amended ("OSHA") and ANSI Z136.1-2001 Safe Use of Laser Standard.

## **Indemnification:**

Buyer agrees to indemnify, hold harmless and defend Seller from and against any and all claims, liabilities or lawsuits involving injury or accident occasioned by Buyer's use of said equipment. This agreement includes but is not limited to the duty to indemnify, hold harmless and defend seller in any of the following: (1) Claim involving or alleging improper or negligent maintenance, reconstruction, repair, alteration, or modifications of the equipment by the buyer, its agents or employees; (2) Claims involving allegations of failure, negligent or otherwise, by the buyer, its agents or employees, to follow Seller's instructions, warnings or recommendations, or to equip said equipment with safety devices as required by federal, state or local government statutes, rules or regulations (including "OSHA" and ANSI Z136.1-2001 Safe Use of Lasers Standard), or as is customary in the trade.

## **Safety:**

Tests carried out have proved the safety and reliability of the laser when used properly. The operator should nevertheless be aware of all the necessary safety rules in order to avoid any risk of damage to persons or the equipment itself.

## **Laser Radiation:**

The Solustan's LinkMotion software and AGNI USB Controller employed to work with any laser system is an OEM system (original Equipment manufacturer), which means that it has been designed and developed as an individual component to be integrated into more complex systems. As an OEM component, it has not been fitted with all the safety systems that complete a laser system. Specialized technicians will need to connect up the machine with all the interlocks, safety indicators and protection devices.

Laser radiation is an electromagnetic emission with a micrometric wavelength found in far infrared (CO2 Laser), near infrared (Nd:Yag, Nd:YV04 Laser), visible (He:Ne or Argon Laser), and ultraviolet (ecchymer lasers).

It should be considered non ionogenic Radiation. In many laser machines, the emission of a crystal bar is excited by "optical pumping" generated by powerful Laser Diode. The continuous bouncing of

Photons between a front and a rear mirror sets up a positive reaction and so their numbers increase by the instant, until the required concentration is achieved to produce a collimated beam emitted from the semi-reflective front mirror. The radiation (which we can imagine to be a “Beam of invisible light”) is then Focused by means of Lenses on a point where the intensity becomes so great that it can react with different materials to cause an alteration by thermal effect.

Even though the radiation of many of such Laser machines may be invisible, because it is near the threshold of vision, the Eye receives it virtually integrally without even any papillary reflex! If we take into account that this is generally very intense, it follows that it can be extremely damaging or lethal to the eyesight.

**Note:**

**Looking directly at a laser beam can cause irreversible damage to the eyesight.**

To avoid permanent personal injury, certain precautions must be followed. All persons who may be exposed to dangerous levels of laser radiation, must know when the laser is active, in which case they must wear protective glasses.

The laser integrated in the Yag system, because of its high power, causes laser light to be reflected from flat surfaces. This reflected light is potentially dangerous to the eyes and skin. Electromagnetic emission with micrometric wavelength comes within the far infrared range and is therefore invisible, it is therefore not obvious where these reflected beams are directed.

**Note:**

Protection from reflected light beams is essential, because these can be of sufficient intensity to cause permanent damage to the eyes and to the skin.

In addition to the potential damage to eyes, invisible laser emission can burn clothes and other flammable materials such as organic solvents (alcohol, acetone) or benzines.

**Note:**

Every laser system is designed as a particular class system. The system integrator shall understand and document the appropriate class of the device, label it properly and explain the importance of safety to the user organization personnel. Class IV covers all laser which are hazardous, not just because of direct or reflected radiation, but also because of diffused radiation! These laser sources can be particularly dangerous to the skin and represent a fire hazard for flammable materials.

# **LinkMotion USB for CO2 Laser Detail Installation and Setup Instructions**

Use 32-bit version for installing on Win 10, 8.1, 8 or 7 32 bit and Win XP operating systems.

Use 64-bit version for installing on Win 10, 8.1, 8 or 7 64 bit operating system.

**LinkMotion will only work on the computer with USB port 2.0 or higher and does not work with USB 1.1. Do not attach other USB devices like keyboard and mouse that has USB 1.1 otherwise LinkMotion will not work.**

If you just purchased USB Controller board and the software, you may want to refer to the document - Connecting and Wiring AGNI USB Controller for the recommended wiring of the controller board in your system.

## **Installation required for LinkMotion USB and USB controller:**

**Part 1 – Installing LinkMotion USB Co2 Laser on Windows 10, 8.1 or 8** requires to follow **Disable driver signature requirement** procedure just prior to installing LinkMotion. **Then follow** first part for installation of LinkMotion USB for CO2 Laser software. Win 7 or XP users do not require Disable driver signature procedure so they can start installing LinkMotion software.

## **Part 2 - Installing USB driver for AGNI Controllers:**

### **A: Install WinUSB Driver for New AGNI III Controller Series 20000 on Win 8 and 10:**

New AGNI Controller Series 20000 now uses windows standard WinUSB driver. Windows 8 and 10 operating system provides windows USB driver for recognizing all USB devices. If you do not have this driver you can go to Microsoft's web site and download this driver. Then follow Confirming the WinUSB driver Installation instructions. Follow all the details from this manual.

### **B: Install WinUSB Driver for New AGNI III Controller Series 20000 on Win 7:**

Win 7 requires for you to download this driver from Microsoft's website. Follow the detail instructions from the Part 2 of installation instructions in this manual.

### **C: Install USB Driver for Older Agni II Controllers series 10000:**

Older Agni Controllers series 10000 and under needed **Install 32-bit AGNI USB driver or 16 bit USB driver**. Please confirm which one you need to install before starting this part of the installation. **Do not plug the USB cable into your computer until the written instruction guides you.**

**Warning for USB Controller Serial Numbers:** If USB Controller's serial number is either not recognized (not certified) or not found when LinkMotion is launched it will display a message "Unrecognized serial number \_\_\_\_". When the user clicks on OK button it will also display a message "The maximum working area is 1'x1" or 25.4mm x 25.4mm". If the controller is not purchased from Solustan or Solustan approved dealer it can display this message "Your controller is not certified. Please contact Solustan for help". Contact Solustan for resolving this problem. G-Code Files tab(menu) also will not be available for

**processing previously generated g-code files.**

**USB Controllers serial numbers can be programmed for limited table size output for testing the software in demo mode. When testing this demo software it will not allow the user to enter and save any larger table size in Machine properties area. It will not allow the user to send any jobs larger than the available table size. Make sure to test the jobs that fit within that available area.**

## **Part 1 - Installation Procedure for LinkMotion USB for CO2 Laser:**

Note that you must have **administrative privileges on the computer or Administrator should install** this in order to install LinkMotion properly. **Please make sure that you are not running any software applications at the time of this installation. Virus protection software needs to be turned off before installing this software. You can turn that back on after the installation is finished.** Most of the installation process is self-explanatory by following the instructions on the screen. You can stop the installation at any time by clicking "Cancel".

Windows 10, 8.1 and 8 users should follow Disable driver signature requirement procedure just prior to installing LinkMotion software as explained separately for each one in next few pages. Windows 7 and XP users can skip that part and go to LinkMotion installation part of the instructions.

### **Installing on Windows 10, 8.1 or 8 operating system:**

**Do not install LinkMotion** until following procedure is done for Windows 10, 8.1 or 8. In Windows 8.1 and 8 operating system, **you must first disable the Driver Signature Requirement to install the LinkMotion driver.** Once the Driver Signature Requirement is disabled the system will restart the computer and the user will be able to install LinkMotion driver using our installation instructions. Next time when the computer restarts the Driver Signature Requirement will default back to enabled. Once the LinkMotion driver is installed, you can install a new version of LinkMotion without having to disable it again in Windows. We have included separate instructions for Windows 10, 8.1 and Windows 8. Please follow proper instructions for your computers operating system.


Windows 10, 8.1 and 8 user interface has newer design and it is different than all previous version of the Windows. There are more than one ways to go to the Control Panel and you should use what you are comfortable with. Control Panel can be selected by bringing the arrow of your mouse at the bottom right corner and select Settings. Under the settings, the second available selection is Control panel. Click on this and all Control Panel selections are available. Remember to use apply button and save information when you make any changes in the settings for it to be effective.

## **Disable Driver Signature Requirement under Windows 10:**


Go to Windows **Settings** dialog box by one of the following methods:

- (1) Click on the Windows **Start button** and select **Settings**.
- (2) Select **All Apps** selection above the Start button of Windows and select **Settings**.
- (3) Click on the **No New Notification** icon in the Systems Tray at the bottom right. Here click on the **All Settings**.

You will see the dialog box for Settings as shown below.

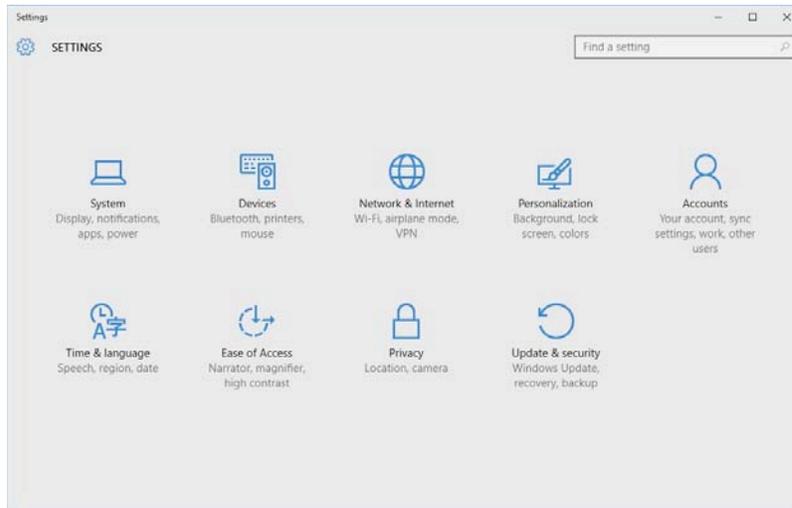

Click on the **Update & Security, Windows Update, Recovery, Backup** and you will see the following options shown in the picture below.

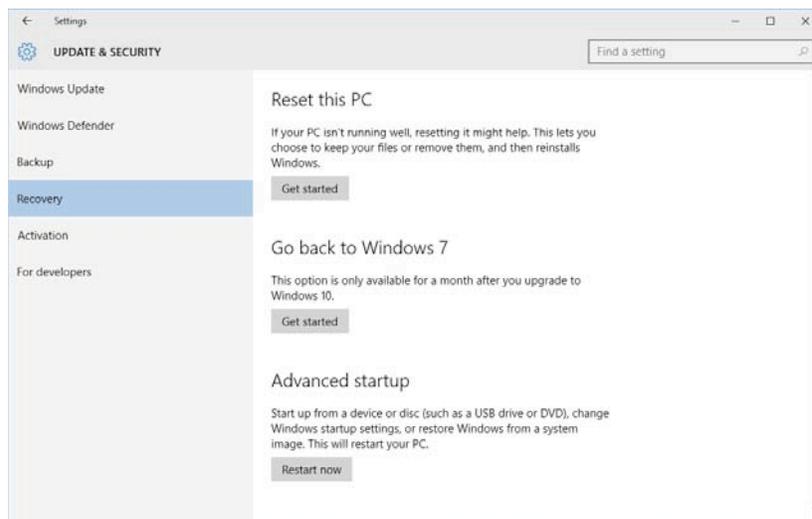

Select **Recovery** on the left side and Click on the **Restart Now** button under Advanced startup on the right side.


Here select **Troubleshoot**.

Select **Advanced Options** under **Troubleshoot** selection.

Select **Startup Settings** under **Advanced Options** selection.

Select the **Restart** button from the bottom right under **Startup Settings** selection.

Now Computer will restart again and you will see a screen for **Startup Settings** with many selections available listed with numbers One through Nine as shown in the picture below.

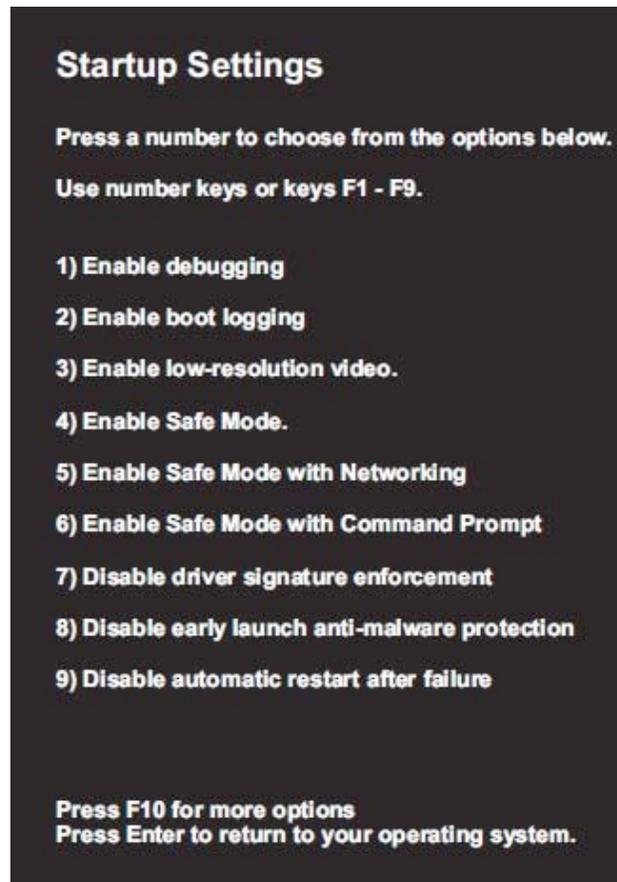

**Press F7 or number 7 key** on your computer keyboard when you see the screen as shown above. This will disable the Driver Signature Requirement. After you press F7 or 7 key your computer will start launching the operating system. After your operating system is launched follow the normal login procedure and install LinkMotion driver by following the installation instructions from the documents provided by Solustan.


**If for any reason you had to restart your computer before installing LinkMotion you need to start the Disable driver signature enforcement procedure again before you can install LinkMotion. LinkMotion printer driver will be installed only if this procedure is followed properly.**

## Disable Driver Signature Requirement under Windows 8.1:


Open the Charms Bar in Windows 8.1 by bringing the arrow of your mouse on the bottom right corner of your computer screen and **select Settings** (first at the bottom) as seen in the picture below.




Once Settings is selected you will see the following screen and **select Change PC Settings** as shown below.

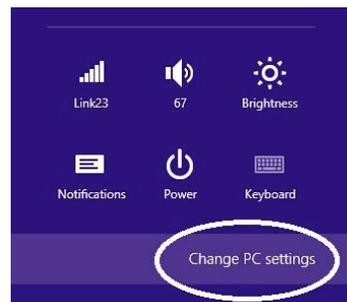

**Under Win 8.1** when Control Panel opens, select **Update & recover** section from the left side as shown in the picture below.

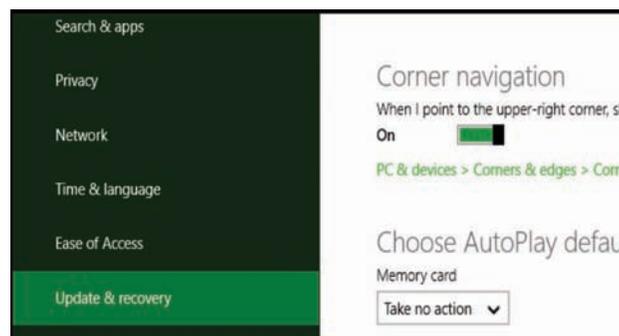

**Under Win 8.1** Click on the **Recovery** option on the left side as shown in the picture below. Once selected, you will see an **Advance startup** section on the right side. You will need to click on **Restart now** button.

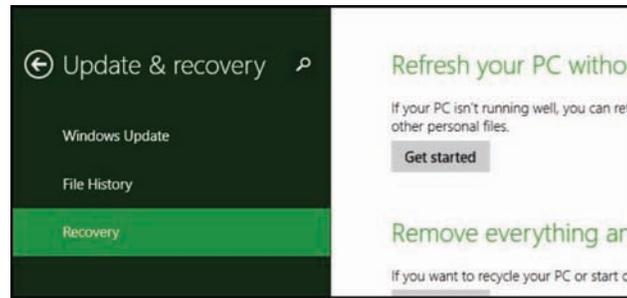


**Now your computer will restart.** Once the Computer has restarted, **Choose an Options** selection will be available. Here **select Troubleshoot**.

Select **Advanced Options** under **Troubleshoot** selection.

Select **Startup Settings** under **Advanced Options** selection.

Select the **Restart** button from the bottom right under **Startup Settings** selection.

Now Computer will restart again and you will see a screen for **Startup Settings** with many selections available listed with numbers One through Nine as shown in the picture below.

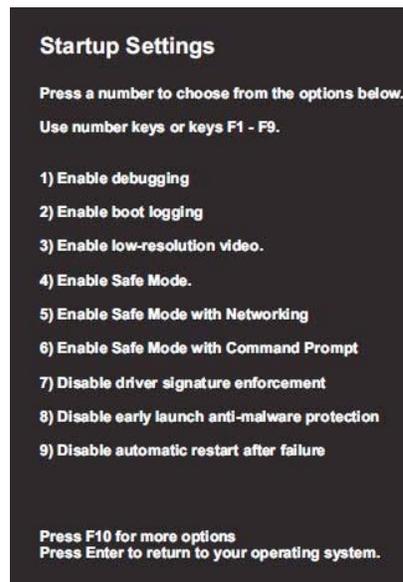

**Press F7 or number 7 key** on your computer keyboard when you see the screen as shown above. This will disable the Driver Signature Requirement. After you press F7 or 7 key your computer will start launching the operating system. After your operating system is launched follow the normal login procedure and install LinkMotion driver by following the installation instructions from the documents provided by Solustan.


**If for any reason you had to restart your computer before installing LinkMotion you need to start the Disable driver signature enforcement procedure again before you can install LinkMotion. LinkMotion printer driver will be installed only if this procedure is followed properly.**

## **Disable Driver Signature Requirement under Windows 8:**


Open the Charms Bar in Windows 8 by bringing the arrow of your mouse on the bottom right corner of your computer screen and **select Settings** (first at the bottom) as seen in the picture below.




Once Settings is selected you will see the following screen and **select Change PC Settings** as shown below.

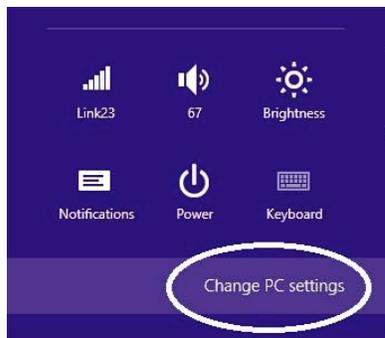

**Under Win 8 select General** from the left side as shown in the picture below.

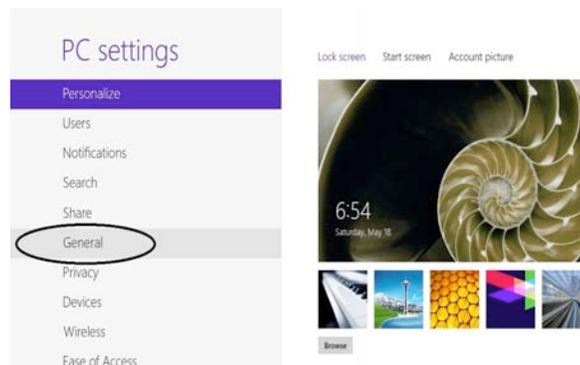

**Under Win8 Scroll to the bottom of General and select Restart Now under Advanced Start-Up** from the right side as shown in the picture below.

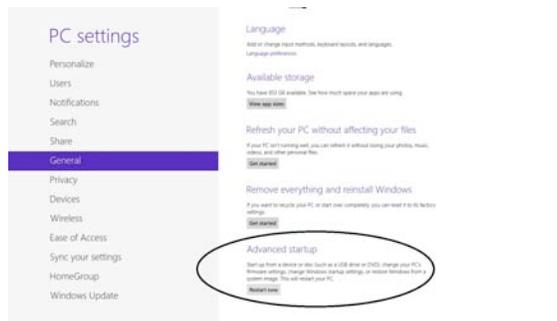


**Now your computer will restart.** Once the Computer has restarted, **Choose an Options** selection will be available. Here **select Troubleshoot**.

Select **Advanced Options** under **Troubleshoot** selection.

Select **Startup Settings** under **Advanced Options** selection.

Select the **Restart** button from the bottom right under **Startup Settings** selection.

Now Computer will restart again and you will see a screen for **Startup Settings** with many selections available listed with numbers One through Nine as shown in the picture below.

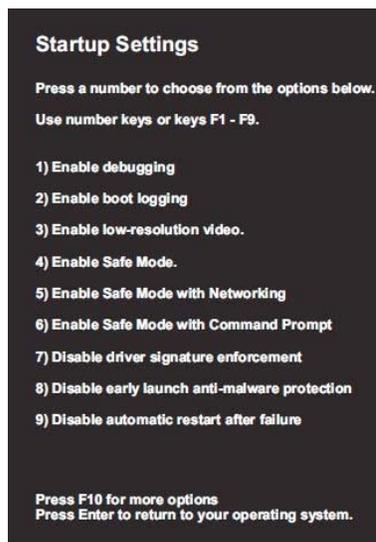

**Press F7 or number 7 key** on your computer keyboard when you see the screen as shown above. This will disable the Driver Signature Requirement. After you press F7 or 7 key your computer will start launching the operating system. After your operating system is launched follow the normal login procedure and install LinkMotion driver by following the installation instructions from the documents provided by Solustan.

**If for any reason you had to restart your computer before installing LinkMotion you need to start the Disable driver signature enforcement procedure again before you can install LinkMotion. LinkMotion printer driver will be installed only if this procedure is followed properly.**

## Installation for LinkMotion driver software for Co2 Laser:

(1) After downloading the LinkMotion driver software, unzip the files and save by creating a folder name LinkMotion. Now **double click on the file name “LinkMotion\_Laser64\_Setup.exe” for a 64-bit version or “LinkMotion\_Laser32\_Setup.exe” for a 32-bit version or “Setup.exe”** and installation will begin.

(2) Click on the Next Button.



(3) Click on the **Next Button**.




(4) When you get to the License Agreement dialog (see above), **you must read the agreement. If you agree, go ahead and click the radio button “I Agree”** for the installation process to continue and Click on the **Next Button**.



(5) After you have read and agreed to the License Agreement, you will be asked to specify the installation folder. In most cases, you can leave this as the default setting.

(6) Click on the Next button once again and you should see a progress bar for installation.

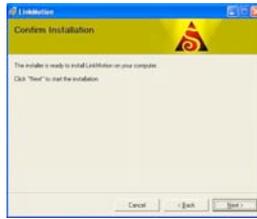

(7) Later during the installation, you will see **Choose your machine** for installation. The default machine name is **My Machine**. Scroll on the arrow to the right and many more machine names are available. Please choose your machine name. **If you wish to add your machine name that you do not see here, Please contact us.**


**Do not create or write your own new machine name here at the time of this installation.**



(8) You will see a message shown below before this installation is complete. Here **select Install this driver software anyway** to make sure that LinkMotion printer driver for your machine gets installed properly. **Name of the printer driver will be the name of the Machine you select from the above selection. Sometime this message may appear in the background of another message and you need to make sure to bring it to the foreground for Installing this driver software anyway is done. It will not install the printer driver if this was not followed properly.**



(9) The message displayed below is a reminder to Re-launch Linkmotion one time after installation is finished for the driver to be recognized properly and Click on the OK button here. **Make sure to click on the OK button after you click on the "Install this driver software anyway".**

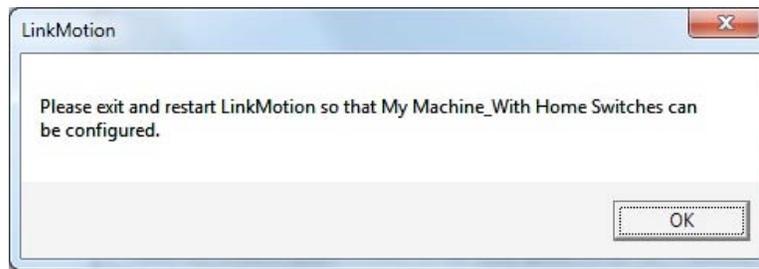

**(10) Click "Close"** when the installation is complete as shown below.



The icon shown below should show up in the system tray at the bottom right. If LinkMotion icon does not show up in the systems stray in case of Win 7 follow directions from below and setup to view that icon all the time.

Go to **Control Panel** of windows from the **Start button**. Click on the **Appearance and Personalization**. Go to the **Taskbar and Navigation(Win 10)**, **Taskbar(Win 8)**, **Taskbar and Start Menu(Win 7 and XP)**. Click on the **(Notification area on Win 10) Customization on the taskbar**.

**Win 10** - Click on **Select which icons appear on the taskbar**. Here check **LinkMotion icon** to be on.

**Win 8, 7** - Here click on the box at the bottom left for **Always show all icons and notifications on the taskbar**. Click on the **OK button**.



**To view all different files and folders that are installed for LinkMotion one more setup is necessary using following directions in Win 10, 8 and 7:**

Go to **Control Panel** and click on the **Appearance and Personalization**.

Under **Folder Options** Click on the **Show Hidden files and folders**.

In the View section, look for **Hidden files and folders**.

If not checked already, check the button for **Show hidden files, folders and drives**.

Click on the **Apply button**. Click on the **OK button**.

**(11) Power Option Settings:**

**Windows 10, 8 and 7:** Windows 10, 8 and 7 operating system disables USB port connections when it is in power save or screen saver mode. Following settings will keep USB port always active. Please make sure to set this up properly. Power save mode can be turned off.


Go to **Control Panel > Click on Hardware and Sound > Under Power Options Click on Change when the computer sleeps(Win 10, 8 or 7), Change Power-Saving Settings(Win 10, 8 or 7) > Balanced** is selected by default. On the right **Click on Change Plan Settings(Win 10, 8 or 7) > Select Never** for put the Computer to sleep by scrolling on the arrow. **Click on the Change advanced power settings** from below > **Double click** on the **USB Settings > Double click** on the **USB Selective Suspend Setting > Click** on the **Settings** and Select **Disable** (for Desktop computers) or **Select Disable** for **On battery** as well as **Plugged in** (for Laptops) > **Click** on the **Apply** button and **Click OK**.

**Windows XP:** Go to **Control Panel > Power Options > Under Power Schemes** select **Never** for **System Standby** as well as **System hibernates** and **Ok** will save this setting.

### **(12) Setting up the Default Printer:**

You want the LinkMotion printer to be your default printer. Open the Control Panel > View devices and printers(Win 10, 8 or 7) or Printers and Faxes menu(Win XP) and find under **printer “My Machine-USB”** name as shown in the picture below. **Right-click on this printer and select "Set as Default Printer"**. **This name may be different if you selected your machine name. We give you a choice for selecting the machine name at the time of the installation with a scrolling arrow on the right side.**

**Do not create or write your own new machine name here at the time of this installation.**

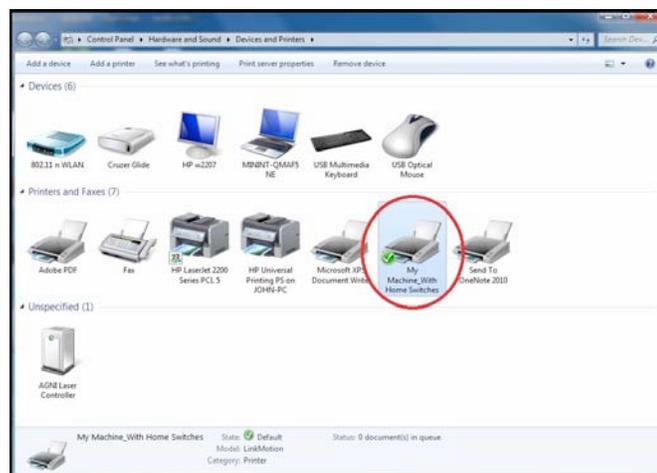

### **(13) Multiple users:**

**Under Windows 10, 8.1, 8 and 7 LinkMotion version 4.06 onwards allows multiple users to use LinkMotion for the same computer.** Installation of the LinkMotion.INI and temp.txt file locations have been moved to the following locations:

**C:/ProgramData folder > Solustan folder > LinkMotion folder > LinkMotion.INI file and BMP files.**

**C:/ProgramData folder > Solustan folder > LinkMotionUSB folder > Tempfiles folder > temp.txt file.**

**The Previous user should always log off before another user logs on and starts using LinkMotion.**

**Under Windows XP version 4.06 onwards, LinkMotion.INI and temp.txt files are installed in the following locations:**

C:/Document and Settings folder > All Users folder > Solustan folder > LinkMotion folder > LinkMotion.INI file.

C:/Document and Settings folder > All Users folder > Solustan folder > LinkMotionUSB folder > tempfiles folder > temp.txt file.

**Windows XP has the limitation to allow only one user to use LinkMotion properly. Please make sure to install properly for one user.**

**(14) International Customers need to check following:**


If you are using Windows operating system for other languages please make sure that following settings are selected for LinkMotion to work properly.

**Win XP:** Go to the **Start button > Control Panel > Regional and Language Options > Click on the Customize button.** Here Decimal Symbol should be (Full stop or Period) selected. Do not select comma. If you had to change **click on the Apply button and Click OK.**

**Win 10, 8 users need to figure out to see the Control Panel and then follow Win 7 instructions.**

**Win 7 32/64:** Go to the **Start button > Control Panel > Clock, Language, and Region > Click on Change input methods(Win8) or Change keyboards or other input methods(Win7) > Select Format tab(menu) > Click on the Additional settings button.** Here Decimal Symbol should be (Full stop or Period) selected. Do not select comma. If you made any change it is important to **click on the Apply button and Click OK.**

You are done with all settings for windows. LinkMotion installation procedure is complete and **now follow the USB controller driver installation procedure.** When USB controller driver is not installed, LinkMotion will not find the controller so you will see the following message if you launch LinkMotion. Once the USB Controller driver is installed properly you will not see this message when you launch LinkMotion.

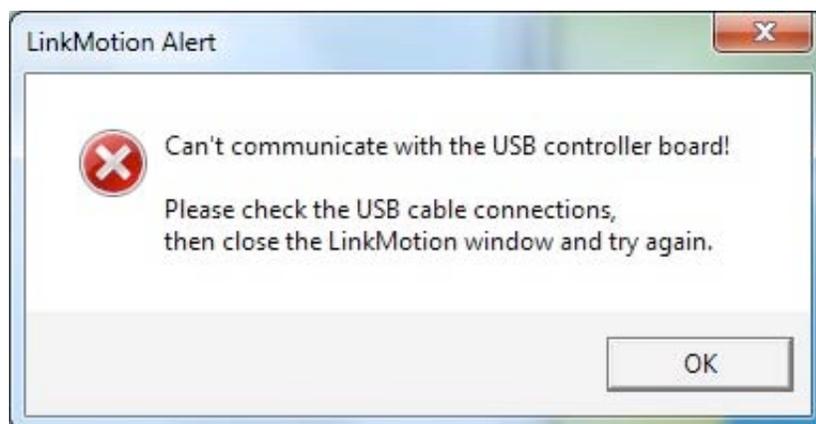

**Re-Launch LinkMotion:**

**It is extremely important to Re-Launch LinkMotion first time after installing and then if you replace or change LinkMotion.INI file for it to be effective. It is also important to Re-launch when you change the machine's table size or DPI selection for LinkMotion USB Laser product.**

**Exit the LinkMotion (icon) applet with a right mouse click from the systems tray at the bottom right. LinkMotion icon should go away from the systems tray.**

**Now launch it back again by following and selecting the path Windows Start button>Program Files or All Programs >Solustan>LinkMotion by the arrow of your mouse.**

## **Uninstalling LinkMotion:**

### **Please make sure of the following before you uninstall:**

Your specific machine related settings are saved as **LinkMotion.ini** file. This file can be **saved** from **General Options Menu** and simply click on the **Save button**. It is preferred that you give this file a unique name and save it properly to make it easy to retrieve it in future. Different users can save under different names. Similarly, you can **Load** that file back after another installation of LinkMotion by going to the General Options menu in LinkMotion and clicking on the **Load button**. Restore Default button allows you to load default original INI file that is supplied with LinkMotion. **It is very important to exit LinkMotion applet and Re-launch the applet when you make any changes for it to be effective. Understand the definition of Re-Launch from below.**

### **Please make sure of the following before you Re-Install:**

LinkMotion is a Windows compatible driver. It does not need to install or uninstall frequently. However, if it is required to re-install the driver, the following are useful pointers to remember.

There is not an easy way to remove and install another version of the driver in Win XP operating system. It is necessary to go through uninstall described in our documents. Additionally, there may be a Need to manually remove Files from various Windows directories on the PC.

Both, Win 10, 8, 7 32 and 64-bit versions are well organized to make fresh installations of the same or newer versions of LinkMotion.

1. It is not proper and will not help to uninstall and install the same version of the LinkMotion one after another if you find it to be not working properly.
2. Windows 10, 8 and 7 does not allow removing of an installed driver and re-installing of the same driver unless necessary changes are made to the driver installation software.
3. In case of going back and forth between earlier and newer driver software, the system may be armed with incompatible versions of the driver and applet. This is likely to cause more problems.
4. Once a driver is installed in Win 10, 8 and 7 system, it is permanent. The driver cannot be unloaded easily. The operating system is more robust and more stable as a result.
5. The best thing to do is to understand the structure of the driver. It is dictated by Windows and Microsoft websites can be very useful in understanding drivers.
6. We will only discuss what is important here. Every driver is made available with an LMVC64\*.inf file. This file controls the installation of the driver.
7. Once you install a LinkMotion driver, a driver instance is created in the appropriate folders of Windows 10, 8 and 7 system. If it is needed to re-install LM USB or LinkCAM, take the following steps:
  - A. Open the file LMVC64.inf in any editor.
  - B. Find the line "DriverVer=06/24/2011,1 " with the date and installation number.

- C. If possible, change it to today's date.
- D. If it is the same date, change the number at the end of the line.
- E. Save the file.
- F. Now, when you uninstall, the older installation, it will remove applet and other files. However, it will archive the last version of the driver.
- G. The new installation will install a new version of the driver as long as the date or the instances are different and newer than the previous installation of the driver.
- H. There is going to be matching driver and applet in the system.
- J. It is important to make sure that the firmware in the USB controller matches the proper version of the LM software.

**Uninstall LinkMotion Procedure:**

Make sure the LinkMotion applet is closed. Open the **Start menu** and select the **Control Panel**. Double-click on **Add or Remove Programs**. Look for LinkMotion entry in the list and click on that. **Select "Remove" and answer "Yes"** when it asks you if you really want to remove LinkMotion.

**LinkMotion.INI file (configuration file) does not get deleted by uninstalling procedure.**

**If you want to delete your existing INI file following is the procedure for Win 10, 8 or 7:**

**LM version 4.06 and higher:** C:/ProgramData folder > Solustan folder > LinkMotion folder > LinkMotion.INI file and BMP files.

**LM Version 4.05 and lower:** In the C:\ hard drive Find folder name **Users> Folder with users (your own name) name> Folder name AppData> Folder name Roaming>Folder name Solustan> Folder name LinkMotion> LinkMotion.INI. Delete this file.**

**If you want to delete your existing INI file following is the procedure for Win XP:**

**LM version 4.06 and higher:** C:/Document and Settings folder > All Users folder > Solustan folder > LinkMotion folder > LinkMotion.INI file.

**LM Version 4.05 and lower:** In the C:\ hard drive Find folder name **Document and Settings> Folder with users (your own name) name> Folder name Application Data> Folder name Solustan> Folder name LinkMotion> LinkMotion.INI. Delete this file.**

**Read and understand detail LinkMotion Control pad warnings and AGNI USB Controller warnings in the following pages and Laser warnings from the full manual before operating your LinkMotion driver software for CO2 Laser product and your Laser machine.**

## Warnings for LinkMotion Control Pad:

1. Use the 'Zero (Ins)' key on your Numeric Key Pad or quickly press 'Space Bar' to Pause the machine operation. LinkMotion needs to be in the foreground and in an active mode when Pause operation is exercised using PC keyboard. Spacebar pressed for a long time will also pause the job in a momentary mode where the job will continue when Spacebar is released. When Pause activated with zero or quickly pressed space bar, a message box will come up for a decision to Continue or Quit the job. (Sometimes this message box is on the back of your Control pad and you may have to bring it to the front simply by clicking on the system tray's active LinkMotion application.) At this point, make the necessary selection. Click YES to continue the job or No to stop the job completely. After you select NO you will see another dialog box asking you if wish to quit and stay in the position you are or you wish to go back to X, Y (0, 0) position. Make your selection and park your laser head properly.
2. When pause is called for during a raster (engrave) operation, the pause will not take place until the laser beam reaches one of the ends of the active scanning line.
3. Control Pad for LinkMotion allows only one direction movement at a time. Only use your computer keyboard (numeric keypad) for these movements. Do not use a mouse and click on the arrows of your Control pad screen. If you do, it will activate the 'nudge' feature.
4. A single mouse click is used to exercise the 'nudge' feature. The mouse may be used for just a few Control Pad functions. These are,
  - Click Home button to activate the home sequence.
  - Click Repeat button to repeat the previous job.
  - Click one of the Pause buttons to pause the job processing operation
5. Once a job is sent or you have activated the LinkMotion applet, it shows up in the bottom bar where active applications are displayed.
6. **Repeat Key** from Control Pad (either of the Enter keys from computer keyboard) will process immediately the last job sent to the controller without sending the job again from the PC to the controller.
7. **Wireless keyboard and wireless mouse should be checked fully before using them. One of the possible problems with the wireless keyboards is that Control pad keys may not send out information fast enough for the machine to move properly.**
8. We have done preliminary testing with a wireless control pad and most keys function well when an individual key is pressed. When two keys are pressed together, it may not work properly. An example is pressing one directional key 6 to move the X-axis going to the right and then try pressing key 5 while holding down the key 6 to make it go faster may not work well.
9. Design using plate size in the Materials Properties Tab is fully tested only with Corel Draw. If you are using any other design application you need to test before you start using the feature.

### 10. IMPORTANT FEATURE


It is possible for the user to turn on the laser power from the Control Pad for testing purpose only. LinkMotion will turn on and off the laser power, when required, during processing of an actual job. The turning on and off the power from the Control Pad is only for testing purposes like checking the actual power v/s calculated power, measuring power level for PWM pulses, making a temporary park on the material, etc.

**Have the Control Pad in the foreground on the PC screen.**

**Hold down the I/O 1 key of the numeric keypad with a finger. Keep it down.  
Note a message on the screen that warns you whether you really wanted to turn ON the power.  
Click NO if you did not mean to turn ON the power with a mouse click.  
Click YES if you wanted to turn ON the power.**

**As soon as you click YES, the power will be ON as long as you keep your finger on the I/O 1 key. The power level and frequency will be selected from the black color settings in the Materials Tab of the control pad.**

## Control Pad for LinkMotion

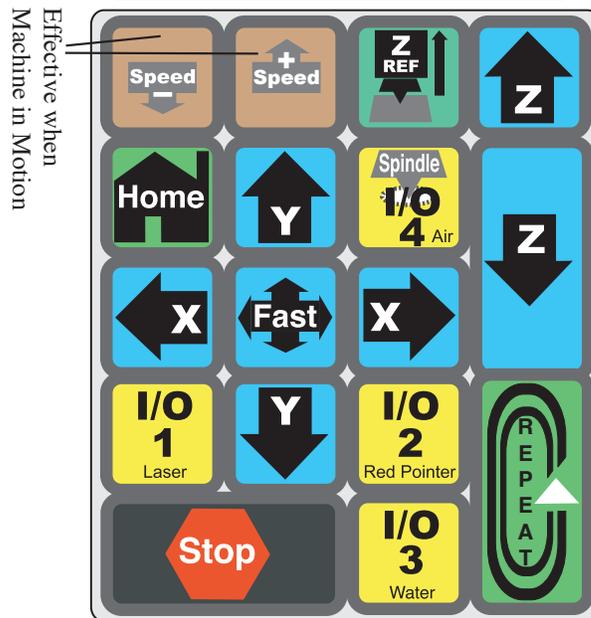

All the keys are active when LinkMotion Control Pad is in foreground on the screen **except the keys for Speed + (Up) and Speed - (down)**. Speed Up and Speed Down keys are effective when job is in process and machine is moving. Speed up key will not go to any higher speed then what you have declared in the Job feed rate of Materials Menu.

When jogging X and Y axis and pressing the Fast Key at the same time will double the speed of jogging. Typically, when jogging action takes place, the jogging speed will be 50% of the declared jogging speed in the Materials Menu of LinkMotion. Upon depressing Fast Key while holding down the directional key for jogging, the machine will jog at full speed or twice the speed of normal jogging.

**Use Zero key or Quickly pressed Space Bar of your keyboard to Pause. Control Pad needs to be in the foreground and active mode for pause to be effective for LinkMotion product. Space bar pressed for a longer time will also pause the job but it will pause in a momentary mode where job will continue when Space bar is released.** When Pause activated with zero or quickly pressed space bar, you will see a message box asking you if you want to **Continue or Quit the job**. Sometimes this message box is in the back of your Control Pad and you can bring it to the front simply by clicking on the systems tray's active LinkMotion application. **Click Yes to continue the job or no to stop the job completely.** If you selected no and job was stopped, it will also ask you if you wish to stop where you are or you can select to go back to the starting position. **Repeat Key** will process immediately the last job sent to the controller without generating and then sending the job again from the PC to the controller.

**WARNING: Do not use the arrow keys elsewhere on the keyboard in place of the Control Pad Keys. It may cause unpredictable results.** Do not keep Num Lock key pressed or do not click many times at a fast speed. You need to gently press and release and observe the speed increase or decrease. **Wireless keyboard and mouse are not recommended.** In case of wireless, Control pad keys do not send out information fast enough for machine to move properly. We have done preliminary testing with wireless control pad and most key functions work well when individual key is pressed. When two keys are pressed together it does not work. An example - Press one directional key 6 to move the X axis going to the right and then press 5 key to make it go faster. **May not work well with the wireless keyboards.**

## **Part 2 – Installing USB driver for AGNI Controllers:**

### **A: Installing WinUSB driver on Windows OS 8 and 10 for New AGNI III Controller Series 20000:**

Windows 8 and Windows 10 are shipped with proper and flexible USB drivers.

1. Connect the new Agni Series 20000 Controller to a USB connection on the PC with one of the above operating systems.
2. The operating system will inform you that it is looking for the proper USB drivers to invoke and install necessary resources.
3. It may take a while based on the speed of the PC. It will announce that the resources are found and the USB device is ready for the operation.
4. That is all there is to it.

Once the USB driver is installed, the name USB device will change to Machine Link II. This name is assigned to Solustan's controller. From now on, every time the controller is connected to the USB connector of the PC, the Device Manager will bring up the Machine Link II and will establish the connection at the USB level. This procedure only needs to be done once.

The LinkMotion printer driver will use the USB device driver to communicate with the Agni controller. It is important to understand that various parts are installed for the LinkMotion to perform its tasks.

1. USB Device Driver
2. LinkMotion Printer Driver
3. LinkMotion User Interface and Control Pad.
4. Corel Draw type design application.

**Now follow Confirming the USB Driver installation after the Win7 USB Diver instructions.**

### **B: Installing WinUSB driver on Windows OS 7 for New AGNI III Controller Series 20000:**

Win7 ships with the correct 'winusb.sys' file, but is missing an updated '.inf' file that associates the driver with "usb\ms\_comp\_winusb" devices. Normally if the USB device supports Microsoft OS descriptors, then it will allow Windows to automatically install the WinUSB driver. This mechanism is supported "in-box" for Win8 and newer. For Win7 the mechanism is supported through Windows update. Depending on the update policy for the Win7 machine, the appropriate driver may or may not be already available on the machine. If it is not already on the machine, user can use the following manual procedure to install the driver if necessary.

1. Search for "windows phone winusb" at [Microsoft®Update Catalog|<https://www.catalog.update.microsoft.com/Home.aspx>].
2. Download "Windows Phone - Other hardware - WinUsb Device".

NOTE:

Solustan took care of the above two steps. Downloaded the software and attached it herewith.

3. Extract the contents of the downloaded '.cab' file to a temporary folder. In other words unzip it.
4. Open the Windows Device Manager on the PC screen.
5. Connect the Agni II controller to any USB port on the PC. Note that a new USB Device is added under the listings of the USB (Universal Serial Bus) controllers.
6. Right Click the mouse to the new Device line in the Device Manager and select "Update driver software ..." -->
7. When choices show up, select "Browse my computer for driver software".
8. Navigate to the temporary folder with the downloaded driver to complete the installation.

Once the USB driver is installed, the name USB device will change to Machine Link II. This name is assigned to Solustan's controller. From now on, every time the controller is connected to the USB connector of the PC, the Device Manager will bring up the Machine Link II and will establish the connection at the USB level. This procedure only needs to be done once.

The LinkMotion printer driver will use the USB device driver to communicate with the Agni controller.


It is important to understand that various parts are installed for the LinkMotion to perform its tasks.

5. USB Device Driver
6. LinkMotion Printer Driver
7. LinkMotion User Interface and Control Pad
8. Corel Draw type design application.

**Now follow Confirming the USB Driver installation from the next page.**


## Confirming the WinUSB driver installation for new AGNI III Controllers Series 20000:

Now confirm proper connection to this new USB Controller device by going to the Device Manager of Windows as shown in the following picture.

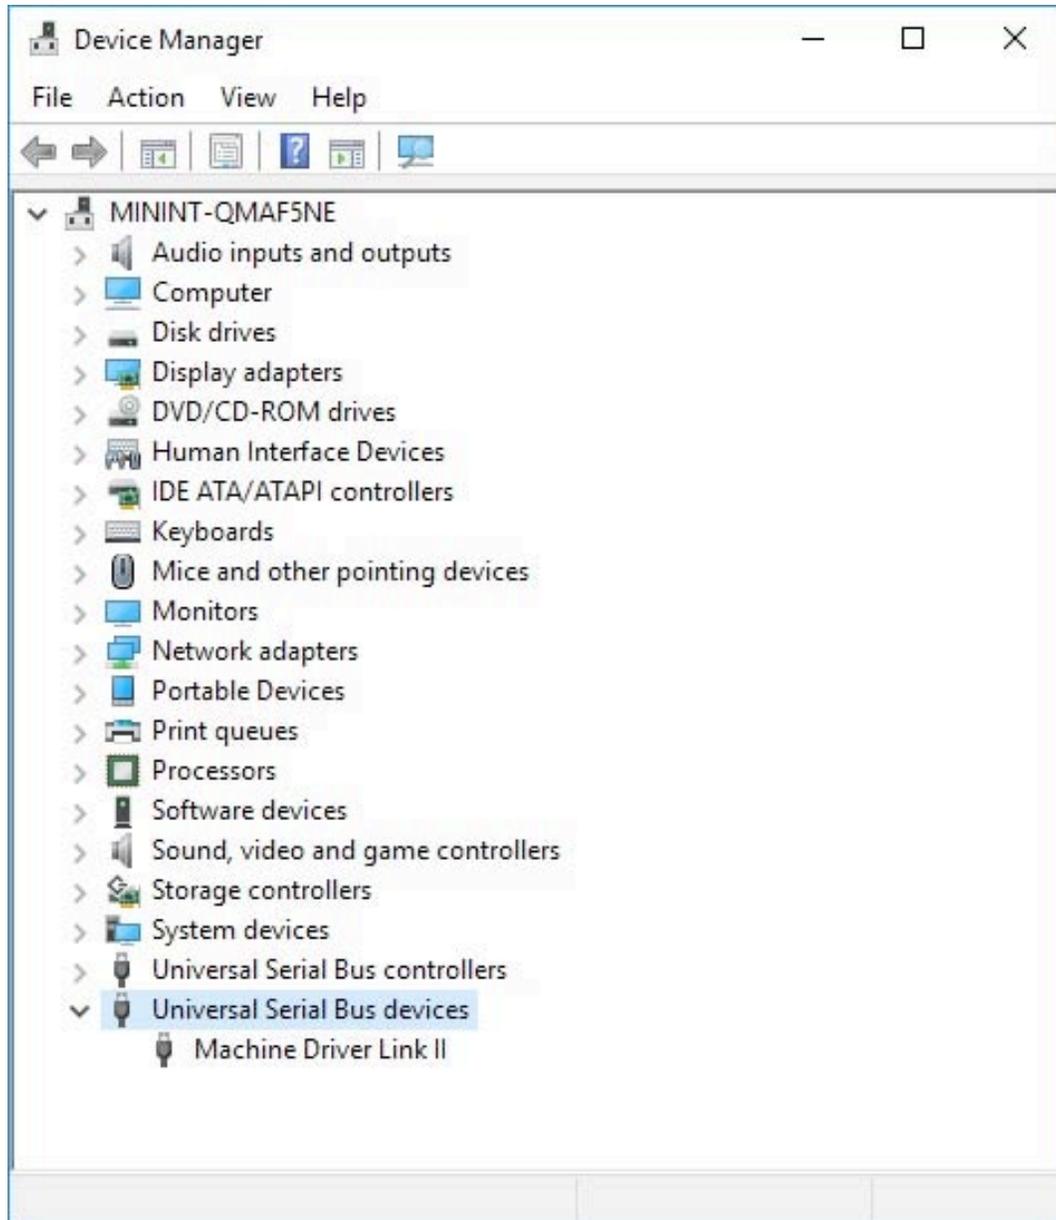

Name of the device once installed will show as “WinUsb Device” and it will show the proper name “Machine Driver Link II” after the restart of the operating system. As long as it is connected properly it will display any one name. **If windows standard USB device driver is not properly installed it will not display this name and will not communicate with new AGNI USB Controller.** Please make sure and install proper driver for USB device.

**Another way to confirm under Devices of Windows Devices as shown in the picture below:**

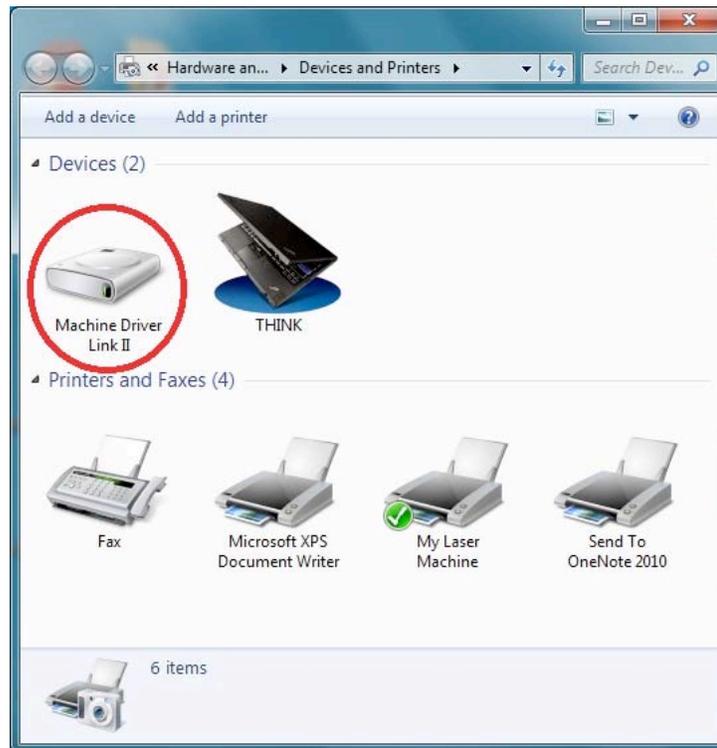

### **IMPORTANT INFORMATION:**

**After installation of LinkMotion software and proper USB device driver, when you connect the AGNI USB controller it should display a windows standard message about recognizing new USB device. Always make sure you see this message, close that message and then launch LinkMotion. It will not connect with this USB Controller properly if you do not follow proper procedure.**

**Re-Launch LinkMotion** means exit LinkMotion Icon from the systems tray on the bottom right by right mouse click and then launch it back on the systems tray by going to the Windows start button and All programs, Solustan, LinkMotion.

## **Warnings for New Agni III USB Controller board Series 20000:**

1. Plug the LinkMotion controller cable directly into your computer's USB 2.0 connection.
2. It is important to experiment and determine that the USB controller works with the USB hub or extension device if the user plans to use such a device.
3. This USB controller does not work with USB1.1 connections. If you connect other USB devices compatible only with 1.1, it may cause problems. All the USB devices including keyboard and mouse in the system shall comply with 2.0 specifications. Always check compatibility for wireless USB devices, if you are using one.
4. Power saver and Screen Saver modes on your computer should be turned off. If these modes are activated, it can cause problems in recognizing the USB connection on a continuous basis.
5. The LinkMotion USB controller can be configured to power either from the USB connection of the PC or from an external 5 VDC power supply. There is a jumper on the controller board that allows the selection of the power supply for the controller.
6. In case of Laptop computers, AC power unit shall be connected to an AC outlet while operating external USB devices. Sometimes, aggressive power save mode settings under battery operations could activate the disconnection of USB devices. Re-Launching LinkMotion will re-activate the communication in such a situation.
7. Approximately 1 minute of machine operation uses 1MB of SD memory for vector work. This controller supports up to 4GB Memory. If you are using LinkMotion version 3.5 or higher, you could use either SD or SDHC memory cards.
8. It is impossible to test all the available SD Memory cards in the market but we have listed in the following lists ones that work and ones that do not work with this USB controller.

Memory chips tested and working with this controller: Sandisk 4GB, PNY 4gb SDHC, Samsung 1gb, Transcend 1gb and 'Made in China Generic' 1gb.

Memory chips found not working with this controller: Kingston 2gb (not SDHC) and 4gb SDHC.

9. If serial number of the controller is not recognized by LinkMotion then user will see a message "Unrecognized serial number \_\_\_\_\_". Once you click on OK button it will display the second message as "The maximum working area is 1"x1" or 25.4mm x 25.4mm. LinkMotion software can output only 1"x1" jobs at that point. Unauthorized controller bought from unauthorized vendors can cause this kind of problem. Get in touch with Solustan to verify your serial number. Not making proper USB connection with the controller can also display this kind of message and simply disconnecting USB cable from computer end and reconnect and re-launch LinkMotion should resolve it.

### **10. USB Controller Board Lights:**

There is only one LED lights available to attach to the new Agni Controller board Series 20000 – Blue. This light will behave in the following manner when connections are made and the board is powered:

**Blue LED** – Steady Blue light means USB powered up and ready. If blue light flases fast it means it is waiting to make the USB connection. At this point, If you launch LinkMotion app it should become steady. If Blue light is flashing slowly it means it is in boot load mode.

We have an additional programmable LED connections available. We will inform you as we add more LED and its functions.

## **C: Install USB Driver for Older Agni II Controllers series 10000:**

Do not plug the USB controller using the USB cable until it is asked for in the instructions. Always plug the controller directly into your computer's USB 2.0 connection when instructed.

If the controller is plugged into the PC via USB hub or other extension devices, it is important to note that the third party devices should meet USB 2.0 specifications. If the hubs or other extension devices cause problems, connect the controller directly to the PC to isolate USB related problems.


### **Installing AGNI USB Controller driver for Win 10, 8, 7 - 32 or 64 and Win XP Operating System:**

Make sure your LinkMotion CD is on the computer. If you receive the software from the internet you should unzip and find a folder name USB Controller Driver and follow the instructions from step (3).



**(1) Go to the start button** of Windows at the bottom left and **Click the right mouse button and select Explore.**


**(2) Navigate and select LinkMotion CD** and the folder name **USB Controller Driver** from software you received from us. **Select and open a USB Controller Driver folder** from the right side.

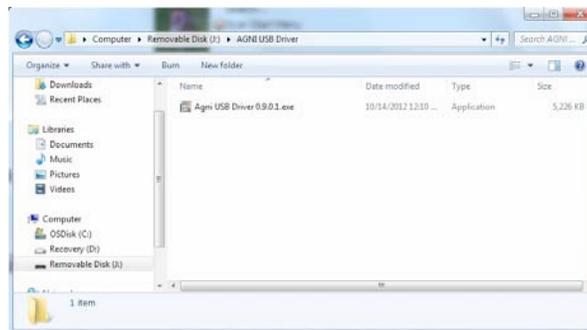

**(3) You will see a file name AGNI USB Driver 1.0.0.0.exe** as shown in the picture above. **Double click on this file** and it will start installing the driver. Your computer setup may ask for special permission to install unknown vendor and you can **click on the Yes button** to start.



(4) You will see the following two screens as installation is in process. Click on **Install button** on the second screen for Windows Security.

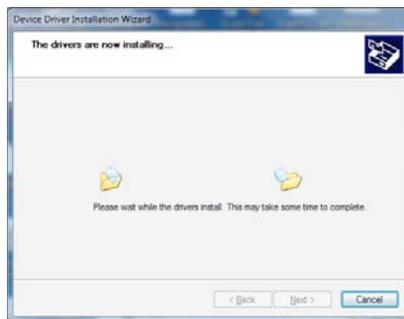


(5) When you see the dialog box for Device Driver Installation Wizard, **click on the Next button**. It just takes a few seconds to install the USB driver. When the installation is finished you will see the following screen and click on the **Finish button**.



(6) **Now plug in the USB cable**. When you plug the USB cable into the computer you will see a message for found new hardware at the bottom right in the systems tray or the screen. Double Click and open it.

**The dialog box is shown in Windows 10, 8, 7:**

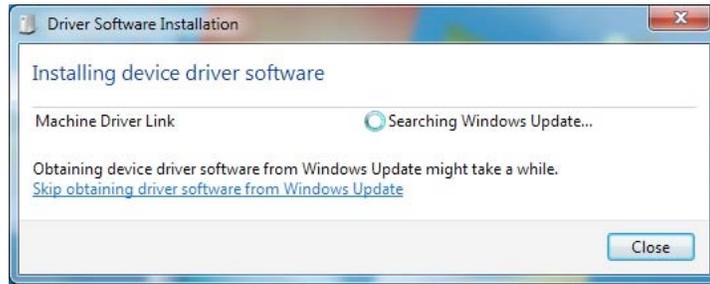


**The dialog box is shown in Windows XP:**



(7) On Win 10, 8 and 7 first dialog box shown above will be displayed and it can automatically search and then install the driver from your computer. The user can save time by clicking on the message **Skip obtaining driver software from Windows Update** and click Yes on the next message (picture not shown). On Win XP Found new hardware wizard dialog box shows up and make sure to check the button for **Install software automatically (Recommended)**. **Click on the Next button.**

You will see the installation procedure collecting and installing the necessary files in proper locations.

**The dialog box is shown in Windows 10, 8, 7:**

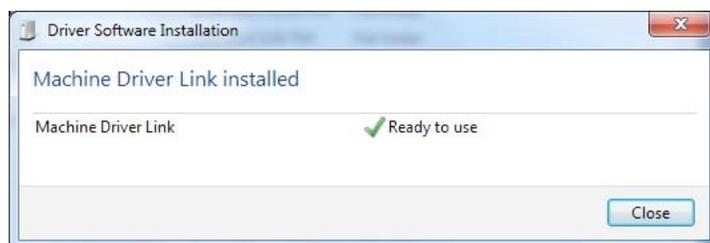

**The dialog box is shown in Windows XP:**




(8) When it finishes automatic installation you will see the message shown above for Win 7, 8 and 10. **Click on the Close button. On Win XP it displays different display and clicks on the Finish button here.**

(9) The proper installation of 32-bit AGNI USB Controller driver “ **AGNI USB Controller** ” driver can be checked and confirmed if the device will work properly in the **Windows Device Manager**.

Properly installed **AGNI USB Controller** under **Device Manager** will show as **Solustan Machine Controller** and **Machine Driver Link** under that. Double click on **Machine Driver Link** and it should show you a message **This device is working properly** if it is installed properly. **This is a driver for Communication with the USB Controller and it is not a printer driver.**

**Under Win 10, 8 and 7 users can see it installed as shown in the picture below in Hardware and printers area. This driver does not display on the Windows XP operating system.**

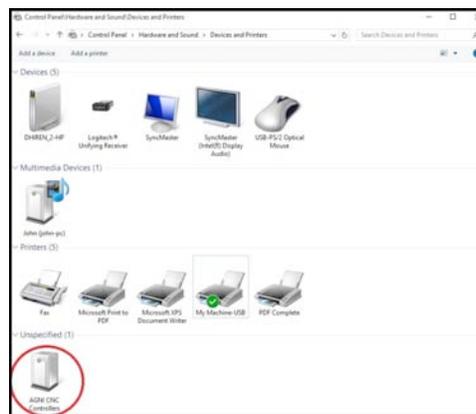

If it is not installed properly please make sure to check your cable connection, follow proper procedure or contact Solustan.

(10) **Remember to plug in the compatible SD memory card into the USB Controller card.** Approximately 1minute of machine work uses 1MB of memory. This controller supports up to 2GB Memory. **We have provided the list of SD memory we have done testing with.**

**If you are installing for the first time you do not need to worry about next step for updating the firmware. We ship all USB controller boards with the latest firmware.**

**(11) Firmware update for AGNI USB Controller board:**

**This procedure is necessary only when an updated firmware or updated LinkMotion driver software is provided with the package.**

**Exit LinkMotion from the bottom right by right mouse click on the LinkMotion Icon. Now disconnect USB cable from the computer end, wait a minute and re-connect back one time. Firmware update requires USB controller board connected to the computer.**

Double click on the file name **AGNI Updater 3084.exe** or with the latest number that we have provided. Click on the big button **AGNI FirmwareUpdater 3060**. This will take a few seconds and when it is done updating it will give you a message **Update Successful**. Click on the **OK** button and **unplug and replug the USB cable to recycle the power for USB Controller** and you are done with the firmware update.

If you are simply updating the USB controller board firmware or updating the LinkMotion driver version then you will simply need to exit the LinkMotion applet by right mouse click and Re-Launch it from the Start menu and start working with it again.

**Make sure and understand the LinkMotion driver features and then start working on your machine. It is always a good idea and a good practice to turn on the PC first and your controller/driver module later. In the same manner, it is always a good Idea to turn off the PC last when you switch off the system.**

## Warnings for Laser/Agni II Controller series 10000:

1. Plug the LinkMotion controller cable directly into your computer's USB 2.0 connection.
2. It is important to experiment and determine that the USB controller works with the USB hub or extension device if the user plans to use such a device.
3. This Laser/Agni controller does not work with USB 1.1 connections. If you connect other USB devices compatible only with 1.1, it may cause problems. All the USB devices including keyboard and mouse in the system shall comply with 2.0 specifications. Always check compatibility for wireless USB devices, if you are using one.
4. Power saver and Screen Saver modes on your computer should be turned off. If these modes are activated, it can cause problems in recognizing the USB connection on a continuous basis.
5. The LinkMotion Agni controller can be configured to power either from the USB connection of the PC or from an external 5 VDC power supply. There is a jumper on the controller board that allows the selection of the power supply for the controller.
6. In case of Laptop computers, AC power unit shall be connected to an AC outlet while operating external USB devices. Sometimes, aggressive power save mode settings under battery operations could activate the disconnection of USB devices. Re-Launching LinkMotion will re-activate the communication in such a situation.
7. Approximately 1 minute of machine operation uses 1MB of SD memory for vector work. This controller supports up to 4GB Memory. If you are using LinkMotion version 3.5 or higher, you could use either SD or SDHC memory cards.
8. It is impossible to test all the available SD Memory cards in the market but we have listed in the following lists ones that work and ones that do not work with this USB controller.

Memory chips tested and working with this controller: Sandisk (1 GB, 512 MB, 256 MB), Topram 1gb, PNY 1gb, PNY 4gb SDHC, Samsung 1gb, Transcend 1gb and 'Made in China Generic' 1gb.

Memory chips found not working with this controller: Kingston 2gb (not SDHC) and 4gb SDHC.

9. If serial number of the controller is not recognized by LinkMotion then user will see a message "Unrecognized serial number \_\_\_\_\_". Once you click on OK button it will display the second message as "The maximum working area is 1"x1" or 25.4mm x 25.4mm. LinkMotion software can output only 1"x1" jobs at that point. Unauthorized controller bought from unauthorized vendors can cause this kind of problem. Get in touch with Solustan to verify your serial number. Not making proper USB connection with the controller can also display this kind of message and simply disconnecting USB cable from computer end and reconnect and re-launch LinkMotion should resolve it.

### 10. Laser/Agni Controller Board Lights:

There are three LED lights available to attach to the Agni Controller board – Blue, Amber, and Red. These lights behave in the following manner when connections are made and the board is powered:

**Blue LED Flashing Slowly** – No USB Connection

**Blue LED Steady** – USB powered up and ready

**Amber LED Flashing Slowly** – Waiting for firmware update

**Amber LED Flashing Fast** – No SD (Memory) card

**Amber LED Steady** – USB ready for SD card

Red LED – Turns on when the board is powered. It turns off when a proper connection is made with the LinkMotion. It also turns on every time when any machine motion is detected.

Red LED Flashing – If hardware switch for Repeat is installed on the Laser/Agni controller and

LinkMotion.INI file is set up properly, then, Red LED starts flashing after a job is processed one time.

Pressing the Repeat switch will send the job again to the machine. After a job is processed one time it is ready to repeat the last job using the repeat button on the USB controller as many times as user wishes

## **LinkMotion Laser/Agni controller for CO2 Laser machines:**

**CO2 laser tube based machines require the following special features for successful job processing:**

- Vector (cut) processing, raster (engrave) processing, and combined vector and raster processing.
- Z axis is managed either in a motorized or a manual fashion to position the top surface of the material at a desired focal distance from the lens.
- PWM to control the CO2 laser tube output power.
- Enable tickle pulse with a selection of frequency and pulse width.
- Manage the CO2 laser tube power as a function of XY speed during vector processing.
- Allow selection of power, speed, and frequency for 10 different RGB colors for a job with specific material type.
- Vary the power, speed, and frequency based on color selection to manage marking, cutting, and other effects within the same job.
- Vary the DPI (dots per inch) and PPI (pulses per inch) for raster jobs.
- Set maximum as well as minimum power levels for the job.
- Manage cylindrical engraving and marking, when required.
- Raster scanning direction of either top down or bottom up to match air flow.
- Complete configuration of working area, starting position, home switch setting, E-Stop setting, step resolutions for each axis, mm or inch setting, motor parameters, and acceleration settings.

LinkMotion USB for CO2 Laser is available for Windows 10, 8, 7 32/64 and Win XP operating systems. One of the important functions of this product is the ability to drive laser machines with a USB connection without locking up any computer functions. Your computer and the design programs are free and available to you while a job is being processed.

**Your computer should have Win 10, 8 or 7 32/64 or Win XP operating system.**

**Win XP operating system with Service Pak 2 or higher installed and two USB 2.0 connections.**

**Also, you should install Microsoft .NET Framework Version 2.0 or higher. This is available from Microsoft's website for you to download freely:**

**Microsoft.com>Downloads & Trials>Download Center>Microsoft .NET Framework 2.0 (version)**

**Do not use any USB 1.1 devices like keyboard or mouse. Make sure all USB devices used are 2.0 or higher in order for LinkMotion to work properly.**

**Raster work always requires more computer memory. We suggest 4GB or more depending on your work requirement.**

LinkMotion version 4.05 and higher does not require protected license procedure so the user can install on any computer as long as AGNI Controller is certified by Solustan it will work properly. If AGNI controller is not certified user needs to get in touch with Solustan.

Make sure to check all the necessary cable connections between your computer, machine and the USB board. A micro SD memory card should be plugged into the USB controller. Check the list in the installation section of this manual for SD memory card compatibility.

## LinkMotion Control Pad Explanation:

Users can setup this Control Pad to view in **English, Spanish or Symbol**. This setup is available in the General Options tab. The following section will explain the function of each of the keys.

### Control Pad in the English language:



**The Control Pad is operated using the numeric keypad on the right side of the extended PC keyboard.** The screen design of the Control Pad mimics the actual numeric keypad. This is the main user interface for the LinkMotion driver software on the PC. Besides controlling the movement of the machine using the Control Pad, it supports many different tabs for to customizing LinkMotion machine settings.

**Click on the Apply button after any changes you make on each tab. Changes are effective only when you click on the APPLY button while you still have the changed tab open. Do not enter only zero '0' value in any area even if you are not using that section. LinkMotion is active when it is launched on the screen. The user needs to launch LinkMotion in order to use a mobile device for Control Pad to work properly. Please read and understand the instruction for using the mobile devices to control your machine before you start any motion of the machine.**

## **Home (Limit) switches (green or red lights) show up at the top of the Control Pad for each axis:**

If switches are present and properly configured, you will see green lights when the switch is not tripped. Home switch selection can be either **Normally Open or Normally Closed switches in Origin Setup tab**. Making a proper selection for the type of switches used for your machine should give you the green light on the Control Pad. The red light indication could mean that user has selected incorrect type of switch.

We protect you from driving into the end of an axis where you have already tripped the Home switch. Move the tool head in any one of the axes until the switch is tripped, the green color will change to red. If the Z-axis is not there or there is no home switch on the Z axis you need to go to the Origin Setup menu and under Home switches select “None” for the Z axis. Counters for each axis will display the position of the tool on respective axis. **Refer to the explanation in Origin Setup area for positive or negative values displayed. The counter may not display any information if the cylindrical option is checked with a certain condition. Refer to detail cylindrical option explanation in the Machine Properties tab.**

## **Reset Counter and Move To 0,0:**

Following two buttons for **“Reset Counter” and “Move To 0,0”** does not show if you activate home switches in Origin Setup of LinkMotion. These two buttons can be active only if you **check and Apply** “Disable Home Switches” and then Re-Launch Linkmotion.

### **Reset Counter:**

This will Reset the Counter for the X and Y axes to zero. If you move the tool anywhere on the table, the X, Y and Z axis counters will display the actual positions of the tool. If you then click on the Reset Counter it will make X and Y display 0. This is useful for machines without a Home switches or for selecting a new starting position. **Counter position displayed for each axis is rounded up to two digits for cm/mm and it is for general understanding. Keep in mind that Z axis counter does not reset. The user can disconnect USB cable, connect it back after a few seconds and then re-launch LinkMotion to reset z-axis counter to zero.**

### **Move To 0,0:**

Clicking on this button will make your machine move your X and Y position to 0, 0 when the counters show values other than 0, 0. **This is a useful function for resetting the start position for the machines without Home switches. Speed used for moving to 0,0 position is same as homing speed declared in the Origin setup.**

Clicking on the **Solustan logo** will take you to the Solustan website if the computer is online and connected to the Internet.

## **All the blue colored keys are designed to move the X, Y, and Z axes as follows: X left (4), X Right (6), Y Up (8), Y Down (2), Z Up (-), Z Down (+) and Fast (5).**

**X-Axis travels from left to right and Y Axis from back to the front of the machine with the Jog speed declared in the Material Properties. Jogging Acceleration is declared separately for each axis in the LinkMotion.INI file as MAX\_MM\_PER\_SEC\_PER\_SEC\_JOG= \_\_\_\_\_.**

In case of LinkMotion Laser software, the default **Platform(Z) Down** value may be '0' but Z can be made active simply by setting a **Platform(Z) Up** value in the **Materials Properties** section of the LinkMotion.INI file. This will allow you to bring the Z axis up and down using the Control Pad of LinkMotion. **LinkMotion uses Platform UP/Z UP speed when simply jogging to bring the platform(Z) up or down. When Z Ref key is pressed it uses higher of the two speeds declared for Platform Down or Platform up speed.**

**Platform Down(Z) Speed is set up in each material related settings individually in the LinkMotion.INI file with the following the line.**

ZFeed\_in=1.0 or ZFeed\_cm=2.5 or ZFeed\_mm=25.00

**Platform Up(Z) Speed is set up in you're selected machine related settings of the LinkMotion.INI file with the following line.**

Speed\_ZFeedUp\_in=1.0 or Speed\_ZFeedUp\_cm=2.5 or Speed\_ZFeedUp\_mm=25.00

### **Soft Limits for the Machine movement:**

The structure is designed to prevent running into the end of travel. First of all, we used to decelerate very slowly and over a relatively long distance. Now, when you set up the typical acceleration of 100 inches/sec, the jogging will stop almost immediately, within a mm or two. Also, if you have limit switches wired into Agni controller, it will stop immediately when the switches are breached.

### **Fast Key (5):**

Key can be pressed while holding down anyone directional key for the X or Y axis to make it move faster. The faster key will jog the axis at double the Jog speed declared under Material Properties.

### **HOME key (7):**

Home Key will move the machine to its Home position if the machine is equipped with Home switches and all home switches are activated in Origin Setup. When the Home key is pressed on the keyboard it will go home for all three axes and reset the counter to 0, 0. Machines may have Home switches in X and Y axis or all three axes. The Home key also has a Z Reference function for machines built with home switches on all three axes. **Laser machines mostly have only X and Y home switches and those two should be activated in the Origin Setup. Now when the user presses the Home key on the Control Pad the laser head should be parked in the position selected in Home Position of Origin Setup.**


**Home Key in Absolute Mode** - The LinkMotion now manages the working area of the machine in an absolute mode. LinkMotion will keep track of the position of the tool (laser head in case of a laser machine or spindle in case of a CNC/Engraving machine) and will not allow the machine to travel outside the working area. It is necessary to have home switches on the machine and it is also necessary to home the machine when LinkMotion is launched. Upon launching LinkMotion, handshaking with the Agni controller takes place. LinkMotion notes the starting position when it finds the home switches. From there on, LinkMotion will track the absolute position of the machine and will prevent the machine from traveling outside the declared working area in the Machine Properties Tab.

### **Temporary new start position after homing:**

The user can also move the machine away from the home(parking) position after homing it once and that can become a new **temporary starting position**. Send a job (assuming that enough area is available for the job you are sending) and now if you pause and decide to go home it will go back to the temporary new start

position and not the original home position where it senses home switches. The user can continue to work from this temporary new start position.

The user can move the machine anywhere and send a job from a program like Corel Draw. If the job is larger than the available working area from the temporary start position, the user will be warned about the size of the job is bigger than the remaining available area on the machine. The message displayed is following:

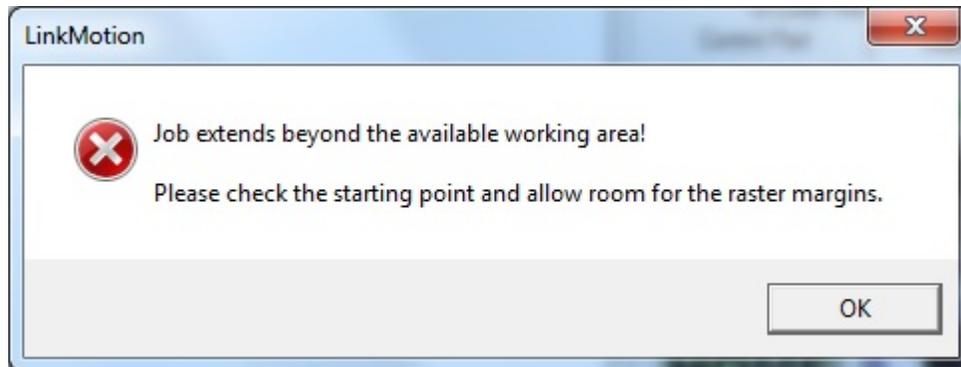

**The user can deactivate this function or protection by checking “disable home switches” in origin setup and Re-Launch Linkmotion.**

**It is important to note that this protection of keeping the job within the working area is not effective if either the machine is not equipped with home switches or the machine is not homed at the time of launching the LinkMotion driver software.**

The software is set up to initiate an automatic homing sequence at the launch time. This option is selectable in the INI file under the settings for your selected machine. **Do not activate this feature until all your machine related settings are proper for X, Y travel directions and linear travel per revolution under Machine Properties, all settings for Motor Parameters are properly tested and proper home switch selection is made in Origin Setup.** You should note a line,

**GoHomeAtStartup=1** (This setting will initiate automatic homing)

**GoHomeAtStartup=0** (This setting will **NOT** start automatic homing)

The homing routines are changed for the LinkMotion laser users. **The automatic homing will initiate homing routines for all three axes, if all three axes are motorized, all home switches are activated and when automatic homing is set up in the LinkMotion.INI file at the time of LinkMotion launch or re-launch.** Solustan recognizes that quite often it may be the platform of the laser machine that may have to be moved for homing Z axis. It is not a good idea to move the heavy platform all the time unless there is an explicit need for the same. **This is why we have decoupled the homing routines from the Control Pad.** **When you click Home on the Control Pad,** it will initiate a homing sequence only for the X and Y axis. **Z-axis can be homed separately by clicking on ZRef key on the Control Pad.**

**Z-axis soft limit** is an additional feature that will respect the travel distance declared in the Maximum Travel for Z axis declared in the Machine Properties. **It will be effective when home switches are activated in the Origin setup area. It is also effective when Z Ref Key is used.** The user can use either automatic homing feature with all three axes to home properly at the launch of Linkmotion or manual homing can be done by pressing the home key of the control pad and also separately use the ZRef key for homing the Z axis. In both cases, Z axis will limit the travel distance declared for Z axis under Machine Properties.

### **I/O Keys (1), (3), (Del) and (9):**

I/O Keys are available for I/O 1, I/O 2, I/O 3 and I/O4 controls. The I/O's can be configured for the lubrication of tools, vacuum control, laser control, red diode, air, water, etc. **I/O 1 for Laser (PWM) has an extra message and it turns on only after you click OK on that message keeping the key 1 pressed. Laser power is picked from the black color when pressed.** All four I/O keys can behave as momentary contacts (Clicking and holding the key to change the status and letting go of the key to go back to the original status) or toggle contacts (Clicking once to change the state. Clicking again to change it back to original state). The settings are made in the INI file as explained below:

### **Output settings for 32 bit Agni USB controller:**

The LinkMotion USB controller has many output lines. Five of the outputs are programmed as defined below in the chart. **Here is how to control them from your G code job files.** Some of the I/O's for outputs can be controlled in two different ways as explained below.

#### **Following Output, pins are shown for new Agni-IIP and II as output 1---7 and PWM.**

Refer to Connecting AGNI controller for more details.

<b>OUTPUT</b>	<b>I/O's</b>	<b>Control logic High</b>	<b>Control logic Low</b>
OUT 1	I/O 1	M64 P1 M7	M65 P1 M9 (alternate controls for the same output)
OUT 2	I/O 2	M64 P2	M65 P2
OUT 3	I/O 3	M64 P3 M8	M65 P3 M9 (alternate controls for the same output)
OUT 4	I/O 4(Spindle)	M64 P4	M65 P4
OUT 5			
OUT 6			
OUT 7			
PWM	Laser PWM	PWM output straight or inverted	

PWM can be inverted by changing the value in the LinkMotion.INI file under your machine related settings, save this file and Re-Launch LinkMotion Incon for it to be effective.

InvertPWM=0 (Value 1 inverts the pulse for Laser) Available with LM Version 4.27

**Following Output, pins are shown for Agni-I with 3 DB25 connectors. Connector3 for all I/O's.**

Refer to Connecting AGNI controller for more details.

<b>OUTPUT</b>	<b>I/O's</b>	<b>Control logic High</b>	<b>Control logic Low</b>
Pin 9	Laser PWM	PWM output straight or inverted	
Pin 1	Laser (I/O 1)	M7 M64 P1	M9 M65 P1 (alternate controls for the same output)
Pin 2	Red Pointer(I/O 2)	M64 P2	M65 P2
Pin 3	Water(I/O 3)	M8 M64 P3	M9 M65 P3 (alternate controls for the same output)
Pin 4	Air(I/O 4)	M64 P4	M65 P4

**I/O's toggle setting and Invert setting:** This setting is available in LinkMotion.INI file.

**The LinkMotion.INI file can be found at the following location:**

**Windows 8, 7 32/64:**

In the C:\ Program Data > Solustan > LinkMotion > LinkMotion.INI

**Windows XP:**

In the C:\ Document and Settings > All Users > Solustan > LinkMotion > LinkMotion.INI

Open LinkMotion.INI file by double-clicking on the file. It is a text file. You will see all the different machine names at the beginning. Specific machine related controls are further down in the file. Find the specific settings for your machine and you can make changes there. Remember to save the file after you make changes. Also, remember to ReLaunch LinkMotion for your changes to take effect.

**Toggle Mode for I/O Keys:**

To switch I/O keys from momentary keys to toggle keys find the following lines:

Key3Toggle=0

Key9Toggle=0

KeyDeleteToggle=0

These lines control the toggle or no toggle nature of the four I/O keys on the Control Pad. The three keys correspond to keys 3, 9, and Del. Any key with a declared value of zero is a momentary key while a declared value of 1 becomes a toggle key.

**Invert Mode for I/O Keys:**

LinkMotion USB for CO2 Laser product also has the capability to invert the I/O's. Values can be 0 or 1. Zero value does not invert and one value inverts the I/O. If I/O's turn on and off in reverse of what you want, you will need to change the values from 0 to 1 or 1 to 0 in the LinkMotion.INI file. Save the file and re-launch LinkMotion.

InvertOutput1=0 (I/O 1 for LinkMotion Laser)  
InvertOutput2=0 (I/O 2 Red Pointer for LinkMotion Laser)  
InvertOutput3=0 (I/O 3 Water for LinkMotion Laser)  
InvertOutput4=0 (I/O 4 Air for LinkMotion Laser)  
InvertPWM=0 (Value 1 inverts the pulse for Laser) Available with LM Version 4.27 or Higher)

### **The explanation for the additional feature of generating power directly from the Control Pad while depressing the I/O 1 key.**

To generate and check out the operation of the laser tube, LinkMotion allows generation of PWM when the Laser key (I/O 1) is depressed. The key is protected with a latch to prevent generation of power by mistake. Solustan recognizes that along with the PWM, it is necessary to generate proper logic level on pin 1 of connector 3 to enable the power supply.

### **Following procedure explains how to test for laser power:**

1. Check the Enable Laser box in the Machine Properties tab.
2. Select the power level of your choice (1 to 100 percent) against the black color in the Materials Properties tab. For this testing purpose, the maximum power value setting is ignored.
3. Hold down the I/O 1 key in the Control Pad
4. Click on the OK button with an arrow of your mouse to Unlock the latch when asked.
5. The power will be generated as long as you hold down the I/O 1 key.
6. The power will be shut off as soon as you take the finger off the key.

### **Zero INS (0) or Space Bar for STOP/PAUSE:**

**Zero key on the numeric keypad or quickly pressed Space Bar will Pause processing of the job at any time. Spacebar pressed for a long time will also pause the job but it will pause in a momentary mode where the job will continue when Spacebar is released. Control Pad needs to be in the foreground for the machine to Pause.**

If Control Pad goes in the background user is unable to Pause. The user can bring LinkMotion in the foreground when the job is in the process by simply one click of a mouse on the active LinkMotion icon in the middle of systems tray.

**When a job is paused you will see the following messages:**

**First message - Continue Job?** Click **Yes** or **No**. Second message displayed only if you select No.

**The second message - Move to home position?** Click **Yes** or **No**. The tool will move to home or 0, 0 position if Yes is selected. The tool will not move at all if No is selected.

### **HardwarePause and CycleStart:**

### **32-bit new AGNI USB Controllers:**

The **Hardware Pause and the Cycle Start** functions are enhanced to improve its functionality. New **Agni USB controllers** have screen printed information for wiring PAUSE, E-STOP, and CYCLE along with the GND information. **The user needs to wire both, Hardware Pause and Cycle Start switches (hardware switch installed without the cycle start switch will not work properly) to work properly along with the activation in the Linkmotion.INI file as explained on the following page.**

### **32 bit older AGNI USB Controllers with 3 DB 25 connectors:**

**Agni-I controllers** with the black metal enclosure and three DB-25 connectors, please, note an error in screen printing. The screen printing shows as follows:

#### **Connector 2 of Agni-I**

Pin 1 – Pause  
Pin 2 – E-Stop  
Pin 3 – Cycle start

#### **The correct pin numbers are as follows:**

Connector 2 of Agni-I  
Pin 1 – Pause  
Pin 2 – E-Stop  
Pin 3 –  
Pin 4 – Cycle start

### **Software settings for Hardware Pause and CycleStart connections for 32 bit Agni USB controllers:**

**Software settings for Hardware Pause and Cycle Start connections** should be activated by proper changes in the **LinkMotion.INI** file as explained below. These settings are for each of the machines so the user will need to find the settings under their selected machine name. **After making the proper changes user will need to Save the INI file, close it and re-launch LinkMotion to make the changes effective.**

#### **HardwarePause= -1, 2 or 3**

**Set the INI value to -1 to disable or deactivate this feature.**

**Set the INI value to 2 to enable HardwarePause if your switch polarity is normally closed.**

**Set the INI value to 3 to enable HardwarePause if your switch polarity is normally open.**

#### **CycleStart= -1, 2 or 3**

**Set the INI value to -1 to disable or deactivate this feature.**

**Set the INI value to 2 to enable CycleStart feature if your switch polarity is normally closed.**

**Set the INI value to 3 to enable CycleStart feature if your switch polarity is normally open.**

**Activating the HardwarePause** switch also requires activating the CycleStart switch for it to work properly. **Only Hardware pause switch will not work properly by itself.** If the hardware Pause switch is activated, it will pause the job immediately but Z axis does not lift up. Now activating the CycleStart switch will allow for the job to continue. **Do not press the Enter/Repeat Key on the keyboard to continue to finish the job when the job was paused using the HardwarePause switch since Enter/Repeat key pressed at this point sends the full job again from this Pause position.**

When Pause(Stop) is used with zero key or the space bar of the keyboard not only a job is paused but it will also lift up the Z axis and if you choose to continue the job then Z axis will travel down and then continue the job.

**Activating the CycleStart** switch allows the user to either continue the job after the user has paused the job using the HardwarePasuse switch or Start or Repeat the previously sent job. This switch can be activated by itself.

Once the Cycle start switch is activated it will prohibit the automatic starting of a job when ‘Printed’ from a job design software. The job will be transferred to the SD memory card on the Agni controller. However, the job will not start until the Cycle start switch is pressed or activated.

### **How to setup LinkMotion for not starting the job when Print command from the job design software is used without the hardware switch for Cycle Start?**

User should setup CylcleStart=3 (default is -1 means not active) in the Linkmotion.INI file under their machine related settings, save the file and Re-Launch the LinkMotion application. Now the Printed job from the design application will be transferred to the SD memory. The user will see the USB controller’s red light flashing. REPEAT/Enter Key on the Control Pad can start the job, if and when required.

### **Num Lock and /(slash) keys when the machine is in motion (job output) mode:**

#### **Num Lock and Slash Keys are available only when the machine is in motion.**

These keys can decrease or increase the speed of the X, Y movements of the machine. Do not keep this key pressed for a long time. Simply press and release gently. Each click of the key will decrease or increase the speed by a percentage set in the LinkMotion.INI file. OnTheFlySpeedChange=4 is the default INI file value. This number is the percentage change in the original speed specified in the Job feed rate of the Materials menu. When the machine is in motion you can decrease the speed by pressing Num Lock Key. Similarly, you can increase the speed by pressing the / Key. For safety reasons, you cannot increase the speed to more than twice the value declared in the Material Properties for the Vector (cut) speed. Once the job is done the speed goes back to what is declared in the Vector (cut) speed of the Material Properties.

#### **Z Ref Key (\*):**

The homing routines are changed for the LinkMotion laser users. **The automatic homing will initiate homing routines for all three axes, if all three axes are motorized, all home switches are activated and when automatic homing is set up in the LinkMotion.INI file at the time of LinkMotion launch or re-launch.** Solustan recognizes that quite often it may be the platform of the laser machine that may have to be moved for homing Z axis. It is not a good idea to move the heavy platform all the time unless there is an explicit need for the same. This is why we have decoupled the homing routines from the Control Pad. When you click Home on the Control Pad, it will initiate a homing sequence only for the X and Y axis. **Z-axis can be homed separately by clicking on ZRef key on the Control Pad.**

**Z Ref key is necessary to press after homing and before sending a job for Z to travel for the distance declared for Material thickness in Material Properties tab. Z travel for Material thickness is not effective if Z Ref was not performed by the operator after homing. When Z Ref key is pressed it uses higher of the two speeds declared for Platform(Z) Down or Platform(Z) Up speed. It is very important and necessary to use the Z Ref method for Material thickness value to be effective in the Material Properties tab.**

**Z-axis soft limit** is an additional feature that will respect the travel distance declared in the Maximum Travel for Z axis declared in the Machine Properties. **It will be effective when home switches are activated in the Origin setup area. It is also effective when Z Ref Key is used.** The user can use either automatic homing feature with all three axes to home properly at the launch of Linkmotion or manual homing can be done by pressing the home key of the control pad and also separately use the ZRef key for homing the Z axis. In both cases, Z axis will limit the travel distance declared for Z axis under Machine Properties.

### **Enter Key (Repeat Key):**

There are two ways to repeat the job last sent to the LinkMotion USB controller

1. Press either of the 'ENTER' keys on the PC keyboard.
2. Attach a hardware switch directly to the LinkMotion USB controller

The Cycle Start switch will immediately process the last job sent to the controller without sending the job again from the PC.

The LinkMotion Control Pad should be active in the foreground of your computer screen. This function can be activated in four ways.

- (1) Press the Enter key on the computer keyboard
- (2) Press the Enter key on the numeric keypad of the computer keyboard,
- (3) Click on the Repeat key (on your computer screen) with the left mouse button.
- (4) Press the hardware switch connected to the LinkMotion controller for Repeat.

Read and follow the detailed explanation for hardware switch connection and how you can enable it with LinkMotion.INI file settings. The red LED will be flashing on the USB controller if the controller is equipped with a repeat key and if the SD memory card is holding a job.

**Hardware Pause and Cycle Start** switches can be connected to USB controller and that information is provided in the STOP/PAUSE/Zero Key or Spacebar explanation area in earlier pages. Please read and understand those functions properly for your USB controller prior to using them.

### **Firmware version:**

AGNI Controller has the Firmware that may need to be upgraded as and when necessary with a newer version of LinkMotion software. Existing Firmware is always displayed in the Control Pad. Please follow necessary upgrade procedure described in the installation area when Firmware needs an upgrade. When LinkMotion is Re-Launched after the Firmware upgrade you can confirm on your Control Pad to read the newer version of the Firmware.

### **Serial Number:**

**LinkMotion reads the serial number of the controller when it is launched.** USB Controller needs to be powered either from the USB connection of the PC or external power that you may have set up. Power on the USB controller needs to be on for it to read this serial number.

When the LinkMotion is launched and if the serial number of the attached controller is not recognized by the driver software, it will change the available working area of the table in Machine Properties to 1 inch X 1 inch. The software will run in a demo mode and will not allow the user to output the file size larger than 1 X 1 inch. The user can re-Launch LinkMotion if you think this was an error. Please contact Solustan if it keeps giving you the same 1x1 inch working area. Solustan will need to verify your serial number and guide you properly.

You will also lose the capabilities of processing pre-generated g-code files. The user will not see the GCode Files tab with LinkMotion. Fully authorized AGNI Controller Serial numbers will have all functions working properly.

If you did not have your AGNI controller connected ahead of time then you need to remember and change these values in X and Y axis maximum travel area of Machine properties and then Re-Launch your LinkMotion. Design applications read these table size available from the LinkMotion driver when design application is launched. The user should launch design application again if any changes were made in LinkMotion's maximum travel area of X and Y axis of Machine properties.

### **USB connection, SD memory, Emergency stop and Job Time:**

**USB connection, SD memory, Emergency stop and Job Time are four items** just below the Solustan Logo in the Control Pad. There are three lights in front of first three items showing green or red. These lights show up if following lines are there in LinkMotion.INI file. This file is located on your hard drive in the following location:

#### **Windows 10, 8, 7 32/64:**

In the C:\ProgramData > Solustan > LinkMotion > LinkMotion.INI.

#### **Windows XP:**

In the C:\Document and Settings > All Users > Solustan > LinkMotion > LinkMotion.INI

You need to check and re-launch LinkMotion in order for these status indicators to work properly if for any reason PC disconnected the LinkMotion USB controller.

#### **status1=USB connection:**

Check your USB (cable) connection if this First light is Red. Sometimes simply disconnecting and connecting the cable back along with exiting LinkMotion and Launching it back will bring back the Greenlight.

#### **status2=Memory card:**

Check your (SD) Memory card in the USB Board if the Second light is Red. SD card is properly plugged and working well then it should show you the green light. Approximately 1minute of work uses 1MB of memory. This controller supports up to 4GB Memory. We have listed the memory we have tested with and user can make sure to use proper SD memory.

#### **status3=Emergency stop:**

**An emergency stop** is activated by an emergency switch that you might have connected to your machine then this Third light is Red. LinkMotion will recognize this and should pause the job and delete the remaining file. You will have to exit and re-launch the LinkMotion application to start again. This is activated in the LinkMotion.INI file.

## **Estop**

1. Normally, the LinkMotion software is shipped with E-Stop sensing disabled via the INI file. Search for the line EStop= -1 in the section of the INI file for your machine (Name of the machine you selected when installing).

**EStop= -1 disables the function.**

**ESTop= 0 enables emergency stop function for the normally open E-Stop switch.**

**ESTop= 1 enables emergency stop function for the normally close E-Stop switch.**

**IMPORTANT: Laser machines have many safety switches to make sure that all doors and other openings are closed before turning ON the laser power. All the wiring of the safety switches and the wiring of the E-Stop switch must be connected to the E-Stop connection (Connector 2, pin 2). Any break in the switch circuits will disable the generation of the laser power.**

2. Additionally, when the LinkMotion Control Pad is displayed you will see a **green or a red light to the right of the control buttons indicating the status of the E-Stop.**

3. E-Stop wiring information is printed on the newer new AGNI boards. Older Agni with three DB25 connectors has Pin 2 of the Connector 2 for E-Stop as well as all safety switches.

4. The sensing voltage must be limited to +5 VDC when connecting lines to the E-Stop pin on our controller. **Applying higher voltage will damage the controller.**

5. The new version of 32-bit AGNI boards are optoisolated using opto isolation circuits and a jumper is provided to use either internally available +5 VDC or externally provided a higher voltage.

**Maximum allowable external voltage is 24 VDC.**

Older 32 bit Agni with three DB25 connectors has 12 input lines on connector 2, pins 1 through 12. All of them are optoisolated using opto isolation circuits on the breakout board (BOB). At this point, actively used lines are pins 1, 2, 3, 7, 8, and 9. The BOB is equipped with a jumper to use either internally available +5 VDC or externally provided higher voltage using pin 13. **Maximum allowable external voltage is 24 VDC.**

6. We do not bring out the connections for E-Stop in our current controller enclosure (Upgrade engraving machine kit or 16 bit USB controller with enclosure option is purchased). There is a slot for a spare DB-25 connector in the back of the controller. It should be simple to bring the E-Stop sensing and ground wire out through the connector.

**7. On sensing the fault on the E-Stop line, the controller will halt any motion in progress, display a red light for Emergency Stop on the Control Pad screen, terminate any profile that is running in the controller.**

**Using new 32-bit AGNI Controller user needs to first deactivate the Estop switch, home the machine and send the job again.**

## **The job will never be processed if Estop is active showing the red light on the LinkMotion Control Pad.**

Firmware 3074(32bit controller) and LinkMotion version 4.20 and higher allows you to see the Light for Estop becoming green when Estop switch is not pressed(Released). The user can jog the machine and home the machine for starting a new job without relaunching LinkMotion. A previous version of the all the firmware (prior to 3074 for the 32-bit controller and 2078 for the 16bit controller) and Linkmotion required for the user to Re-launch Linkmotion before it allowed you to jog and home the machine.

**8.** There is no internal circuit designed to take the power off of the AC to DC power supply. The step motor will still be powered. However, there will be no movement.

### **status4=Job Time:**

This function will display the time when a job is prepared and sent to the machine by LinkMotion driver. It will display approximate time in minutes and seconds. This Job time also is displayed when a job is sent using the Repeat(Enter) Key. However, job time will not be displayed if the user has re-launched LinkMotion for any reason and then uses the repeat key. The user will need to generate the job again using the Print command for it to display proper Job time.

### **Run bounding box only:**

The bounding box is also sometimes called as a run box. If the bounding box is desired as the output, the box for Run bounding box only shall be checked before sending the job. **Apply button does not become active when the bounding box is checked and there is no need to confirm the check mark with an APPLY button.**

Imagine a rectangular bounding box around the selected part of a job or a complete job. When the job is sent, the tool will travel on the bounding box to show exactly where the job will be processed, if the job was sent. Note the following behavior:

- **The tool will travel at the declared cut/vector speed** while showing the bounding box.
- Any other selected outputs (I/O) will stay on for bounding box for laser operations.
- The Z axis will not move during the drawing of the bounding box, even if any depth is selected. The user can position the tool as far or as close to the material as desired to see exactly where the bounding box is.
- If the laser power is selected for the job, it will be turned OFF during this process.
- If necessary and if available, an indicator diode (often red diode) can be turned ON or any other outputs and the red light will show the bounding box.

**Remember to uncheck this bounding box before sending the actual job for laser processing.**

### **Customizing Control Pad Keys:**

LinkMotion installs a folder name **Button Graphics** under Program Files in following location:

**Win 10, 8, 7-64:** C:\Program Files(x86) > Solustan > LinkMotion > Button Graphics > Down and UP folders with same file names

**Win 10, 8, 7-32 and XP:** C:\Program Files > Solustan > LinkMotion > Button Graphics > Down and UP folders with same file names for all keys.

**Folder name Up** has all ControlPad keys that you see when keys are not pressed. **Folder name Down** has all ControlPad keys that you see when keys are pressed. All names for the keys are same in each folder. The user can design their own keys and give the same names and replace these files.

(1) All small keys like X Right, X Left, Y Up, Y Down, Z Up, Fast, I/O 1, I/O 2, I/O 3, I/O 4, Home, Speed Down, Speed Up and Z Ref(Surface) should be designed with 91x73 pixel size BMP files.

(2) Z Down and Repeat keys are designed with 91x154 pixel size BMP files.

(3) Stop(Pause) key is designed with 192x73 pixel size BMP file.

One last thing to make these custom keys visible and active is to go to the LinkMotion.INI file. Find a line **CustomButtons=0**. **Change this value from zero to number 1**. It should read **CustomButtons=1** Save that file and Re-Launch LinkMotion and you will see your own custom designed keys.

## Control Pad in the Spanish language




Go to the General Options tab. Look for Control Pad Labels. Click on the arrow to the right to see your choices. Select the Spanish Control Pad. Click on the Apply button and you will see the Spanish Control Pad.

## Control Pad with Symbols:



Go to the General Options tab. Look for Control Pad Labels. Click on the arrow to the right to see your choices. Select the Symbol Control Pad. Click on the Apply button and you will see the Symbol Control Pad.

## Materials Properties:

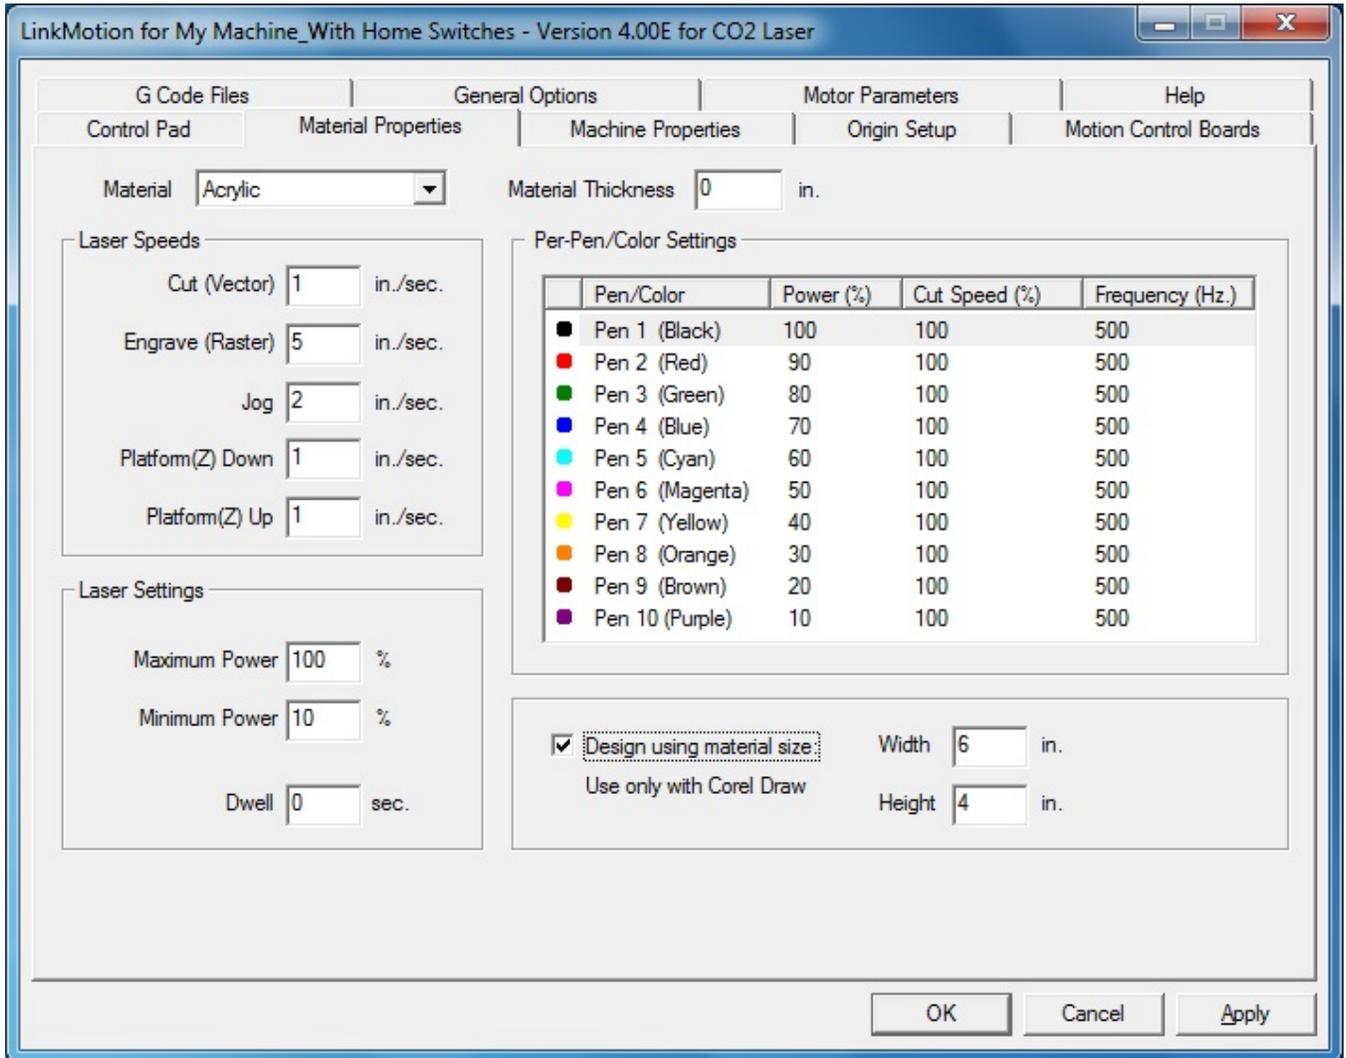

## Material/Laser Speed/Laser Settings:

Click on the Material Properties tab to observe a selection of various materials. You can edit the default values for speed and power for each of the materials. The Materials Properties tab has special settings to accommodate the features of CO2 lasers.

A number of popular materials are included in the list of materials. More can be added with ease. Different materials react differently to CO2 laser frequency and power. An optimum frequency can be set for each type of material and for each line color. LinkMotion will associate the set frequency with the material. When a material is selected, it will show the power, speed, and frequency saved for each of the colors. You can override any setting by changing it while the material is selected. Click the 'Apply' button to make the new value effective.

Settings the power value is slightly different. There is one overall material setting for the maximum and the minimum power. However, the power can vary as the percentage of maximum for each of the colors.

Setting a minimum power above zero will guarantee that the laser will continue to fire at the slowest vector processing speed.

LinkMotion can be customized for many different types of machines. There are no values that will be appropriate for all machines. OEM's and/or customers' experiences will dictate the proper values for the optimum operation of your machine.

LinkMotion for CO2 laser is optimized for X and Y axis operations. A Z-axis setting is necessary only in the case of a motorized Z axis. The most common practice is to move the platform up or down to adjust the focal distance from the lens to the top of the material. The optimum speed setting for the movement of the Z-axis can be set up in the INI file before processing a job. Such adjustments are only necessary when the thickness of the material changes from one piece to the next. Use the Z up and Z down buttons in the Control Pad to adjust the distance between the lens and the material.

The values can be inches per second, millimeters per second, or centimeters per second. The General Options tab allows you to select your measurement units.

## **Laser Speeds:**

### **Speed setting for Cut (Vector) job:**

A number can be set up in inches/sec or mm/sec for the Cut selection in the Materials Tab. This will be the maximum speed. A percentage of this maximum speed can be further adjusted for each of the colors. The combined XY speed will never exceed the set speed. The output power of the laser will be modulated on-the-fly for any slow down in the combined XY speed. However, the output power will never go below the setting for the minimum power setting during the job.

Cut (vector) speed applies when the laser is moving in a line to etch or cut. Cut speed will be the job feedrate for vector cutting.

**Please make sure to set up proper power, speed and frequency in material properties for all colors and acceleration in motor parameters for all axis before doing a test job.**

**LinkMotion version 4.50 and higher now uses Jog speed declared for moving between the shapes for vector job.**

**Older than 4.50 version used moving between the shapes** USB Controller internally calculates and looks at the higher of the Cut(Vector), Engrave(Raster) and Jog speed declared for X-axis and higher of the Cut(Vector) and the Jog speed for Y axis and then moves the machine for X and Y axis appropriately. **If you prefer higher speed for the older version between the shapes then set the speed declared for the Engrave/Raster job (below) to be higher and it will move at a higher speed between the shapes.**

### **Speed setting for the Engrave (Raster) job:**

**The speed setting for raster job has two parts.** The X-axis is mechanically designed and optimized for high speed. **This speed is set in the Engrave (raster) selection in the Materials Tab and used for X-axis travel.** The Y-axis needs to move at the end of the X-axis raster sweep. Y-axis could be carrying more weight and needs separate setting. **LinkMotion will pick up the jog speed as the maximum clamping speed for the Y axis during a raster job.** The maximum speed for jogging will depend upon the

mechanical design of the machine. If you set it too low, you waste time. If you set it too high, you run a risk of losing steps, hence quality and accuracy.

**Please make sure to set up proper power, speed and frequency in material properties for all colors, DPI and PPI settings in machine properties, Raster margins in LinkMotion.INI file (BMPMarginMultiple=5 is default value), acceleration in motor parameters for all axis before doing a test job.**

**Engrave/Raster speed is also used for movement between the shapes for Cut/Vector job in 4.44 and older versions.**

**Engrave Speed/Raster speed in Material properties in inches (mm will be converted to inches) is multiplied with PPI value declared in the Machine properties setup for deriving proper frequency value for Raster work declared as Q value when raster G-Code is generated.**

Following line is added in the LinkMotion.INI file under each machine related settings.

**MaxLaserFrequency=10000**

The user should declare a proper value for their laser machine by checking with the manufacturer for Maximum Frequency generated. This number declared above prevents the PPI and Raster Speed from going over 10000.

### **Example of the message:**

Raster speed 20in/sec and PPI is 500 than trying to increase PPI will display a warning message.

**"The current raster speed setting of 20 in./sec limits the PPI to 500"**

If you try to change the raster speed, you'll see this message:

**"The current PPI setting of 500 limits the raster speed to 20 in./sec."**

### **Jog Speed:**

Jog Speed is preset and can be changed to the Jog value under Laser Speeds. Hold down any directional key while the Control Pad is in the foreground on the screen and the respective axis will move in the direction at the speed of the declared jog speed. Hold down the Fast Key (5) while keeping the directional jog key pressed and the X or Y axis will move at the double the declared jog speed.

**LinkMotion version 4.50 and higher now uses Jog speed declared for moving between the shapes for vector job.**

**In older version of Linkmotion, the jog speed should always be same or slightly higher than the Cut (Vector) speed. If the jog speed is lower, it may slow down the movement between the shapes and increase the job processing time unnecessarily. If it is much higher than cut speed it may move too fast between the shapes for vector jobs so set up your speeds after testing a few sample jobs properly. Please understand and read the explanation above in the Cut(Vector) speed area for how the move speed for vector job is calculated by the controller.**

**Maximum Jogging Acceleration value is declared in GENERAL section separately for each of the axis in the LinkMotion.INI file under [AXIS\_0] for X axis, [AXIS\_1] for Y axis, [AXIS\_2] for Z axis, [AXIS\_3] for A axis, [AXIS\_4] for B axis, [AXIS\_5] for C axis using the following line:**

**MAX\_MM\_PER\_SEC\_PER\_SEC\_JOG= \_\_\_\_\_.**

**The user needs to Save the LinkMotion.INI file after changing this value in above-shown line and then Re-Launch LinkMotion applet for it to be effective.**

Numeric keypads on the PC extended keyboard are the best way to use the Control Pad. If you use mouse clicks to try to jog any of the axes, you will actually end up using the nudge feature as explained in the General Options Tab section of this document.

**Numeric keypads on a laptop:** There are two ways to use the numeric keypad on a laptop. Generally, laptop keyboards have an additional key that invokes the numeric keypad as the third level of keys. Refer to the documentation for your laptop. Alternately, inexpensive numeric keypads can be attached to an available USB port. Make sure and buy a keypad that is USB 2.0 compatible. Wireless numeric keypads are also available but these devices may not work properly.

### **Platform Down (Z) and Platform Up(Z) Speed:**

**Platform down or up in Z-axis speeds are set up in two locations.** Laser machines may be equipped with a motor moving up and down for repositioning the platform on which the material rests or for focusing the laser beam. Generally, this speed does not need changing on a regular basis. **LinkMotion uses Platform UP/Z UP speed when simply jogging to bring the platform(Z) up or down.**

**When Z Ref key is pressed it uses higher of the two speeds declared for Platform Down or Platform up speed.**

**Platform Down(Z) Speed is set up in each material related settings individually in the LinkMotion.INI file with following lines.**

ZFeed\_in=1.0 or ZFeed\_cm=2.5 or ZFeed\_mm=25.00

**Platform Up(Z) Speed is set up in your selected machine related settings of the LinkMotion.INI file with following lines.**

Speed\_ZFeedUp\_in=1.0 or Speed\_ZFeedUp\_cm=2.5 or Speed\_ZFeedUp\_mm=25.00

### **Laser Settings:**

#### **Maximum Power**

Set the maximum power for the material as a percentage of the available power for your laser machine. Power declared here will prevent not to exceed this power for output. Also, percentage selected in all the color selection output for RGB and CYMK will be a percentage of this Maximum power declared.

#### **Minimum Power**

LinkMotion modulates the laser power level based on the combined XY axes speed. It will maintain the power level of the set speed. However, when the speed is reduced approaching corners and on curves, the power level will be reduced proportionally to the reduction in XY speed. It may be desirable to maintain a

minimum power level for some materials even as the speed approaches zero. The minimum power setting accomplishes just that.

### **Dwell**

Dwell time is available and used mostly for vector work. Time declared in dwell is used for the laser to stay on before it starts the motion for the output of each vector shape. It will also dwell for half the time declared after each shape is finished for the vector jobs but the laser will not remain on at that time.

### **Material Thickness:**

The declared value here will make the Z axis move up or down first by this distance before starting the Laser job. It is designed for using different material thickness for a different type of jobs. The user can declare different thickness and Z axis will move up or down accordingly. **This function will be active only after you have either home the machine with automatic homing or you have used Z Ref function and home key function for X, Y motion. If you need to Re-launch LinkMotion for any reason then you need to use the Z ref function again before this function is effective. This function will not be effective if Z ref function is not used.**

**Example: Automatic homing or Z Ref performed after X, Y homing. At this point, LinkMotion control pad counter should display value 0(zero) for X, Y and Z axis counters. Now, if you have declared positive distance in the Material thickness value in Material Properties tab then Z axis will travel that distance in down direction before starting X and Y movement for doing your job. If material thickness had negative value declared then Z should travel in up direction before starting X and Y movement for doing the job. If first time user declared 0.25-inch value then Z should travel 0.25 inch down and then do the job. If the user changes that value to be 0.15 inch after the first job then Z tool should travel up by 0.10 inch and then the job will be done since reference point of zero value has not changed.**

**Please read the description for Automatic homing and Z Ref function in control Pad explanation before you use this feature. This function will not be active if homing is deactivated in Origin setup or proper homing procedures were not followed.**

### **Per-Pen/Color Settings:**

**Solustan provides a color palette for the 10 colors used in LinkMotion. This can be RGB (10 color support) or CMYK (7 color support) color palette. Follow instructions from LM&Corel.PDF document to install this color palette file. The user should check their own design application if they support windows supported RGB or CMYK colors and test it.** While preparing Cut (vector), Engrave (raster), or combined jobs, it is important to select proper color schemes to generate expected power, speed, and frequency for the Cut job and to generate expected power for the engraving job. We suggest for you to run a trial job before going for the final production.

**Power % - The laser power can be managed with colors in the following manner:**

1. For each of the colors, you can set power levels as a percentage of **Maximum Power declared on the left under Laser Settings**. Double click on the power percentage number for the appropriate color. A dialog

box will pop up. Select and change the number. **Power range value should be 0 to 100 in percentage value.**

2. Within the color, for each of the shapes being processed, LinkMotion will manage the power as a function of XY speed.

**Cut Speed % - The laser cut speed can be managed with colors in the following manner:**

1. For each of the colors, you can set the cut speed as a **percentage of maximum speed declared on the left side under Laser Speed for Cut(Vector) speed.** Double click on the speed percentage number for the appropriate color. A dialog box will pop up. Select and change the number. **The range for speed should be 1 to 100 in percentage value.**

2. LinkMotion will maintain the declared speed and the declared power for the color during the processing of the job. It will modulate the power if the XY axis slows down for sharp corners or curves.

Double-clicking on the Cut Speed (%) number for each Pen/Color and will open an editing box that will allow you to change this number. Let us look at some examples:

Maximum power is set at 100 percent. Minimum power is set at 5 percent.

Cut (vector) speed is set to 4 inches/second.

Power, speed, and frequency settings are available for each of the ten colors.

If you design a cut (vector) using a color set with 50% for power, 60% for speed, and a 500 Hz frequency, you will process the vector job at 50% of rated laser power at a speed of 2.4 in/sec with the PWM running at 500 Hz.

The Cut (vector) speeds of jobs designed in color will be scaled by the percentage declared for that color. One use for this feature is to design the same job in different colors on different layers and sequence the layers appropriately.

**Frequency(Hz): - Frequency range value can be minimum 100 and up to 120, 000 Hz.**

LinkMotion Version 4.10 and higher has a line in the LinkMotion.INI file under each laser machine related settings for Maximum Laser Frequency control.

**Following example explains how it works best on your machine:**

**MaxLaserFrequency=10000**

When maximum 10000 value is declared in the INI file it prevents PPI and the Raser Speed from going over this value. If the raster speed is 20 in/sec in Material properties and the PPI is 500 declared in the Machine properties, when you try to increase the PPI you'll see a warning message **"The current speed setting of 20 in./sec limits the PPI to 500."**

Using the same settings as above if you tried increasing the Engrave (Raster) speed you should see a warning message **"The current PPI setting of 500 limits the raster speed to 20 in./sec."**

Following are the **RGB** (Works well with all operating system and Corel X3, X4, X7) and **CMYK (Not as reliable with Win 8, 10 and Corel X7)** color/pen values for the LinkMotion V 3.5 and higher given in percent:

<u>Pen no. Laser</u>	<u>Color</u>	<u>R</u>	<u>G</u>	<u>B</u>	--	<u>C</u>	<u>M</u>	<u>Y</u>	<u>K</u>
1	Black	0	0	0	--	0	0	0	100

2	Red	255	0	0	--	0	100	100	0
3	Green	0	255	0	--	100	0	100	0
4	Blue	0	0	255	--	100	100	0	0
5	Cyan	0	255	255	--	100	0	0	0
6	Magenta	255	0	255	--	0	100	0	0
7	Yellow	255	255	0	--	0	0	100	0
8	Orange	255	128	0	--	Not Available			
9	Brown	255	192	0	--	Not Available			
10	Purple	128	0	255	--	Not Available			

It is advisable to set up a color palette with the above 10 colors with respective RGB values or 7 colors with respective CMYK colors. Use this newly defined palette to design your jobs where color is required. Solustan provides **LinkMotion RGB.cpl** and **LinkMotion CMYK.cpl** file with the software that can be loaded in Corel Draw. **LM&Corel.pdf** document has the instructions for loading that properly in Corel. Updates files are also available for download on Solustan’s support section of our website.

**If you do not create a color palette with the above RGB or CMYK values, the GDI may not convert proper color settings file. This process may result in errors.**

**Design using material Size: (Fully tested with only Corel Draw design application)**

**Vector work will require for the user to enter actual Plate size. Design output will be what is designed to that plate size.**

**Raster work will require additional raster margin value for the travel on X-axis on both sides of the plate. An example is below:**

**Default margin declared is 1” on both the sides for raster jobs. Your plate size is 6”x2”. In this case, your design size X-axis should not exceed 4” centered for it to have 1” on both ends for X-axis for the raster margins. Alternatively, 4”x2” plate can be placed 1” away from the starting position in X-axis. If default raster margin is greater than 1” declared in the Linkmotion.INI file then design your plate size and the raster job keeping that raster margin value in mind properly.**

A special feature is created in order to be able to design a job in Corel Draw using the plate size dimension as opposed to the working area of the machine. If it is not required or if there is a need to hide the option in the user interface area, this part of the UI can be hidden by placing the following line in the INI file and in the area of your selected machine.

UseMaterialSize=-1

Before you enable Design Using Material Size, we suggest that you read the section on Machine Properties a little later in this document.

Please understand the difference between two concepts clearly:

You can set the page size in the job design software to be the same as the working area of the machine declared in the Machine Properties.

You can set the page size in the job design software (fully tested with Corel Draw) to be the same as the material size for the job.

In both cases, the working area of the machine declaration in the Machine Properties remains the same. The machine size will not change when you use the material size for the job design.

## **Why set the material size? What are the advantages?**

Different strokes for different folks. If you are interested in engraving award plates you may want to center the job, select different fonts with different sizes for different lines, change and recompose jobs with ease, be able to see the design in a larger area of the screen and take advantage of the many composition features of your design software. Setting up the page size to be the same as the material size allows you to take advantage of these powerful composition features in Corel Draw.

### **Setup:**

Check and understand three areas for setup before using this function.

(1) LinkMotion applet setup, (2) LinkMotion printer driver setup and (3) Design application setup.

### **1. LinkMotion Applet Setup:**

The applet is a small application sitting in the Systems Tray at the bottom right of the taskbar.

It is extremely important to first set up your machine with all the settings in each section (tab) of LinkMotion, Refer to the detailed explanations for Machine Properties, Motor Parameters, and Origin Setup. Do some preliminary testing with a full page size design (using a page size the same as the X and Y maximum travel declared in Machine Properties) and then move on to test the material size function.

### **2. LinkMotion Printer Driver Setup in the job design software:**

It is also important to select the orientation (Portrait or Landscape) under Printer Setup to match the table size declared in your Machine Setup and get the output in the correct location.

Setting up the printer properties for Windows XP, Windows 7 32 and 64 operating systems:

Go to Devices and Printers (Printers and Faxes under Windows XP) from the Start button. Right, Click on this printer with your machine name and select "Printer Properties". Click on Advanced button. Click on the Printing Defaults button and choose your table orientation. If X maximum travel is larger than Y maximum travel, choose Landscape. If X maximum travel is smaller then Y maximum travel, choose Portrait. Click on the OK button. Click again on the OK button of Printer Properties.

### **3. Job Design Application Setup:**

There are a number of ways to set up a job in your design program to process it in the right location in the working area of the machine.

- (1) Test with the same page size as the machine's table size: Initial testing should be always done with the page size set to be the same as your machine's table size. Declare the working area of the machine in the Machine Properties tab of LinkMotion. Restart your job design program so that it can reset to the new working area of your machine. The job design program receives this information from the LinkMotion driver at the time it launches. Set the page size in the job design program to be the same as the working area of your machine. Prepare the job on the new page where you want it to appear on the machine.
- (2) Test with a page size smaller than actual machine's table size: If you're setting up a jig with a smaller than the total working area of the machine, it may be advantageous to change the working area of the machine in LinkMotion and design the job using the smaller page size. See the following

instructions for selecting the starting position and choosing the starting location of the tool, using X and Y axis tool offsets if necessary.

- (3) Test with the “Design using material size” option: If you are using Corel Draw you can design in the plate area while keeping the machine (table) size as is. The procedure for Design using material size will give you step by step instructions below.

**Job design using material size (plate size):** LinkMotion.INI file controls this function. Following line should be present in the area within the section with your machine configuration:

**UseMaterialSize=1 or 0**

The default value is 1 and the Design using material size will show up in Materials properties tab. 0 will hide this interface from the Materials menu and output will be in relation to the table size declared. The picture of Materials Properties page shown earlier in this document displays Material Size user interface.

**Once you have set up the machine properly, check for correct output size and position of the job on the material.**

### **Procedure for Design using material Size:**

Check the box for Design using material size in Material Properties.

Click on the Apply button.

Enter the values for material (plate) width and height.

Click OK. (The LinkMotion applet will close)

When Design using material size is active you can choose a plate size smaller than the actual table size. (Table size is declared in the Machine Setup tab of LinkMotion by setting the Maximum Travel for the X and Y axes.)

Launch Corel DRAW.

Set the page size in Corel DRAW to match the material size declared in LinkMotion.

Your plate design can be portrait or landscape. As long as the orientation selection matches in the printer setup your output will be in the correct location. Please do some testing before making your final product.

If you have selected orientation mode to be Landscape and your plate size has portrait mode you should see the following message:

“Paper Orientation does not match one or more document pages. Adjust Printer automatically?”

Click on the Yes button if you are using on Windows 7 and output should be in the correct location.

Click on the No button if you are using on Windows XP and output should be in the correct location.

Similarly, if you have selected orientation mode to be Portrait and your plate size has landscape mode you should see the following message:

“Paper Orientation does not match one or more document pages. Adjust Printer automatically?”

Click on the Yes button if you are using on Windows 7 and output should be in the correct location.

Click on the No button if you are using on Windows XP and output should be in the correct location.

When you want to change the plate size.

Go to Material properties of LinkMotion and change the width and height.


Click on the Apply button.

Click OK. (The LinkMotion applet will close)

### **Important Warnings:**

This function was tested to work with Corel Draw only. We have not tested the Plate Size function with other applications. The print preview from Corel Draw will not display the proper job output location when you use “Design using material size” but the output will be in a proper location on your machine.

## Machine Properties:

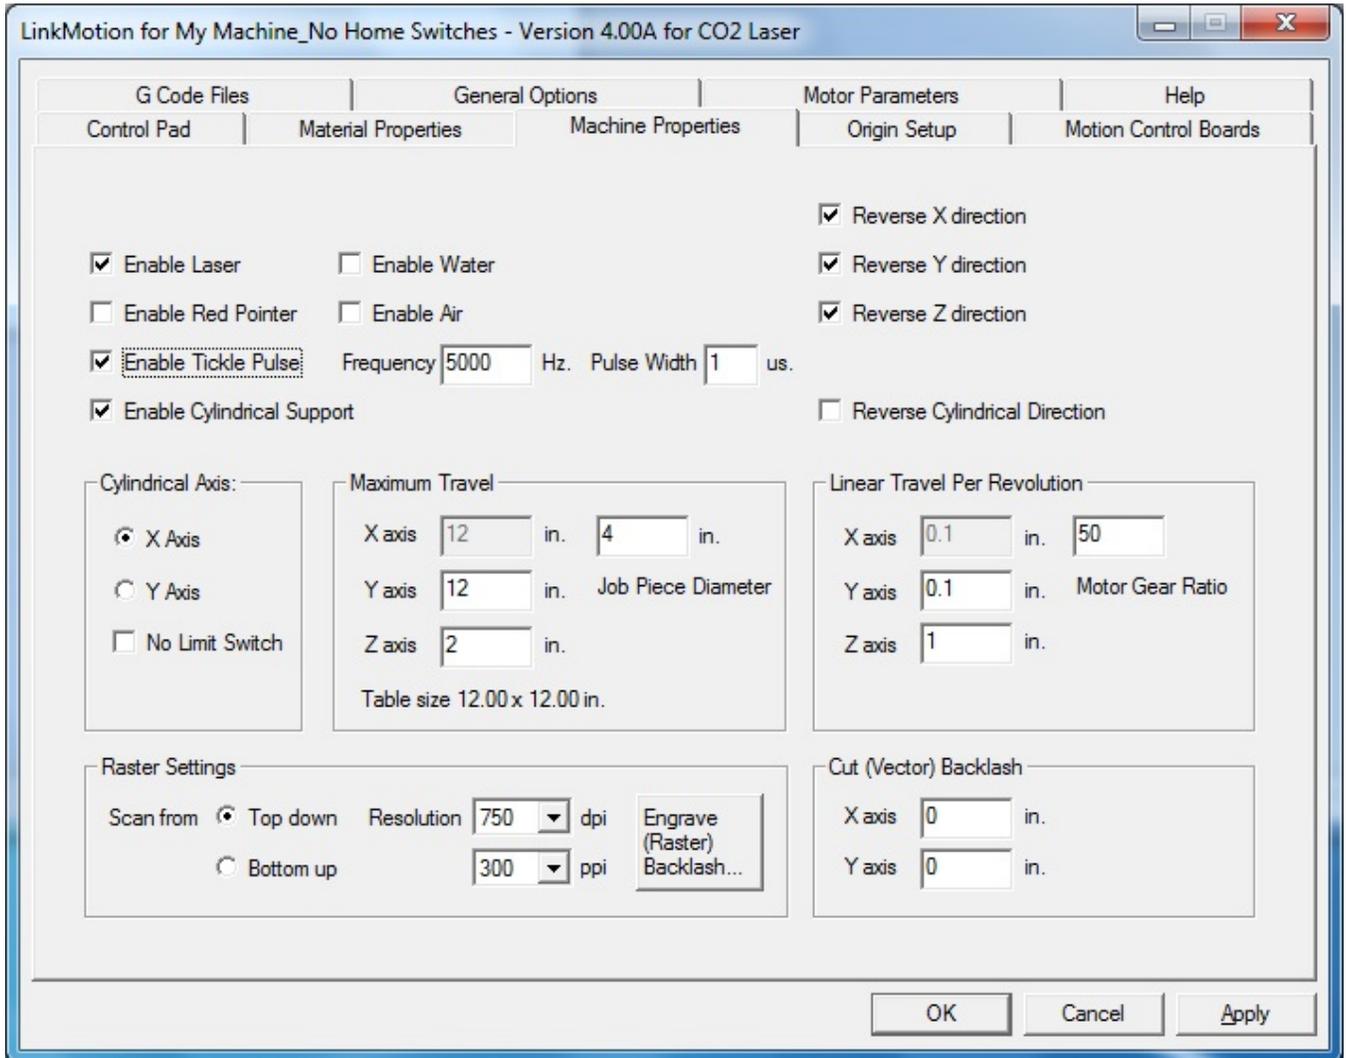

### Enable outputs - Laser, Red Pointer, Water, and Air:

If Enable Laser is checked, it will turn the Laser ON while cutting/engraving and turn the laser OFF at the end of the part. The I/O will stay OFF during the move to the beginning of the next raster or vector part. You can test the operation of the laser by depressing Key 1 on the numeric keypad. A safety feature is provided here for your protection. When the Key 1 is pressed, a warning will appear on the screen and a click of the mouse is necessary. The power will be turned off as soon as the Key 1 is released.

**When using the keypad, the laser will have the power level and the frequency set for the black pen color of the selected material in the Material Properties tab.**

If Enable Red Pointer is checked, it will turn the Red Pointer I/O ON while cutting/engraving and turn the I/O OFF at the end of the shape. The I/O will stay OFF during the move to the beginning of the next shape. You can test the operation of the Red Pointer by either clicking on the Key 3 button with a mouse or depress the key on the numeric keypad.

If Enable Water is checked, it will turn on and off with the job execution. You can test the setting by clicking the Key Del (.) on the numeric keypad.

If Enable Air is checked, it will turn on and off with the job execution. You can test the setting by clicking Key 9 on the numeric keypad.

**Output settings for 32-bit AGNI USB controller:**

The LinkMotion USB controller has many output lines. Five of the outputs are programmed as defined below in the chart. **Here is how to control them from your G code job files.** Some of the I/O’s for outputs can be controlled in two different ways as explained below.

**Following Output, pins are shown for new Agni-IIP and II as output 1---7 and PWM.**

Refer to Connecting AGNI controller for more details.

<b>OUTPUT</b>	<b>I/O’s</b>	<b>Control logic High</b>	<b>Control logic Low</b>
OUT 1	I/O 1	M64 P1 M7	M65 P1 M9 (alternate controls for the same output)
OUT 2	I/O 2	M64 P2	M65 P2
OUT 3	I/O 3	M64 P3 M8	M65 P3 M9 (alternate controls for the same output)
OUT 4	I/O 4(Spindle)	M64 P4	M65 P4
OUT 5			
OUT 6			
OUT 7			
PWM	Laser PWM	PWM output straight or inverted	

PWM can be inverted by changing the value in the LinkMotion.INI file under your machine related settings, save this file and Re-Launch LinkMotion Incon for it to be effective.

InvertPWM=0 (Value 1 inverts the pulse for Laser) Available with LM Version 4.27

**Following Output, pins are shown for Agni-I with 3 DB25 connectors. Connector3 for all I/O’s.**

Refer to Connecting AGNI controller for more details.

<b>OUTPUT</b>	<b>I/O’s</b>	<b>Control logic High</b>	<b>Control logic Low</b>
Pin 9	Laser PWM	PWM output straight or inverted	
Pin 1	Laser (I/O 1)	M7 M64 P1	M9 M65 P1 (alternate controls for the same output)
Pin 2	Red Pointer(I/O 2)	M64 P2	M65 P2

Pin 3	Water(I/O 3)	M8 M64 P3	M9 M65 P3 (alternate controls for the same output)
Pin 4	Air(I/O 4)	M64 P4	M65 P4

### **Inverting I/O's:**

LinkMotion also has the ability to invert the I/O's. If I/O's will turn on and off in reverse of what you require, change the values in the LinkMotion.INI file. Values can be 0 or 1. Zero value does not invert and one value inverts the I/O. Save the file and Re-Launch the LinkMotion.

InvertOutput1=0 (For Laser in LinkMotion)  
 InvertOutput2=0 (For Red Pointer in LinkMotion)  
 InvertOutput3=0 (For Water in LinkMotion)  
 InvertOutput4=0 (For Air in LinkMotion)  
 InvertPWM=0 (Value 1 inverts the pulse for Laser) Available with LM Version 4.27

### **Toggle I/O Keys:**

I/O keys can be either momentary or toggle keys find the following lines in the Linkmotion.INI file within your selected machine settings:

**Key3Toggle=0**  
**Key9Toggle=0**  
**KeyDeleteToggle=0**

These lines control the toggle or no toggle nature of the four I/O keys on the Control Pad. The four keys correspond to keys 3, 9, and Del. Any key with a declared value of zero is a momentary key while a declared value of 1 becomes a toggle key.

### **Tickle Pulse setting:**

A tickle pulse can be set up with ease for the machines that require it. Check the box for Enable Tickle Pulse and two more selections will show up for setting the frequency (Hz) and pulse width (microseconds). **The user is required to Re-launch LinkMotion with any changes made in these settings for it to be effective even after you click on the Apply button.**

Manufacturers of laser tubes will recommend the values for the settings. The settings may need adjustment as the laser tube ages.

### **Reverse X, Y, or Z direction:**

**Directions for X, Y and Z** can be set here by checking or un-checking the reverse box. If the axis movements are opposite of the intended directions, the direction can be reversed without changing any wiring.

## **Machine Travel (Table size) for X and Y and Maximum Z travel:**

Setting the Maximum Travel allowed in each of the axes is an important part of the Machine Properties tab. As discussed earlier, the page size in the job design software (Corel Draw, AutoCAD, etc.) can be set to either the working area of the machine or the size of the material used for the job.

**Minimum of 0.3937x0.3937 inch or 1x1 cm and a maximum of 192”x192” or 487.64x487.64 cm for X and Y axis for Table size. Also, keep in mind the margin value on both sides of the raster job. Default margin value is 1” when Linkmotion is installed. The user can change this in the LinkMotion.INI file as explained at the end of this Machine Properties section. Do not design jobs outside of that page area.**

The maximum travel distances of the machine (working area) in X, Y and Z axis is set here. The maximum travel numbers should match the page size in the design applications you are using (for example, Corel Draw or AutoCAD.) If the numbers do not match, the job will not appear in the intended location on the machine. Setting these numbers correctly allows precise positioning of the job on the machine.

The following four settings are necessary for the proper positioning of the job on the machine:

1. Maximum travel area in the Machine Properties of LinkMotion
2. Matching page size in the job design application program
3. Starting position with necessary offsets
4. Physical positioning of the tool on the machine to match the declared starting position with offsets

If you are using Corel Draw to design the job with the page size set to the material size (instead of the machine size,) please refer to the section – Design using material size in the Materials Properties section.

## **How maximum Travel for table size X and Y works with home switches and without home switches:**


**Home Key in Absolute Mode** - The LinkMotion now manages the working area (Maximum travel declared X and Y axis in Machine properties) of the machine in an absolute mode. LinkMotion will keep track of the position of the tool (laser head in case of a laser machine or spindle in case of a CNC/Engraving machine) and will not allow the machine to travel outside the working area. It is necessary to have home switches on the machine and it is also necessary to home the machine when LinkMotion is launched. Upon launching LinkMotion, handshaking with the Agni controller takes place. LinkMotion notes the starting position when it finds the home switches. From there on, LinkMotion will track the absolute position of the machine and will prevent the machine from traveling outside the declared working area in the Machine Properties Tab.

### **Temporary new start position after homing:**

The user can also move the machine away from the home(parking) position after homing it once and that can become a new **temporary starting position**. Send a job (assuming that enough area is available for the job you are sending) and now if you pause and decide to go home it will go back to the temporary new start position and not the original home position where it senses home switches. The user can continue to work from this temporary new start position.

The user can move the machine anywhere and send a job from a program like Corel Draw. If the job is larger than the available working area from the temporary start position, the user will be warned about the

size of the job is bigger than the remaining available area on the machine. The message will be displayed as shown in the following picture:

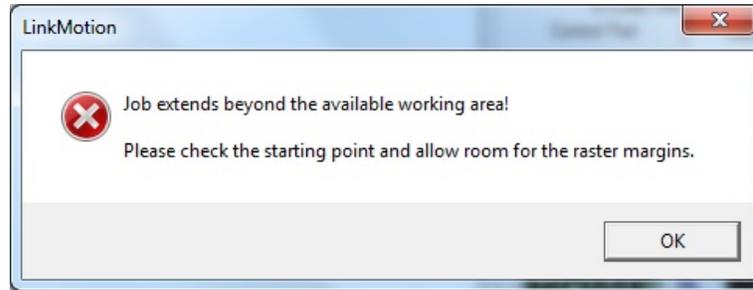

**The user can deactivate this function or protection by checking “disable home switches” in origin setup and Re-Launch Linkmotion.**

**It is important to note that this protection of keeping the job within the working area is not effective** if either the machine is not equipped with home switches, home switches are not activated in the software or the machine is not homed at the time of launching the LinkMotion driver software.

**Similarly, travel of the X and Y axis using the Nudge function** also will limit the declared distance in the maximum travel for X and Y axis when home switches are activated and the homing procedure is followed.

### **How maximum Travel for Z axis works with home switches and without home switches:**

**Z-axis soft limit** is an additional feature that will respect the travel distance declared in the Maximum Travel for Z axis declared in the Machine Properties. **It will be effective when home switches are activated in the Origin setup area. It is also effective when Z Ref Key is used.** The user can use either automatic homing feature with all three axes to home properly at the launch of Linkmotion or manual homing can be done by pressing the home key of the control pad and also separately use the ZRef key for homing the Z axis. In both cases, Z axis will limit the travel distance declared for Z axis under Machine Properties.

### **Linear travel per revolution for X, Y, and Z:**

Linear travel per revolution can be changed here if necessary. You may not know all the specifications of your system. The specifications include the pitch of the screw (2 turns per inch, 5 turns per inch, etc.) or belt and pulley movement for a complete turn of the step motor, the full step angle of a step motor (200 full steps for a 360 degree turn, etc.), and the micro-stepping of the driver. If you know any two of the three, the third one can be determined using the nudging feature of the Control Pad. Typically, the Control Pad is activated by pressing with your finger on the physical keys of the keyboard. The nudge feature is activated using a single click of the mouse on the appropriate key on the screen. The nudge distance is set in the General Options. Measure the actual distance moved by the machine and compare it to the nudge distance setting. Make the necessary correction of the value for the unknown parameter to get the specified nudge distance.

**Do not declare zero value even if your machine does not have Z axis. The user should leave the default value.**

### **Machine Calibration(setup) Test:**

There is one simple test you can do using the nudge value in the General Options tab. The default nudge value when you install LinkMotion is one inch. You can change this nudge value to 0.25 or 0.5 inches for the Z axis if your machine has a small overall travel distance.

When you bring up the Control Pad and click with the left mouse button of your mouse on the X axis right movement arrow, your machine should move 1 inch to the right. If it does not move 1 inch then the values declared in the settings described above are not correct and need to be adjusted.

You can do this nudge test for all three axes to determine if your settings are proper in Linear Travel per revolution of Machine Properties as well as Microsteps per full step in Motor parameters.

The following two values are important for getting the proper output size.

(1) Linear Travel per revolution in Machine Properties


The pitch of the screw or belt and pulley arrangement in all the motorized axes determines the linear movement of the axis per single rotation of the step motor.

(2) Microstep per full step in Motor Parameters

The step motor drivers used for the motors of your machine determine this value.

### **Cylindrical Axis:**

A cylindrical axis capability is built into LinkMotion. You should enable this feature only if your machine is equipped with a cylindrical axis capability. Check the Enable Cylindrical Axis box and you will see a message for new table size along with the two more boxes will show up for additional settings. These are Job Piece Diameter and Motor Gear Ratio.

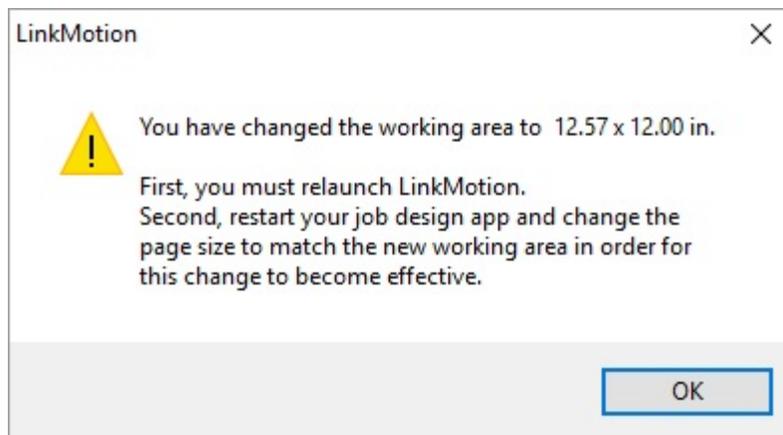

**It is very important to Re-launch LinkMotion applet as well as your Design Application after you make the selection for Cylindrical Mode or make any changes to the information for gear ratio or job piece diameter.**

**The Maximum Travel size of the table in X or Y will change when you Enable Cylindrical Axis Support. You do not need to enter this new size in the Maximum Travel area of LinkMotion. However, it is very important to remember the dimensions and create that page size in your design applications like Corel or AutoCAD. Selecting X or Y to match the cylindrical axis for your machine. Motor Gear Ratio and Job Piece Diameter are entered for your job in the section below the checkbox.**

Do not check **Design using material size** when the cylindrical feature is activated. If it is checked, remember to uncheck it before working on cylindrical jobs. **Also, most machine use center starts position for cylindrical work.**

**Following setting is available in the LinkMotion.INI file under each machine related settings for cylindrical work:**

UseCAxis=0 or 1

Use 0(zero) value if existing X or Y axis driver(amplifier) is replaced by cylindrical axis motor.

Use 1(one) value if the separate driver(amplifier is used for cylindrical axis motor.

We place default value of 1 for every machine when software is installed. The user needs to change, save the Linkmotion.INI file and Re-Launch LinkMotion if this value is changed for it to work properly.

**If UseCAxis=0 is selected in your LinkMotion.INI file, you need to also change the following setting:**

The second change that is necessary is for the acceleration of C axis. This can be obtained by reducing the number of the motor parameters under Maximum Toolhead Acceleration for either X or Y axis depending on what you have selected in the Machine Properties for the cylindrical axis.

**If UseCAxis=1 is selected in your LinkMotion.INI file, you need to also change the following setting:**

Go to the LinkMotion.INI file. Find all the settings for your selected machine name. Now find the following line within your machine related settings:

CMaxAccel\_in=10.0000

CMaxAccel\_cm=25.4000

CMaxAccel\_mm=254.0000

Depending on what unit of measurements you have selected in the LinkMotion you can lower this number for Maximum Acceleration value. Save the file and Re-Launch LinkMotion for this to be effective.

**Also, the counter on the LinkMotion Control Pad does not display information for cylindrical axis when the cylindrical option is activated.**

### **Raster settings:**

**Raster work will require additional raster margin value for the travel on X-axis on both sides of the raster job. An example is below:**


**Default raster margin declared is 1” on both the sides for raster jobs. Your job should be placed and designed such that the machine has 1” extra travel available on both the sides for X-axis.**

Raster Settings are for filled shapes and bitmap jobs. LinkMotion driver software has a protection warning if the job is not generated properly for raster job. In other words, the job has too many raster shapes designed separately such that it will take too long to perform the job.

In the second section of the LinkMotion.INI file following line controls this warning.

**MaxBMPCount=100**

LinkMotion will display a message as shown below if the design file had more than what is declared here for the number of raster shapes.

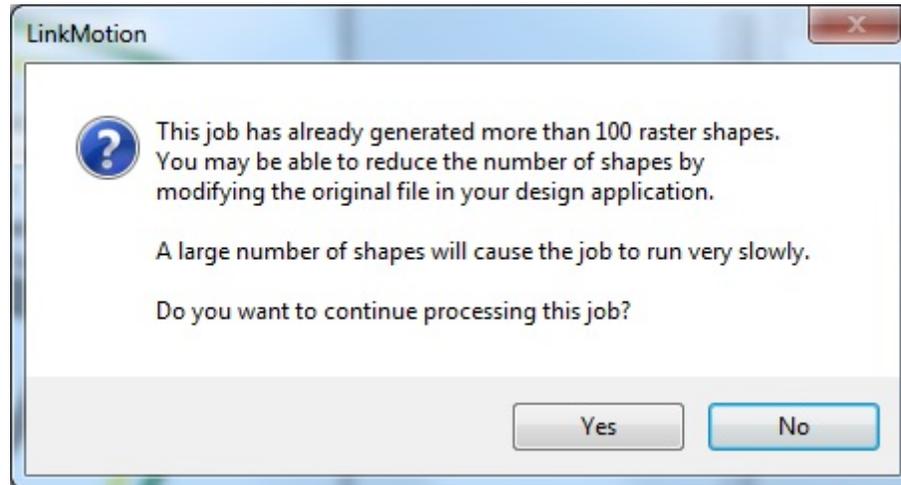

Click on the 'Yes' button will continue processing job further and 'No' button will allow you to quit the job. This will help in correcting your design file to save the job time. The user can declare higher or lower number in the LinkMotion.INI file for LinkMotion to display this message earlier or later.


**Top Down or Bottom Up** selects the starting position of an to engrave (raster) job. The air flow inside the laser machine may determine the direction of the processing of the raster job. The starting position of the machine may also become a deciding factor here.

In either case, the raster job is processed both left to right and right to left along the X-axis.

**(Using Top-Down selection in LinkMotion generates regular BMP image of all raster shapes while using Bottom-up selection will generate BMP image that is upside down(inverted) for our internal requirement only for proper output.)**

**DPI** is the selection of dots per inches. **This selection is made for both vector and raster job.** Using a lower number reduces the resolution and increases the processing speed for raster jobs. Photographs may require a higher resolution for best quality. In case of vector jobs, a value between 300 to 600 should give you a good result. If your table size is very large like 96"x 48" then you should never select 1000 DPI. The DPI setting should be between 300 and 800 DPI. We recommend that you experiment with different DPI numbers for the best output of the job before you do your final production. This setting is controlled from the user interface with the following line in the INI file.

**The user will see the following message when DPI value is changed.**

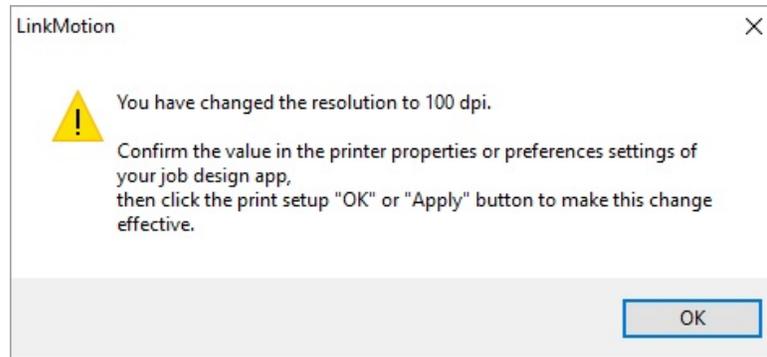

**DPIscale=30 (Default DPIscale value 30 is for 300 DPI. 600 DPI should change DPIscale to 60.) Prior to this 4.0 version, LinkMotion required that the job design program (For example, Corel Draw!) needed to be re-launched along with LinkMotion when a different DPI resolution value was selected in LinkMotion for raster (engrave) processing. The new procedure is quite simple:**

- Change the DPI value for resolution under raster setting in the Machine Properties Tab.
- As soon as you click the APPLY button, you will see instructions on the screen to follow.
- No Need to re-launch any of the programs.
- In Corel Draw, for example, click on the “properties” or “preferences” button (based on the version of Corel Draw) in the print dialog box. Next, click on the “advanced” button to observe the selected resolution. Click OK button and another OK. At this point, you are all set to send the job.
- Similarly, navigate to the printer properties or preferences in other design software and make sure that the proper resolution values are registered with the job design software before sending the job and make sure to click OK or Apply to make the new setting effective.
- It takes some time to re-launch job design software. The process is speeded up significantly by eliminating the need for re-launch.

**Guidelines for generating Vector or Raster output:**

Following guidelines are created using Corel X4 and Win7 64 bit computer. It may vary for other design applications and older operating system.

<b>Resolution DPI</b>	<b>50</b>	<b>100</b>	<b>200</b>	<b>300</b>	<b>400</b>	<b>500</b>	<b>600</b>	<b>750</b>	<b>800</b>	<b>1000</b>
<b>Line Weight</b>										
<b>0.001” - 0.0254mm</b>	Vect	Vect	Vect	Vect	Vect	Vect	Vect	Vect	Vect	Vect
<b>0.002” - 0.0508mm</b>	Vect	Vect	Vect	Vect	Vect	Vect	Vect	Vect	Vect	Vect
<b>0.003” - 0.0762mm</b>	Vect	Vect	Vect	Vect	Vect	Vect	Vect	Vect	Vect	Vect
<b>0.004” - 0.1016mm</b>	Vect	Vect	Vect	Vect	Vect	Vect	Vect	<b>Rast</b>	<b>Rast</b>	<b>Rast</b>
<b>0.005” - 0.1270mm</b>	Vect	Vect	Vect	Vect	Vect	Vect	<b>Rast</b>	<b>Rast</b>	<b>Rast</b>	<b>Rast</b>
<b>0.006” - 0.1524mm</b>	Vect	Vect	Vect	Vect	<b>Rast</b>	<b>Rast</b>	<b>Rast</b>	<b>Rast</b>	<b>Rast</b>	<b>Rast</b>
<b>0.007” - 0.1778mm</b>	Vect	Vect	Vect	<b>Rast</b>						
<b>0.008” - 0.2032mm</b>	Vect	Vect	Vect	<b>Rast</b>						
<b>0.009” - 0.2286mm</b>	Vect	Vect	Vect	<b>Rast</b>						
<b>0.010” - 0.2540mm</b>	Vect	Vect	<b>Rast</b>							

0.016” - 0.4064mm	Vect	Vect	Rast								
0.028” - 0.7112mm	Vect	Rast									
0.030” - 0.7620mm	Vect	Rast									
0.040” - 1.0160mm	Rast										

**DPI Guidelines for high quality output and Mamximum available table size (required only for V4.77 and lower): V4.78 does not have this limitation.**

Version 4.78 and higher does not require for user to follow DPIScale and DPIIndex setting in the LinkMotion.INI file.

DPIResolution=600(default number) User can change this number to 400, 500, 600, 750, 800 or 1000 if needed in user interface. Click on the apply button and re-launch LinkMotion for it to be effective.

Version 4.77 and lower you need to refer to the resolution number chart for maximum available output size for the table size as described in the DPI Resolution information in next few pages. Do not design jobs outside of that page area.

The example below gives maximum X and Y axis numbers. The user can change X and Y in any combination as long as it does not exceed the multiplication number then it will work. Design applications you use may have their own limitations. Please check with the manufacturer of your design application for proper use of following settings.

**Example:** Corel draw works well but Adobe Illustrator works at 1000DPI in default mode so Illustrator users can work with a maximum table size of 65” x 65” or 84” x 50” or 96” x 44” so it does not exceed multiplication 4225 number.

**400 DPI** – Maximum table size 163”x163” = 26,569 Do not exceed this multiplication number.

**500 DPI** – Maximum table size 129”x129” = 16,641 Do not exceed this multiplication number.

**600 DPI** – Maximum table size 109”x109” = 11,881 Do not exceed this multiplication number.

**750 DPI** – Maximum table size 87”x87” = 7,569 Do not exceed this multiplication number.

**800 DPI** – Maximum table size 81”x81” = 6,561 Do not exceed this multiplication number.

**1000 DPI** – Maximum table size 65”x65” = 4,225 Do not exceed this multiplication number.

**PPI** is the pulse rate per inch. The PPI selection is independent of DPI selection. **It affects the laser frequency setting for raster jobs.**

**Speed, power, and frequency settings for the Raster (Engrave) jobs.**

Speed setting for the raster job, left to right, is set in the Materials Tab.

Power setting is picked up from the same area as for the vector jobs. LinkMotion will look at the color of the job and will pick up the power setting for the color. This is one of 10 RGB colors organized in the Materials Tab along with the color palette provided by Solustan for Corel Draw.

Frequency setting for the raster job is a function of PPI, pulses per inch. We multiply PPI with the speed to arrive at pulses per second or frequency.

**Engrave Speed/Raster speed in Material properties in inches (mm will be converted to inches) is multiplied with PPI value declared in the Machine properties setup for deriving proper frequency value for Raster work declared as Q value when raster G-Code is generated.**

Following line is added in the LinkMotion.INI file under each machine related settings.

**MaxLaserFrequency=10000**

The user should declare a proper value for their laser machine by checking with the manufacturer for Maximum Frequency generated. This number declared above prevents the PPI and Raster Speed from going over 10000.

**Example:**

Raster speed 20in/sec and PPI is 500 than trying to increase PPI will display a warning message.

**"The current raster speed setting of 20 in./sec limits the PPI to 500"**

If you try to change the raster speed, you'll see this message:

**"The current PPI setting of 500 limits the raster speed to 20 in./sec."**

**How to check LinkMotion generated G-Code file and BMP file(For raster) :**

**There is an excellent diagnostic capability built into the software to check out for errors.** Every job that is 'Printed' from a program like Corel Draw is saved as a temporary file on the hard disk of the PC until the next job is sent. The job is saved as a **temp.txt** file. Since it is G code, for the most part, it is easier to read and decipher.

Following location will have the Temp.txt G-Code file :

**Windows 10, 8, 7 32/64:**

In the C:\ **ProgramData** > **Solustan** > **LinkMotionUSB** > **Temp.txt**

**Windows XP:**

In the C:\ **Document and Settings** > **All Users** > **Solustan** > **LinkMotionUSB** > **Temp.txt**

If there are any raster parts in a job (only in the laser version), the raster jobs will be saved as BMP files. Any Paint type program can open BMP file for your review. The limit of BMP files included in any one job is 1016. There is almost no chance for a user to reach such a limit.

**The following location will have the LinkMotion generated BMP file for your job:**

**Windows 10, 8, 7 32/64:**

In the C:\ **ProgramData** > **Solustan** > **LinkMotion** > **1.BMP** (more files if more than one BMP is generated)

**Windows XP:**

In the C:\ **Document and Settings** > **All Users** > **Solustan** > **LinkMotion** > **1.BMP** (more files if more than one BMP is generated)

**(Using Top-Down selection in LinkMotion generates regular BMP image of all raster shapes while using Bottom-up selection will generate BMP image that is upside down(inverted) for our internal requirement only for proper output.)**

## **Engrave (Raster) Backlash Settings:**

Earlier versions of LinkMotion required the user to go to the LinkMotion.INI file to enter the backlash for vector and raster jobs. LinkMotion version 3.76 and higher has a user interface on the Machine properties for setting up vector and raster backlash. Please read, understand and then set it up properly.

Backlash is available separately for raster and vector mode. Raster mode requires backlash in X-axis. In the raster mode, run a job at a very low resolution (50 or 100 DPI) on a material where the lines show up clearly. Run comfortably low level of power to be able to see the different lines in the X-axis sweep on your material. You may notice that the lines do not align properly at both the ends. **Measure the difference and that value should be entered as a positive value.** Raster job can have multiple backlash values with different speeds. We have provided eight different speeds as default values and the user can edit those values by double click on those speed numbers. Similarly, backlash values can be entered in inches and mm depending on the what default mode you have selected for LinkMotion. Double click on the button for **Engrave (Raster) Backlash** button and you will see the following screens for you to enter proper backlash values with respective speed selections. After making those changes it is important to click on the Apply button on this screen and again on the Apply button on the Machine Properties screen for it to be effective. Once you have setup proper numbers we generate proper g-code with effective backlash values and you should see proper raster output.



**Important: Machine requiring backlash value in raster mode will also require backlash settings for cut(vector) mode. Make sure to set proper backlash numbers for Raster and Vector mode in order for your machine to perform better for raster work. Cut(vector) backlash setting information is provided in the following pages.**

LinkMotion looks for the backlash value for a speed that's equal to or greater than the job speed. It then looks at the backlash value for the speed that's lower than the job speed and calculates the value of the in-between job speed. **If there's no backlash value available for a speed that's equal to or greater than the job speed, the backlash value will be set to zero.**

Simple example:

Speed	Backlash
100 mm/sec	1 mm
500 mm/sec	5 mm
1000 mm/sec	10mm

If the job speed is set to 700 mm/sec, the backlash will be 7 mm. In this example, if the list of backlash values did not have an entry for 1000 mm/sec, the backlash for 700 mm/sec would be set to zero.

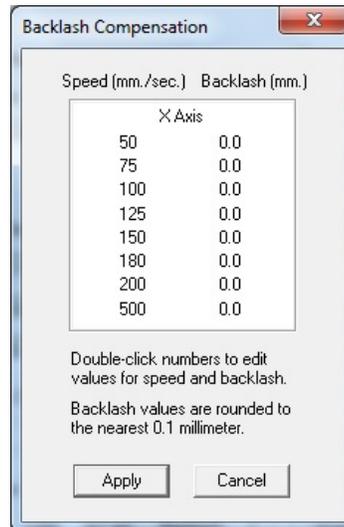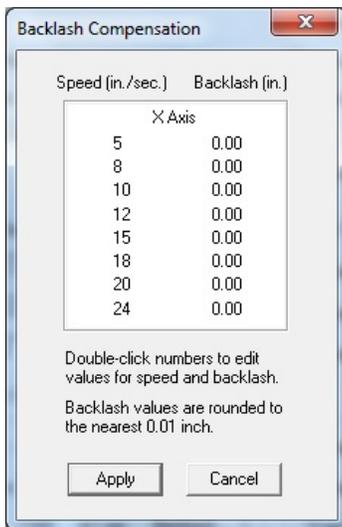

## **Cut (Vector) Backlash Settings:**

The LinkMotion has the capability to handle the backlash for each of the axis individually for vector work. Machines may have a backlash and may change with the aging of the belts and pulleys and screws. In the vector mode, you try to output a circle and if it does not come back to the same starting point of the circle when it finishes the job, it may need ‘tuning’, also known as backlash correction in one or both the axis. Measure that distance in x and y directions for both the axis and enter that value for X and Y axis separately in the user interface available in Machine Properties and click on the Apply button. You need to enter in inches or mm depending on what you have selected as default in LinkMotion setup.

## **Raster Margin Value:**


Raster Margins for travel of X-Axis is controlled by the following the line in the LinkMotion.INI file under each machine related settings:

**BMPMarginMultiple=5**

The default value is 5 and it creates 1inch margin on both sides. Increasing this number adds additional 0.2 inches. Remember to save the INI file and relaunch LinkMotion for the newer value to be effective.

**Detail explanation for setting up the Raster Margin value along with proper Raster Acceleration number is explained in section II of FAQ (Frequently Asked Questions).**

## Motor Parameters:

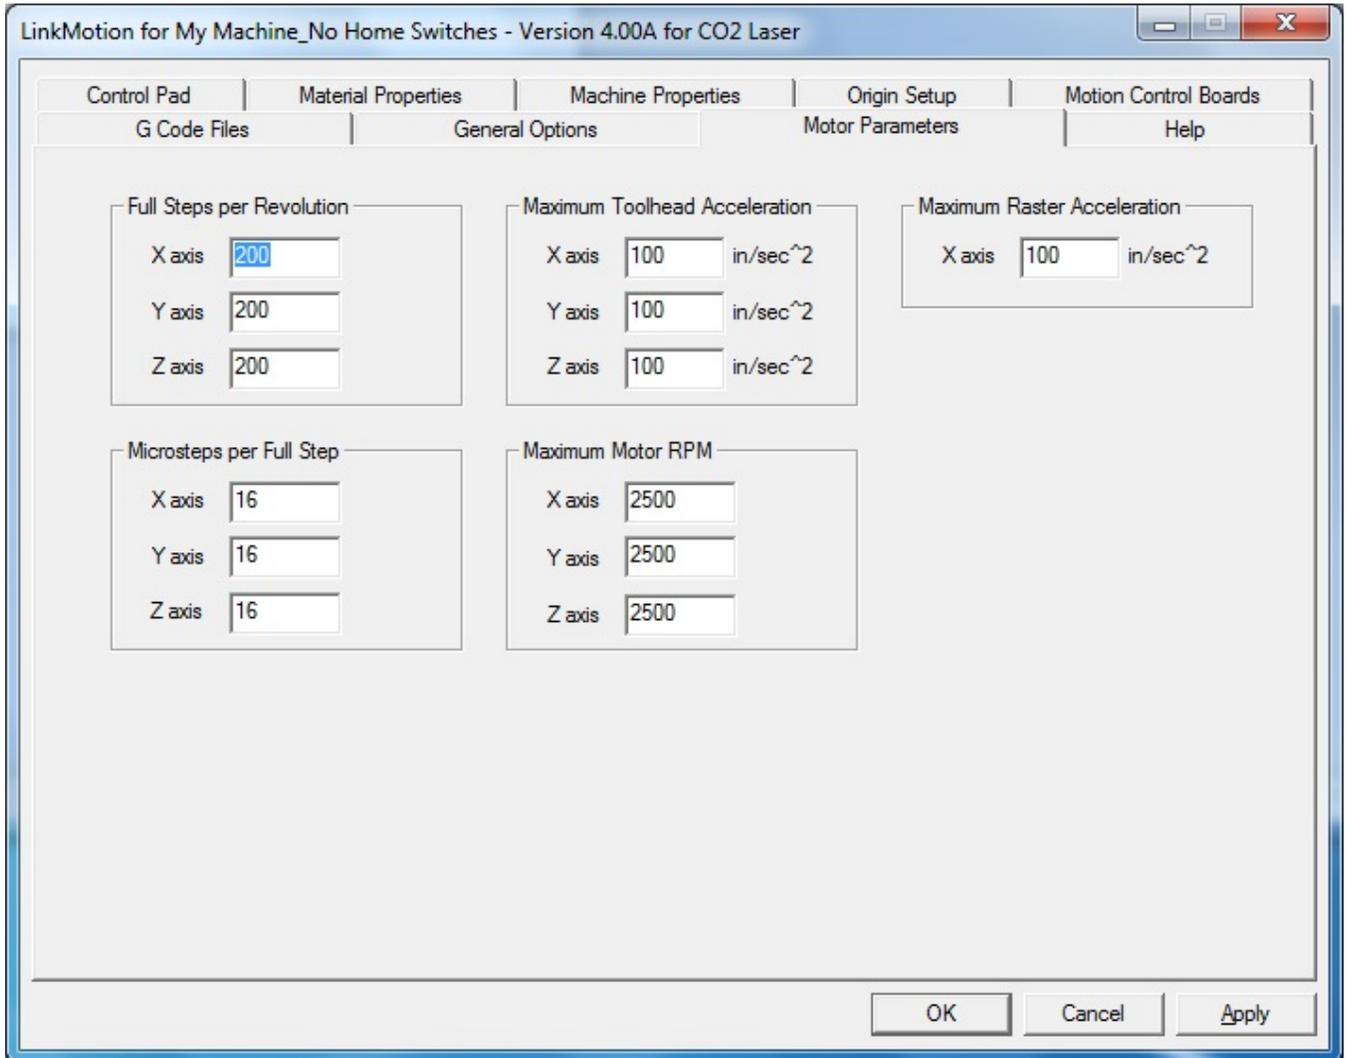

### Full steps per Revolution:

Above values are determined by the motor manufacturer. Enter **Full steps per revolution** values for each axis per manufacturers specifications.

### Maximum Toolhead Acceleration:

Declare Toolhead Maximum Acceleration values for vector jobs in the motors for each axis in inches per second per second. You may need to adjust this numbers to get smooth motion. Check with your machine manufacturer for the correct numbers for your machine. In absence of that, a safe starting range is between 10 and 100 inches/sec or 250 to 2540mm/sec. **Refer to Section II of LinkMotion driver software settings under FAQ (Frequently Asked Questions) area for setting up proper acceleration numbers for Vector jobs.**

**Keep in mind that Cylindrical work may require lower acceleration value for whichever is selected to**

be the cylindrical axis. Refer to the machine properties section for the cylindrical axis acceleration setup.

### **Microsteps per Full Step:**

Set the **Microsteps per full Step** for your system for each of the axis. This is necessary only if you are using step motors in your system. This number is derived from the Amplifier driver used for your motors. In case of servo motors, you need to make sure that the multiplication of numbers in this area as well as in the number of full steps per revolution of the motor in the Motor parameters match your encoder number for the feedback. Generally, it would be a good idea to declare number 1 as the number in the microsteps per every full step and the encoder resolution number in the number of full steps per revolution in the motor parameters.

### **Machine Calibration(setup) Test:**

A simple test using the **nudge** feature in the **General Options** tab will help to determine the proper setting of the resolutions for each of the axis.

Bring up the control pad and click the mouse on one of the X, Y, or Z directional move keys on the screen. The laser head shall move in the appropriate direction the distance equal to the value declared in the nudge location in General Options tab.

It is simple to determine if your settings are proper in **Linear Travel per revolution of Machine Properties** as well as **Microstep per full step in Motor parameters** with the help of nudge feature.

**Following two values are important for getting proper size output.**

#### **(1) Linear Travel per revolution in Machine Properties**

The values in each of the three axes determine the linear movement of the axis per single rotation of the step motor.

#### **(2) Microstep per full step in Motor Parameters**

Step motor Drivers used for the motors of your machine determine this value.


### **Maximum Motor RPM:**

Maximum Motor RPM should be specified by your motor manufacturer. Most step motors lose torque significantly after 2,500 RPM. LinkMotion will use your RPM and other motor settings to limit your maximum speed settings in the Material Properties tab.

### **Maximum Raster Acceleration:**

Accelerations for Vector and Raster jobs are calculated separately for better output. The user should declare proper Raster Acceleration values here for your motors. You can check with the motor manufacturer or try different numbers before doing your final production. **Refer to Section II of LinkMotion driver software settings in FAQ (Frequently Asked Questions) area for setting up proper acceleration numbers for Raster jobs.**

## Origin Setup:

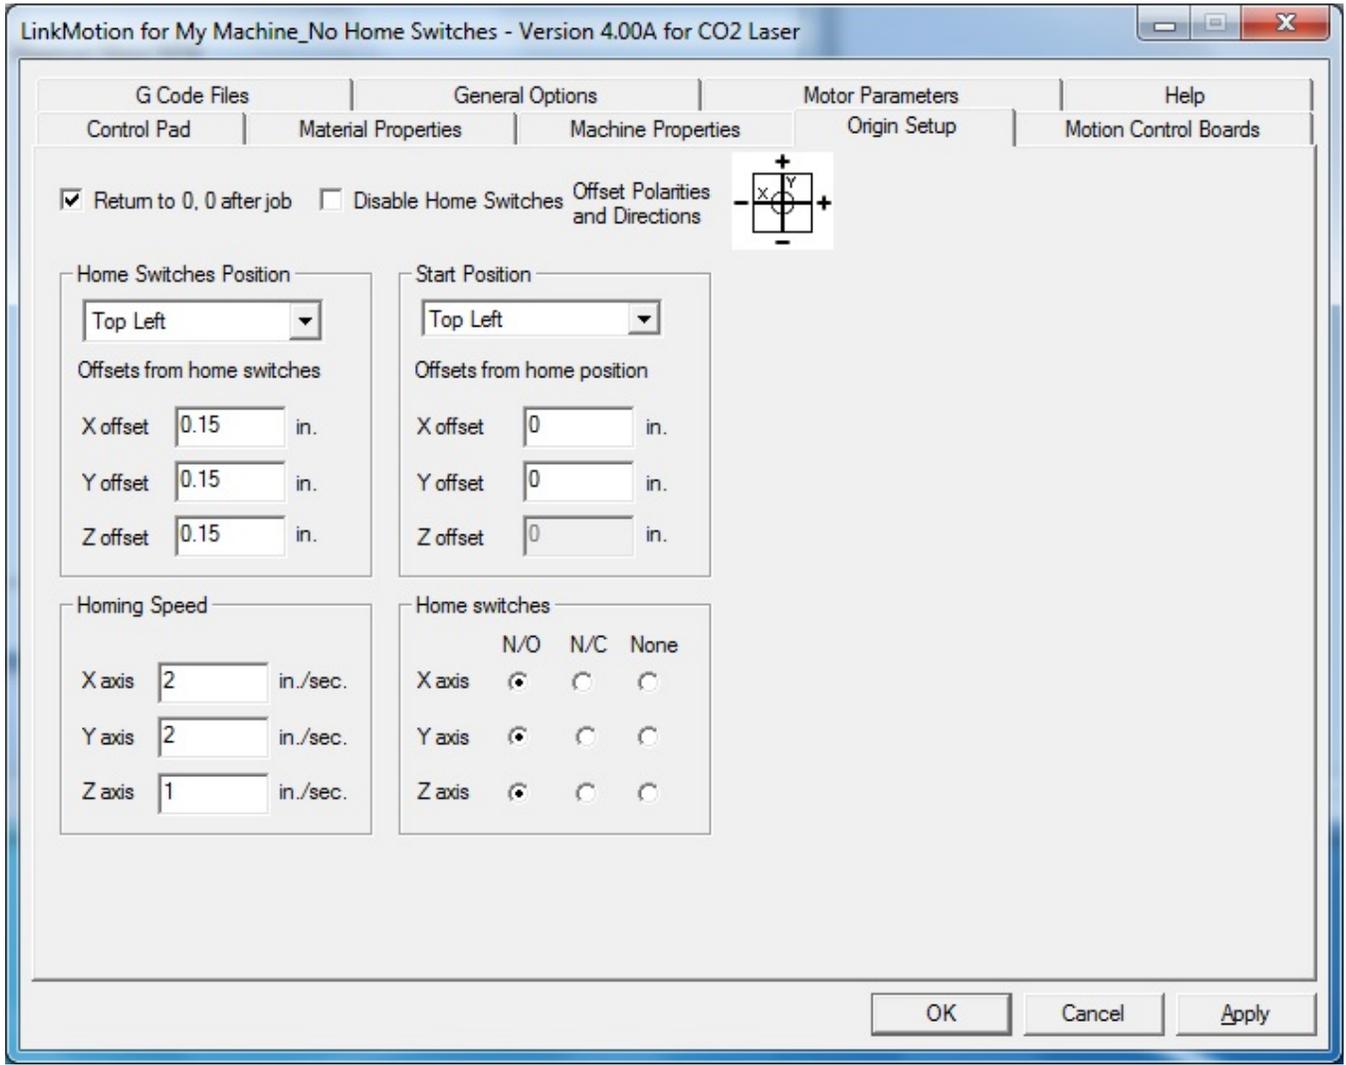

### Return to 0, 0 after job:

If you have not checked this box then, after finishing the job, the tool will travel up on the Z axis and stop at the XY position where it finished the last shape. It does not move from the final XY position. It does not go back to the start position. Checking this box makes your tool go back to the starting position (parking position) for the X, Y and Z axes.

Most of the time, the parking position for X and Y is 0, 0. If you need to sense the home switches again then you should first make sure that your surfacing value in the Z axis is proper by checking Origin Setup and Z offset values in Start Position. Then click on the Control Pad Home key to place your tool in the home position. If you need to change the surfacing value then you need to surface the tool again and then go home.

### Disable Home (Limit) Switch:

Checking this box disables the limit switches. Un-checking this box activates the limit switches. If limit switches are present, you must select normally open or closed for the home switch polarity.

**If the disable home switch button is not checked then homing is activated and the user should fully understand the function of homing using the home key as well as automatic homing when LinkMotion is launched. Please refer to Home Key as well as Z Ref key functions in Control Pad explanation before using it.**

## **Offset Polarities and Directions:**

Offset polarities and direction diagram are shown to display how Machine's travel for X and Y axis works using LinkMotion software. It also displays positive or negative values respectively on the control pad of LinkMotion.

### **Positive and Negative Direction Explanation:**

- (1) If your tool is parked on the top left area of your machine then X-axis travel to the right is positive values and Y-axis travel towards front has negative values.
- (2) If your tool is parked on the bottom left area of your machine then X-axis travel to the right is positive values and Y-axis travel towards the back has positive values.
- (3) If your tool is parked on the top right area of your machine then X-axis travel to the left is negative values and Y-axis travel towards front has negative values.
- (4) If your tool is parked in the bottom right area of your machine then X-axis travel to the left is negative values and Y-axis travel towards back has positive values.

General Z down travel is negative and Z up travel is positive values. Z-axis values are calculated after Z axis is surfaced on the table (Either using Z Ref or Homing key as explained in the Control pad explanation) and surfacing value is considered to be zero position.

## **Home Switches Position:**

This is the parking position of the tool for your machine. Bottom Left, Bottom Right, Top Left and Top Right are the choices. It is important to understand the setting of the origin for the machine. If the machine has home switches, it will have a defined Home position. This position should be selected. The offsets from the home switch serve two purposes:

- A. The offset values will allow the machine to move back by the declared distance after reaching the switch. It is always a good idea to get off the switch once it has been sensed.
- B. The offset values can be adjusted to send the machine to a specific starting position, such as a far corner of the table.
- C. **The offset values should be always positive values** and recalibrated every six months or anytime the sensor is replaced, or as often as necessary to maintain the integrity of the home position.

## **Homing Speed:**

The Homing speed for going home is separate from the jogging and move speeds. The machine starts out traveling at the set homing speed. Once reaching home, the machine travels 0.25 inch back into the working area of the table and hunts for home again at a slower speed. This sets the table with the exact home position every time. The Home key is key 7 on the Control Pad. Different homing speed settings for Z, X and Y are available here.

## **Start Position:**

The choices are **Bottom Center, Bottom Left, Bottom Right, Center, Top Center, Top Left and Top Right**. If your Home Position and Start Positions are the same, the following selections are necessary:

<b>Home Position Selection</b>	<b>Start Position Selection</b>
Bottom Left	Bottom Left
Bottom Right	Bottom Right
	Center
	Top Center
Top Left	Top Left
Top Right	Top Right

The job start position can be different than the Home position. The Job start position may be, Where the jig is positioned (Home Position)

The Center of a machine, with offset values in X and Y, in the case of a vise-type machine where both jaws move.

Top center of a machine with an offset value in X only, in the case of a vise-type machine where only the bottom jaw moves.

In the situations above and others, it is necessary to select a Start Position and declare offset values for X and Y appropriately. Please see the diagrams on the following pages.

## **Offset from Home Position:**

Offset values under the Start Position have been explained using the diagrams in following few pages. This values can be positive or negative depending on your selection for the Home Position. Make sure to understand and set it properly before starting your production work.


## **Automatic Homing Set up:**

**Automatic Homing set up** is available using the following line in the Linkmotion.INI file under your selected machine related settings every time LinkMotion is Launched. This allows the user to control the machine not to travel beyond the working area. Please read and understand the detail explanation given in the LinkMotion Control Pad explanation under the Home Key area before using it.

**GoHomeAtStartup=1** (This setting will initiate automatic homing)

**GoHomeAtStartup=0** (This setting will **NOT** start automatic homing)

# Start Position Explanation

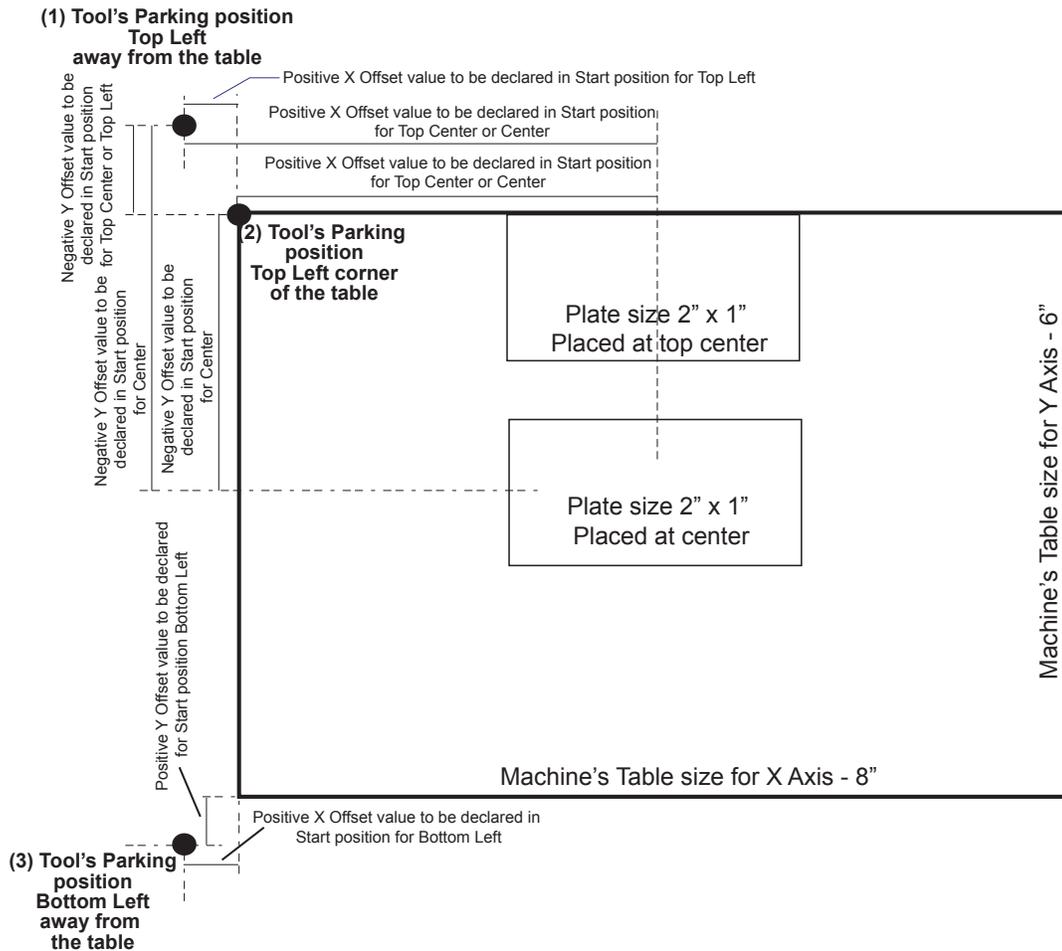

Three different Home Positions are shown in the above diagram.

**(1) Top left away from the table, (2) Top left at the corner of the table and (3) Bottom left away from the table.** Start position offset values are shown in the diagram above after you have parked the tool in those positions.


Home Switch Position values for X, Y and Z offset are the values where you want to park the tool after it senses the home switches and parks away from those switches

Start position offsets are declared when tool is parked away from the table or Top Center or Center is selected to be the Start position. Above diagram explains how to setup and enter positive or negative values for Start Position in Origin Setup of Linkmotion.

If your machine is designed to use other home position for parking of the tool then measure the distance from those locations and decide the proper values to declare in positive or negative numbers in the origin setup accordingly.

If you are using engraving design software where design is done in actual plate size then it is better to declare your table size to be same as your plate size and re-launch your design software to get the proper output in proper location.

### Tool's Home/Park position at the top left corner of the table

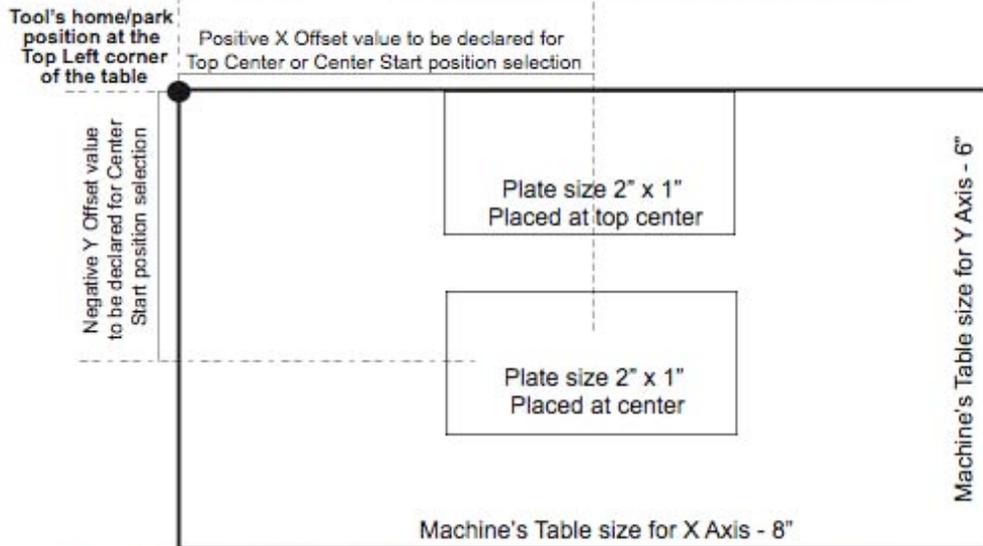


Tool is parked at the Top Left corner of the table(machine) and home position selection should be Top Left. Following three choices are available for Start position and respective offset values to enter:

- (1) Top Left - X and Y offset values should be 0 (zero).
- (2) Top Center - Positive X offset value and Y offset value is 0 (zero).
- (3) Center - Positive X offset value and Negative Y offset value.

Top Center and Center selection used for vise type machines.


### Tool's Home/Park position at the bottom left and away from the table

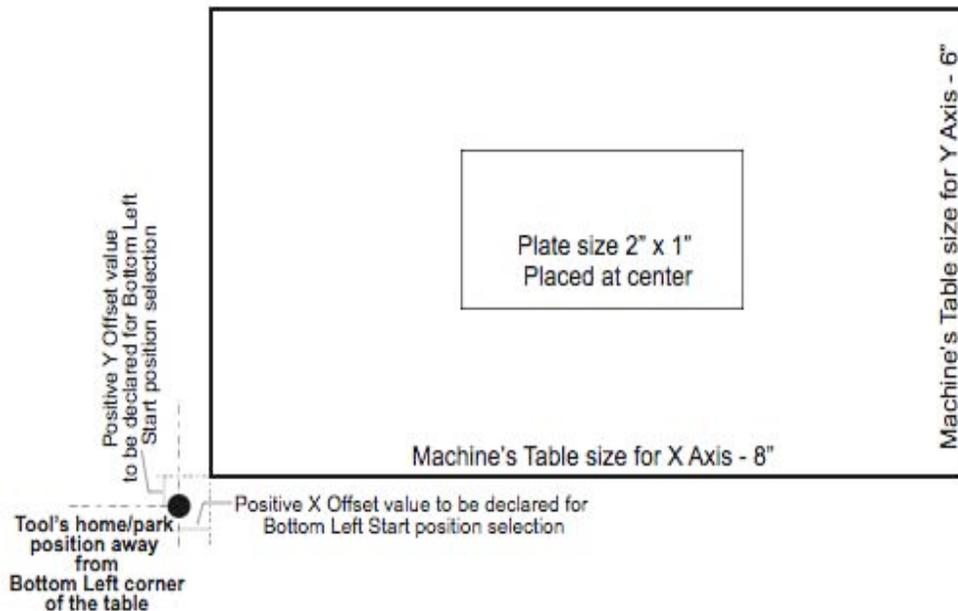

Tool is parked at the Bottom Left and away from the table(machine) and home position should be Bottom Left. Following choice is available for Start position and respective offset values to enter:

- (1) Bottom Left - Positive X and Y offset value. (X and Y offsets are small)

## Tool's Home/Park position at the Top Left away from the table

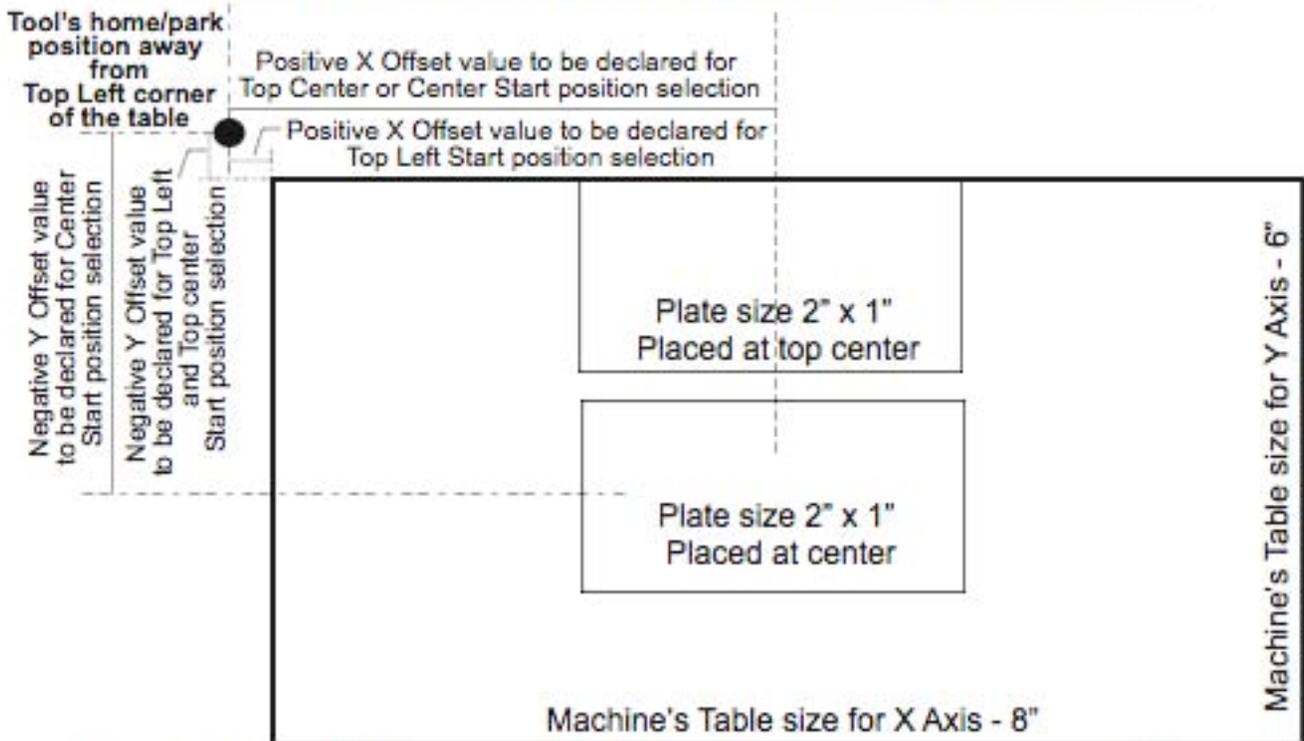

Tool is parked at the Top Left and away from the table(machine) and home position should be Top Left.

Following three choices are available for Start position and respective offset values to enter:

- (1) Top Left - Positive X offset value and Negative Y offset value. (X and Y offsets are small)
- (2) Top Center - Positive X offset value and Negative Y offset value. (X offset is large and Y offset is small)
- (3) Center - Positive X offset value and Negative Y offset value. (X and Y offsets are large)


Top Center and Center selection used for vise type machines.

## Home Switches:

**Home Switches** for each axis can be selected individually by checking **X, Y or Z axis enabled**. This depends on how your machine is built. Some machines have home switches for all three axes and some have for X and Y but not for Z axis. Make a proper selection of your machine.

**Home Switch Polarity** selection is available for **Normally Open** as well as **Normally Closed** and it depends on how the wiring is done for your home switches. LinkMotion will sense those switches and show you **green lights on the control pad** (next to X, Y, and Z movement boxes) when we sense proper switches. If you do not know how your machine is wired then try selecting one after another and when the lights are green you have made the proper selection.

## G Code Files:

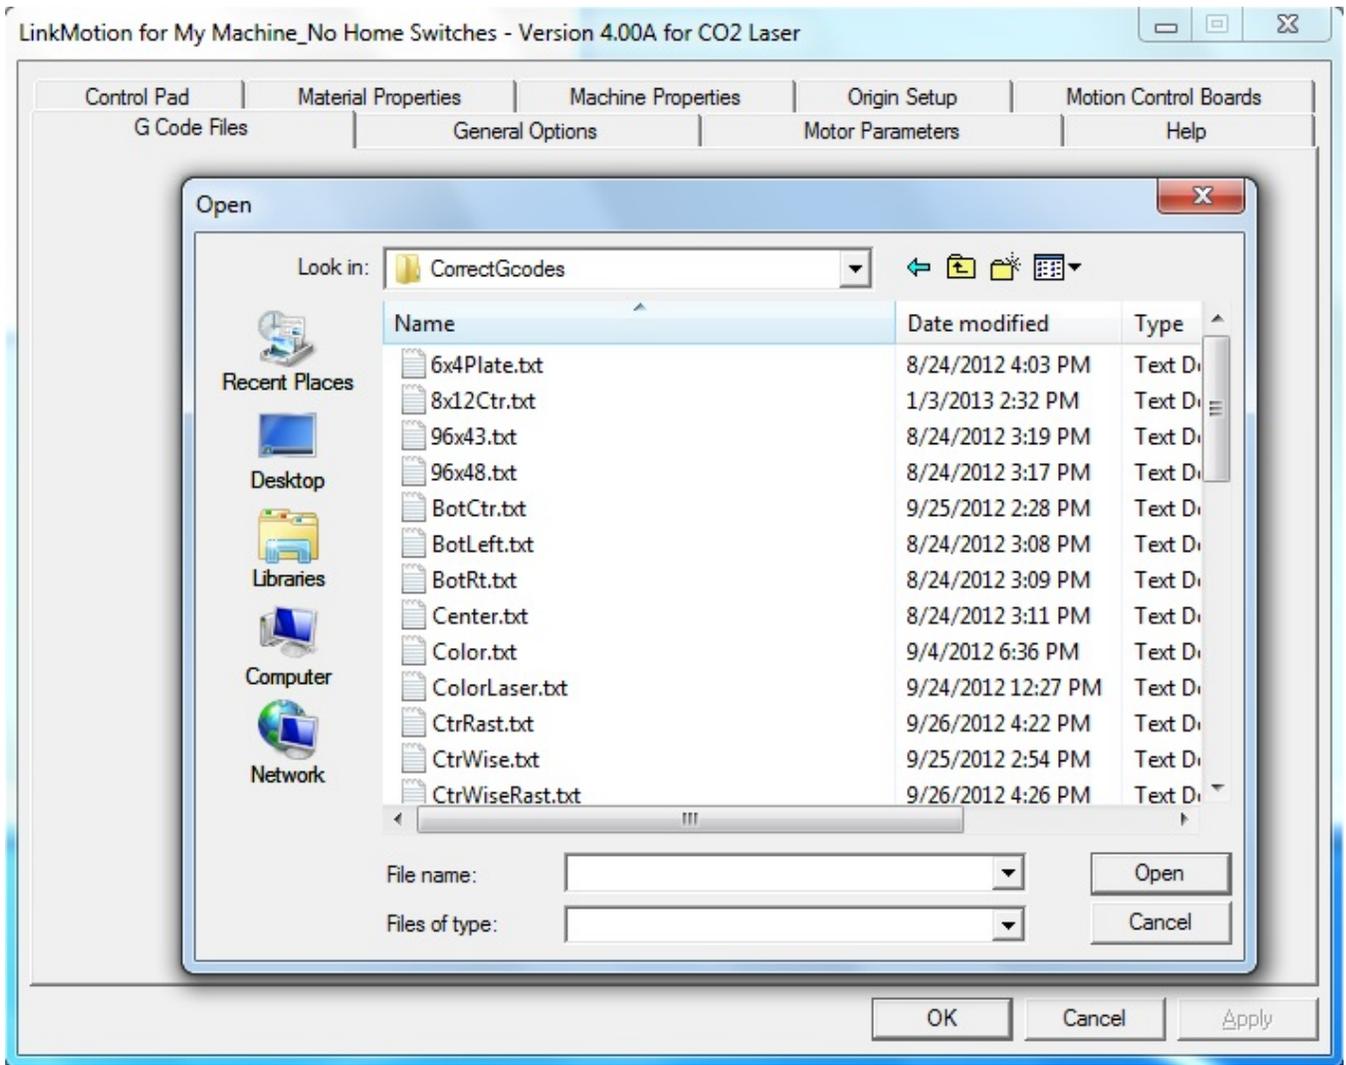


This feature will send previously generated G-Code files from LinkCAM or other CAM programs to CNC machines using the LinkMotion USB driver. Solustan has added custom G codes to handle bit maps and custom M codes to handle frequency and power levels. **The user needs to make sure that you have setup all the parameters for your machine properly by going to the Machine Properties, Material Properties, Motor Parameters, Origin setup and Motion Control Boards before sending the file from here.**

**LinkMotion software in demo mode or if USB Controller serial number is not authorized you may lose this GCode processing tab.**

You can click on the **G Code Files tab** to see a dialog box allowing the selection of a job file from anywhere on your computer. You simply navigate to the file and click on the **Open** button and it will process the job file and send it to the AGNI USB controller.

## Motion Control Board:

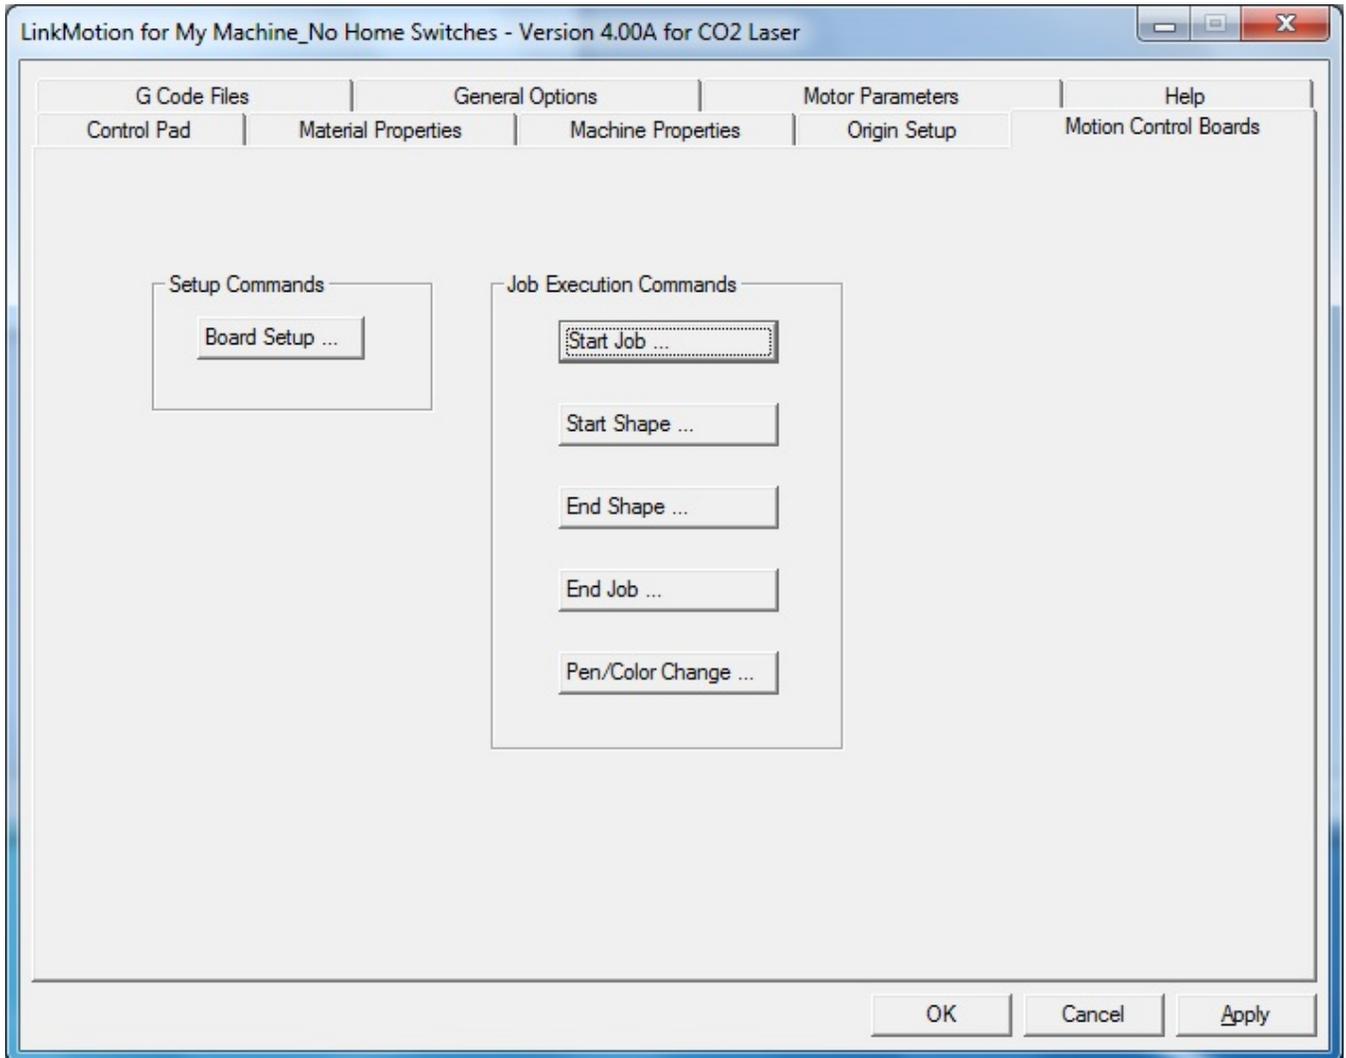

Commands unique to a specific machine can be inserted at the above locations. Many times these are M codes which activate the spindle, vacuum, lubrication, and other functions.

### Setup commands or Initial commands:

Click the Board Setup button and enter commands on one or more lines exactly as you want them to appear in the G code. Once you save the commands, they will be sent every time a job is sent, at the very beginning of the G code file.

### Start Job:

Click the Start-Job button and enter commands on one or more lines exactly as you want them to appear in the G code. Once you save the commands, they will be sent every time a job is sent, right after the Board Setup commands in the G code file. We use to declare in inches as G64 P0.004 in the older version.

**Now Deafult setup is G64 1.0 Q40 here.**

**P value is for Adherence to original vector and it allows maximum deviation from the original vector in mm. P value should be always declared in mm and design path should not deviate more than the value declared here for your output.** This **P parameter** is part of the G code command structure. What it means is that the G code interpreter can only deviate from the original design lines by no more than 0.1 mm. If you allow more deviation from the original design, the machine is likely to run faster but may have less than desirable results (Design path is less accurate). The user can try making it 1 or 2 mm and then process a small rectangle. You will notice that the corners are rounded instead of sharp 90 degree corners. High speed with low acceleration value declared should display clear deviation for a rectangle shape using P value to be 0.1mm and 10.0mm value.

**Q value is the change in the angle (in degrees) for a path of your design for two successive vectors. The machine will slow down when detected angle of the design path is 15 degrees or less. We do have a solution to look ahead on the next vector using Q command** and as long as the angle of change is not sharp, we can continue to move without slowing down. This is our newest implementation and we have not checked it fully. The user can actually declare a value of the angle. For a heavier gantry, you may call out for an angle as small as 15 to 25 degrees for the gantry to decelerate and accelerate to prevent overshooting. For lighter gantries, the angle could be as liberal as 40 degrees or more. **This Q value can be different for your needs.**

### **Start Shape:**

Click Start Shape button and enter commands in one or many lines just the way you want. Once you save the commands, it will be sent every time a job is sent. A job can be made up of many different shapes. These commands will be repeated at the beginning of every new shape in the G code file.

### **End Shape:**

Click End Shape button and enter commands in one or many lines just the way you want. Once you save the commands, it will be sent every time a job is sent. A job can be made up of many different shapes. These commands will be repeated at the end of every new shape in the G code file.



### **End Job:**

Click the End Job button and enter commands on one or more lines exactly as you want them to appear in the G code. Once you save the commands, they will be sent every time a job is sent, right at the end of the job in the G code file.

### **Pen/Color Change**

Click the Pen/Color Change button and enter commands on one or more lines exactly as you want them to appear in the G code. Once you save the commands, they will be sent in the G code file every time there is pen color change in the original graphics job file.

### **How to enter and edit unique commands:**

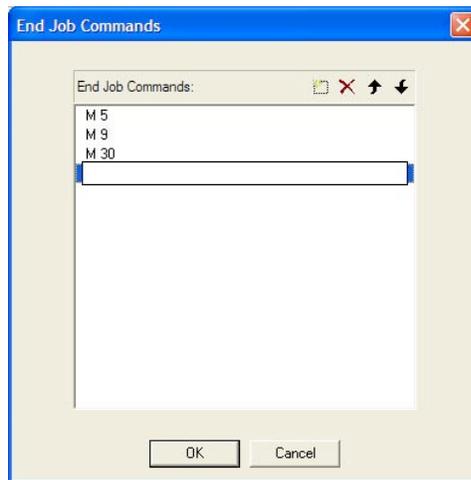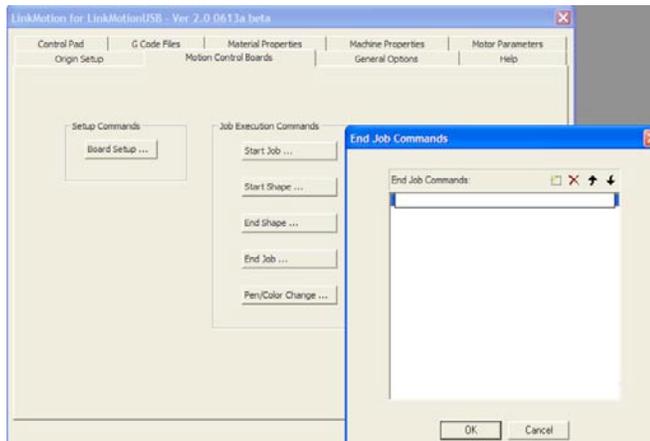

There are four simple editing controls.


Clicking on the dotted box will create a new line at the bottom of the list in the box. You are ready to enter your commands.

The Red X selection will delete the highlighted line from the list.

The Up arrow will move the selected line above the previous line.

The Down arrow will move the selected line below the next line.

## General Options:

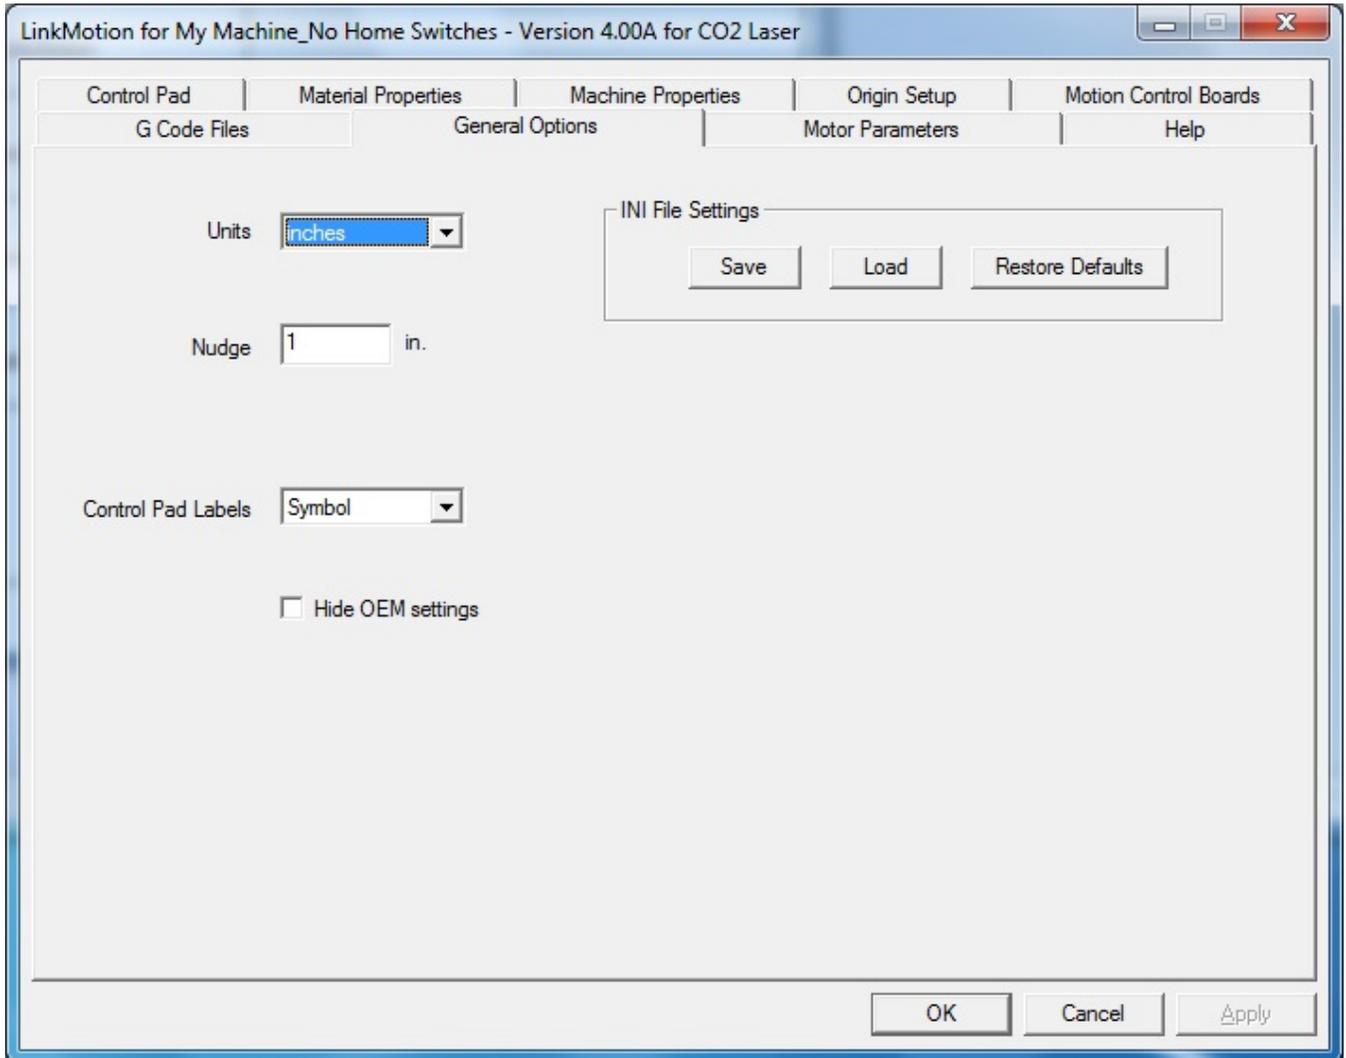

### Units:

There are just a few things on the General Options screen. Units give you the choice to display measurements in inches, millimeters, or centimeters. If you have switched from one unit to another you need to check the settings in all the tabs of LinkMotion to make sure that the settings are correct for your machine and correct for your job. The Linkmotion.INI file keeps separate settings for inches and metric values. **The values are not necessarily converted directly from one to the other.**

### Nudge:

**The Nudge value determines how far each axis will move with a single mouse click on the Control Pad keys that move the X, Y and Z axes.**

**There is a protection added to nudge value. Nudge will not move the machine more than “Maximum Travel” value declared in the Machine Properties for X and Y Axis when home switches are**

**activated and machine's homing procedure is followed to park the tool in home position. The user can deactivate this function by checking "disable home switches" in origin setup and Re-Launch LinkMotion.**

### **Control Pad Labels:**

Your choices here are **English, or Spanish or Symbol**. Click on the Apply button and you will see the Control Pad using the labels you have selected.

### **OEM Settings:**

Hide OEM setting is for OEM customers only. It hides some of the LinkMotion tabs when checked. The choice is saved in the LinkMotion.INI file with the line User Type=0 or User Type=1. A value of 1 enables OEM mode and hides some of the tab settings. A value of 0 displays all the tab settings.

Checking the box in the General Options menu will hide the checkbox when LinkMotion is next started. To bring back the checkbox and all the hidden tab settings, you will need to edit the LinkMotion.INI file manually and set **User Type=0**

### **INI File Settings:**

Following buttons are available for saving and loading different INI files but we highly suggest for you to write down your setting numbers from each of the menu(tab) of Linkmotion if the newly released version of LinkMotion is loaded. This is most suitable to take advantage of new features added in the new version of Linkmotion.INI file.

### **Save:**

Once the machine is properly configured and working well, we advise you to save a copy of your settings on the hard disk drive. This file will serve as a backup for the LinkMotion.INI that is automatically saved by LinkMotion.

Click on the Save button and you will be asked to choose a file name and location. Make sure to remember the file name and where you are saving it. You can navigate to the directory where you want to save your file. You can name the file anything that will be easy for you to remember. Most of our customers rename their settings file with their machine name.

### **Load:**

If LinkMotion needs to be reinstalled, or if you load an upgraded version of LinkMotion, you can reload all you INI file settings without wasting time re-entering settings for each tab. To reload the settings select the Load button and navigate to your saved INI file and click on Apply and OK. Now exit LinkMotion by clicking with the right mouse button on the LinkMotion icon in the System Tray and exit the program. Go to the Start button and relaunch LinkMotion. You will now see all your saved settings.

### **Restore Defaults:**

Clicking on this button will load the **default LinkMotion.INI** file that we supply with the LinkMotion driver software.

You must relaunch LinkMotion when you change and select another INI file to make the changes effective.

**LinkMotion.INI File and BMP files:** LinkMotion keeps a copy of all your settings in a file named LinkMotion.INI. To find this file please check the following instructions for your operating system. LinkMotion also stores last BMP file created for sending raster job in the same location as the LinkMotion.INI file. Bmp file can be 1 or multiple and it is dependent on your design.

**Windows 10, 8, 7 32/64:** C:\ ProgramData > Solustan > LinkMotion > LinkMotion.INI and 1.bmp etc.

Select Computer from the Start button. Select the C: hard drive from the left side. Double click on the folder name ProgramData. Double click on the folder name Solustan. Double click on the folder name LinkMotion. You should see a file name LinkMotion.INI and BMP files here.

**Windows XP:** C:\ Document and Settings > All Users > Solustan > LinkMotion > LinkMotion.INI and 1.bmp etc.

Select the C: hard drive and double-click the folder name Document and Settings. Double click on the folder name All Users. Double click on the folder name Solustan. Double click on the folder name LinkMotion. You should see a file name LinkMotion.INI and BMP files here.


### **Location for Temp.txt file (G-Code file of the last job sent):**

The **temp.txt** file is the last job sent and it rewrites every time you send the job.

**Windows 10, 8, 7 32/64:** C:\ ProgramData > Solustan > LinkMotionUSB > TempFile > Temp.txt

**Windows XP:** C:\ Document and Settings > All Users > Solustan > LinkMotionUSB > TempFile > Temp.txt

## Help:

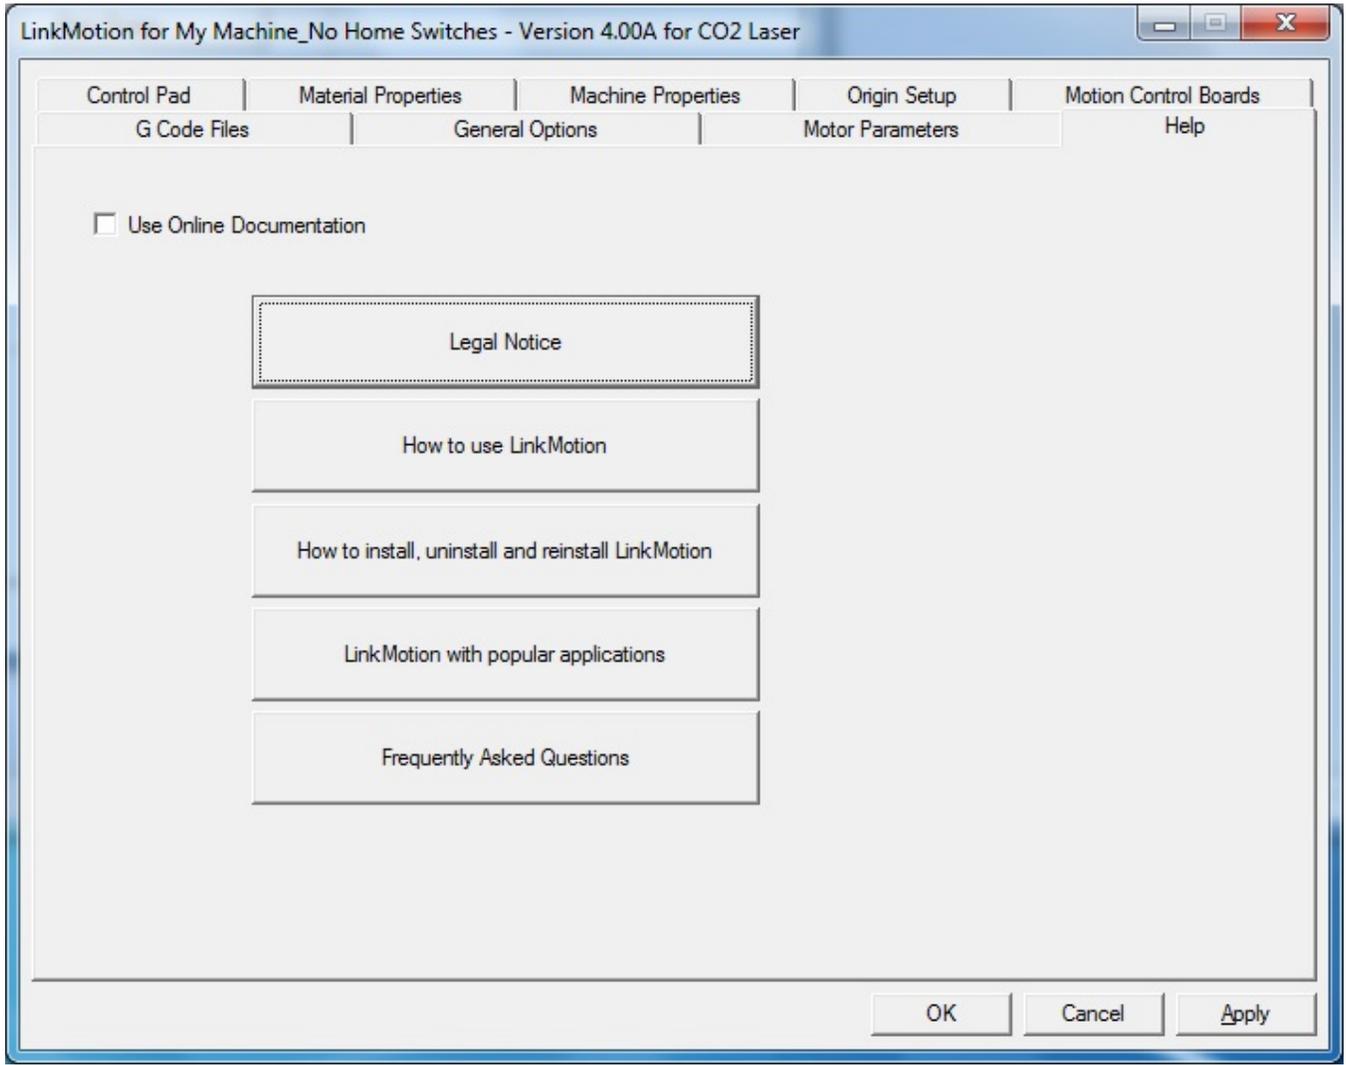

### Use Online Documentation

Checking this button takes you to our website where you can get most PDF documents for support.

Different buttons are created for help, however, more up-to-date manuals in PDF formats are provided with the respective LinkMotion version you receive.

## Connecting and Wiring the AGNI Controller:

Newest Controller information is first and older controller information in the following pages.

### Advantages of our USB controller board:

- (1) New 32 bit AGNI Controller Series 20000 has high speed and higher step rate up to 250,000 and FAT or FAT32 formatted SD memory available.
- (2) The major function of this product is to drive your machines with USB connection to your computer without locking up any computer functions. Your computer and the design programs are free and available to you while the previous job is being processed.
- (3) The controller is compatible with USB 2.0 specification. It allows transfer of job at a very high speed. It is not compatible with USB 1.1. **Do not use any USB 1.1 devices on the computer where you install LinkMotion software.**
- (4) **Old Agni Series 10000 and uner** has a slot for SD card memory. It is used as a job buffer and a spooler. The processing of a job on a machine can go on while the PC can be used for other purposes simultaneously. Approximately 1 minute of machine operation for a job uses 1MB of memory and this controller supports up to 4GB of micro memory. **The new version of LinkMotion 3.0 and higher now supports SDHC memory and we have done testing with following ones.**

**Memory chips tested and working with this controller: Sandisk 1 GB, 512 MB, 256 MB, Topram 1gb, PNY 1gb, PNY 4gb SDHC, Samsung 1gb, Transcend 1gb and 'Made in China Generic' 1gb.**

**Memory chips not working with this controller: Kingston 2gb (not SDHC), Kingston 4gb SDHC**

- (5) The USB controller solution is equipped with EMC2 (The Enhanced Machine Control 2) compatible M&G code capability. EMC (the Enhanced Machine Control) is a software system for computer control of machine tools such as milling machines, lathes, engraving machines, torch cutting machines, water jet cutting machines, laser machines, and other multi-axis machines. EMC has been available under Linux and has a very large user base. Now, it is available under Microsoft Windows environment with the same capabilities, precision, and flexibility. Please, visit <http://www.linuxcnc.org/> for additional information.
- (6) The LinkMotion can accept the jobs in the following manner:  
  
2D jobs, 2 1/2D, 3D, 4D, 5D, or 6D jobs created elsewhere using M&G format can be sent to the USB controller using LinkMotion. In other words, the USB controller is totally compatible with M&G codes, one of the most popular command structure for machine control. A list of implemented M&G codes from the complete list of EMC commands is available elsewhere in this document.
- (7) The board will generate step and direction commands for up to 6 drivers for controlling 6 motors. The standard explanation is for 3 axes and refers to **Additional axis control** information if your machine has more than 3 motors.

- (8) The USB controller is capable of sensing Home switches, E-Stop, and other inputs.
- (9) The USB controller has 6 output connectors. The functions are described later in this document.
- (10) It is advisable to mount the controller board in your enclosure such that the USB connector residing on the controller board and the SD memory card slots are accessible without opening the enclosure.
- (11) Optionally, Solustan provides small, standalone enclosure with or without the wiring for the output connector (DB-25 female) for the convenience of initial testing and/or for an on-going configuration. An optional, external 5 VDC power supply is also available along with the enclosure if required.
- (12) **New Agni Series 20000 Controllers** has the capacity for 250,000 steps per second capacity.
- (13) **Old Agni Series 10000 and uner Controller** has the capacity for 125,000 steps per second maximum specified limit. 75,000 steps per second are the maximum specified limit of the older 16 bit USB controller.

### **IMPORTANT WIRING SUGGESTIONS:**

We have tested it in our labs and we are convinced that the wiring is the weakest link in any machinery. Just like User Interface, the wiring is almost always an afterthought in assembling a machine. We cannot stress more that you should look into the following while wiring your laser machine:

- (1) Coming out of the Agni's connectors, use twisted and shielded pairs to wire the controller to the machine.
- (2) Use metal or metalized shells for the cables ending into the connectors when required.
- (3) The shield should be grounded only on one side of the cable, preferably on the machine side. Should not be connected to the controller side.
- (4) The home or limit switches have two wires, use a twisted pair.
- (5) All the I/O's require a ground wire, use a twisted pair.
- (6) Step motors have a pulse (step) and direction wires, use a twisted pair for each of the axes.
- (7) PWM signal wire for the laser power also has a ground wire for return, use a twisted pair.
- (8) American style, 22 or 20 gauge wires with multi-strands are just fine.

What could happen in an electrically noisy environment?

- The controller may sense a noise pulse as reaching home on home switch wires. If you see the lights on the limit switches on the Control Pad fluctuating between red and green colors while the machine is not even trying to go home, it is the electrical noise that may be a culprit.
- After finishing a job, a good machine does not go back to (0,0) position, steps are added or subtracted during operation due to electrical noise.
- If the laser power is fluctuating even while cutting a straight line, it may be the noise again.

**If you are buying Chinese laser machines, you may enlist their help while they assemble the machines. It may add just a few dollars to the cost but may buy you many happy customers.**

## **Warnings for Laser/Agni Controller board:**

1. Plug the LinkMotion controller cable directly into your computer's USB 2.0 connection.
2. It is important to experiment and determine that the USB controller works with the USB hub or extension device if the user plans to use such a device.
3. This Laser/Agni controller does not work with USB1.1 connections. If you connect other USB devices compatible only with 1.1, it may cause problems. All the USB devices including keyboard and mouse in the system shall comply with 2.0 specifications. Always check compatibility for wireless USB devices, if you are using one.
4. Power saver and Screen Saver modes on your computer should be turned off. If these modes are activated, it can cause problems in recognizing the USB connection on a continuous basis.
5. **New AGNI USB Controller / Series 20000** can use 24 VDC - The LinkMotion Agni controller can be configured to power either from the USB connection of the PC or from an external 5 VDC or 24 VDC power supply. There is a jumper on the controller board that allows the selection of the power supply for the controller.
6. **Old AGNI USB Controller / Series 10000** - The LinkMotion Agni controller can be configured to power either from the USB connection of the PC or from an external 5 VDC power supply. There is a jumper on the controller board that allows the selection of the power supply for the controller.
7. In case of Laptop computers, AC power unit shall be connected to an AC outlet while operating external USB devices. Sometimes, aggressive power save mode settings under battery operations could activate the disconnection of USB devices. Re-Launching LinkMotion will re-activate the communication in such a situation.
8. Approximately 1 minute of machine operation uses 1MB of SD memory for vector work. This controller supports up to 4GB Memory. If you are using LinkMotion version 3.5 or higher, you could use either SD or SDHC memory cards.
9. **New AGNI USB Controller / Series 20000** uses FAT or FAT32 formatted SD memory.
10. **Old AGNI USB Controller / Series 10000** - It is impossible to test all the available SD Memory cards in the market but we have listed in the following lists ones that work and ones that do not work with this USB controller.

Memory chips tested and working with this controller: Sandisk (1 GB, 512 MB, 256 MB), Topram 1gb, PNY 1gb, PNY 4gb SDHC, Samsung 1gb, Transcend 1gb and 'Made in China Generic' 1gb.

Memory chips found not working with this controller: Kingston 2gb (not SDHC) and 4gb SDHC.

11. If serial number of the controller is not recognized by LinkMotion then user will see a message "Unrecognized serial number \_\_\_\_\_". Once you click on OK button it will display the second message as "The maximum working area is 1"x1" or 25.4mm x 25.4mm. LinkMotion software can output only 1"x1" jobs at that point. Unauthorized controller bought from unauthorized vendors can cause this kind of problem. Get in touch with Solustan to verify your serial number. Not making proper USB connection with the controller can also display this kind of message and simply disconnecting USB cable from computer end and reconnect and re-launch LinkMotion should resolve it.

### **12. USB Controller Board Lights:**

**New AGNI USB Controller / Series 20000** - There is only one LED lights available to attach to the new Agni Controller board Series 20000 – Blue. This light will behave in the following manner when connections are made and the board is powered:

**Blue LED** – Steady Blue light means USB powered up and ready. If blue light flashes fast it means it is waiting to make the USB connection. At this point, If you launch LinkMotion app it should become steady. If Blue light is flashing slowly it means it is in boot load mode.

**We have an additional programmable LED connections available. We will inform you as we add more LED and its functions.**

**Older AGNI USB Controllers / Series 10000** - There are three LED lights available to attach to the Agni Controller board – Blue, Amber, and Red. These lights behave in the following manner when connections are made and the board is powered:

**Blue LED Flashing Slowly** – No USB Connection

**Blue LED Steady** – USB powered up and ready

**Amber LED Flashing Slowly** – Waiting for firmware update


**Amber LED Flashing Fast** – No SD (Memory) card

**Amber LED Steady** – USB ready with SD card

**Red LED** – Turns on when the board is powered. It turns off when it makes a proper connection with LinkMotion. It also turns on every time when any machine motion is detected.

**Red LED Flashing** – If hardware switch for Repeat is installed on the Laser/Agni controller and LinkMotion.INI file is set up properly, then, Red LED starts flashing after a job is processed one time. Pressing the Repeat switch will send the job again to the machine. After a job is processed one time it is ready to repeat the last job using the repeat button on the USB controller as many times as user wishes.

## The New High Speed Controller – Agni III - Series 20000

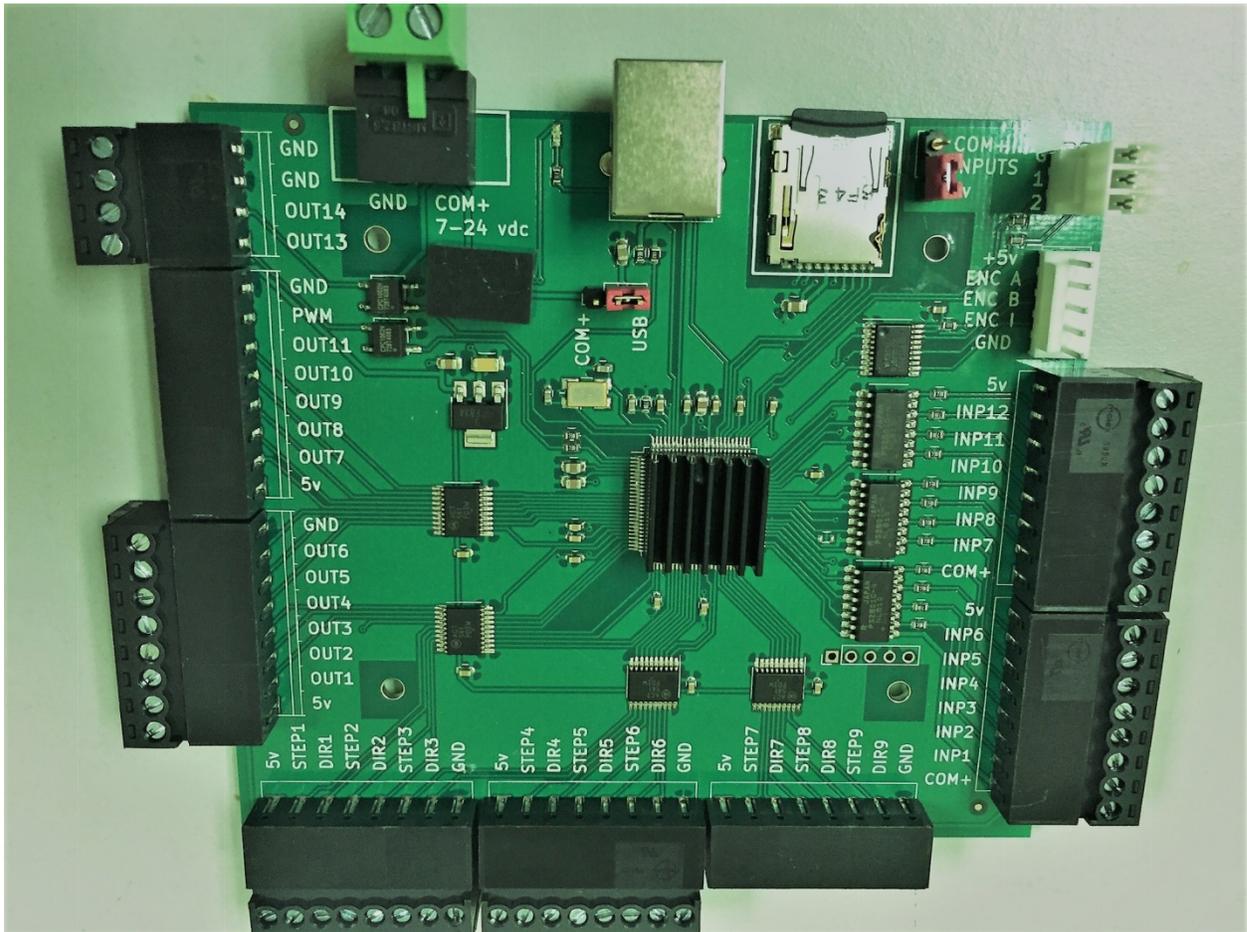


The hardware details of the Agni III controller:

1. Our previous controller Agni II had the maximum step rate of 125,000 steps per second. The Agni III controller doubles the speed to 250,000 steps per second.
2. It offers up to 9 axes control, M&G code processing, and lot more inputs and outputs.
3. The SD memory cards are used as formatted cards for improved reliability of stored information. Use a PC to format the SD memory card using FAT or FAT32 method.
4. The controller can be powered directly from the USB port by taking power from a PC.
5. Alternately, it can also be powered externally with an on-board power supply regulator. The external power supply can be as low as 7 VDC and as high as 24 VDC. There is only one jumper on the controller to select the power source. The jumper is positioned close to the USB connector.
6. Place the jumper toward the COM+ side to accept external power through the 2 pin Green connector. The picture shows the COM+ side (7 to 24 VDC) and the GND side for the connections.
7. Place the jumper toward the USB side in order to accept the power from the USB port of the PC. With this selection, the 24 VDC output will not be available through outputs 13 and 14.
8. All the outputs are driven through line driver IC's. Each output can source or sink up to 20 ma current.
9. All inputs are opto-isolated to reduce noise and interference.

10. Of the 9 axes, the very first axis, X axis can work with step or a servo motor. However, the servo motor driver is required to be able to handle pulse and direction inputs. A special connector is setup for encoder feedback.
11. The 9 axes are X(1), Y(2), Z(3), A(4), B(5), C(6), U(7), V(8), and W(9). The G code file shall have the alphabet values for it to be processed properly.
12. The controller is equipped with one blue LED on-board for USB connections and other functions like firmware updates. The 3 pin white connector is equipped with connections for two more LED's. Many different indications can be programmed. We are looking to bring these LED's to a Control Panel that can be implemented on a machine. We would like to have feedback from users describing the features they want to see implemented using the LED's for appropriate feedback.
13. The second jumper is placed by the SD memory card. The input lines can be TTL (+5 VDC) or they are allowed to be as high as 24 VDC. Some active home switches may send signals anywhere from 5 to 24 VDC. The jumper allows the selection of TTL or higher input levels. Input lines are programmed based on the selection here.
14. Outputs 1 will work with Output 13. Both of them will turn ON and OFF at the same time. However, Output 1 is a TTL output while Output 13 switches an SSR (Solid State Relay) to switch either +5 VDC or 7 to 24 VDC with the capability to drive a load requiring up to 500 ma current.
15. Outputs 2 will work with Output 14. Both of them will turn ON and OFF at the same time. However, Output 2 is a TTL output while Output 14 switches an SSR (Solid State Relay) to switch either +5 VDC or 7 to 24 VDC with the capability to drive a load requiring up to 500 ma current.
16. Outputs 1, 13, 2, and 14 turn ON when the laser is ON or the CNC tool is cutting and they turn OFF when the laser is OFF or the CNC tool is not cutting during a job.
17. Outputs 3 and 4 turn ON and stay ON throughout a job and turn OFF at the end of a job.
18. Outputs 5 through 11 are not controlled by the LinkMotion application at this point. However, they can be turned ON and OFF using M commands in the G codes. M64P(x) to turn ON and M65P(x) to turn off the output.
19. Here are the Input settings:
  - Input 1 is for the X axis Limit Switch
  - Input 2 is for the Y axis Limit Switch
  - Input 3 is for the Z axis Limit Switch
  - Input 4 is for the A axis Limit Switch
  - Input 5 is for the B axis Limit Switch
  - Input 6 is for the C axis Limit Switch
  - Input 7 is for the Cycle Start or Start
  - Input 9 is for the E-Stop
  - Input 10 is for the Pause
20. Solustan plans to design a Control Panel using Cycle Start, E-Stop, Pause, and the two LED's for additional feedback.

## AGNI-IIP Controller for CO2 Laser or CNC Machines:

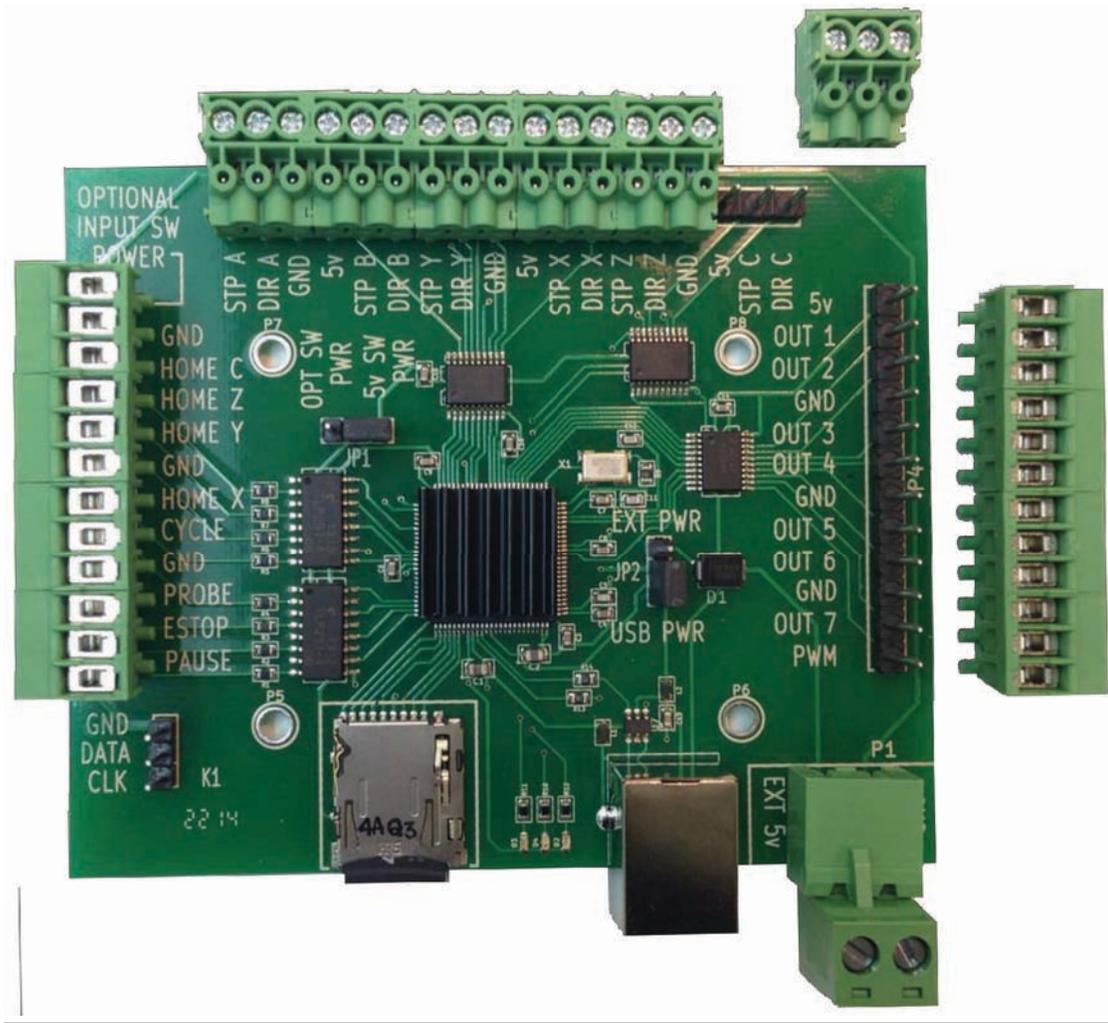


This newest **AGNI-IIP controller** has Phoenix-type connectors that can be plugged in two different ways compared to earlier AGNI II version that had screw terminals. Two different positions are available such that wires can come out either from the sides or from the top. It is slightly smaller in size and all dimensional details are given on the following page. Wiring information is printed on the board and remaining other technical information is provided in the following pages.

Four plastic standoffs may be provided with the controller. They require 0.125" or 3.2mm holes for the mounting surface. The material thickness of the mounting surface should not be greater than 0.062". If you have thicker material then you should use screws with spacers.

### **The physical dimensions of the controller board are as follows:**

1. The size of the controller board is 93.5 mm X 76.2 mm (3.68 in X 3.0 in)
2. There are 4 holes for mounting the controller. The holes are 3 mm in diameter (1/8 inch)
3. Horizontally, the distance between holes is 50.6 mm (2 inches)
4. Vertically, the distance between holes is 40.2 mm (1.57 inch)

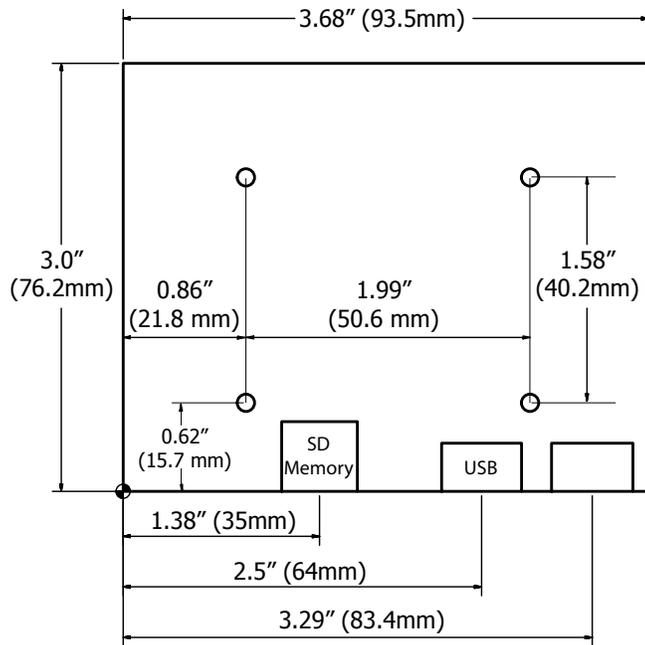

## **Specifications:**

The USB connector protrudes by 5 mm outside the board.

The connector for external power supply when connected will extend outward by about 12 mm. (The external +5 VDC connector is NOT required if the jumper is set to accept the power for the controller board from the USB port of a PC.)

The Agni controller has a processor running at 96 MHz with 6 axis controls. It comes with an SD memory card holding a capacity of 4 GB of storage.

## **Caution:**

Controller board is equipped with integrated circuits and high-frequency processors. The components are susceptible to static electricity. We tend to build a static charge on your body while simply walking around in a less than ideal humidity in the environment. It is easy to damage the circuits on the board with a slight touch. It is recommended that a grounding strap on the wrist or other methods to neutralize the build-up of static electricity before handling the controller board. Keep yourself grounded while you continue to work with the controller board.

## **Connections and configuration of the Agni-IIP controller:**

1. Take a look at the above picture of the controller and note that there are only two jumper settings required for physical connections.

Jumper on the left of processor relates to voltage requirement for the Home (Limit) switches. If the Home switches in your machine only require +5 VDC, you do not need to do anything. The default setting of the jumper is set to use the internal power (5v SW PWR). On the other hand, some machines use active home sensing switches that may require higher than +5 VDC for proper operation. In such a case, move the jumper to the optional power input (OPT SW PWR) for home switches. The optional power and Ground input points are at the top left of the board. Connect the switch appropriate power supply here. The voltage of the external power for the Home switches shall not exceed 24 VDC. All the input lines are protected with optoisolators.

**Also, refer to more detail description for connecting home (limit) switches along with output connections in following pages after the general description.**

Note the second jumper situated to the right of the main processor chip in the center of the Agni controller. The Agni controller needs little power. It is possible to power the controller directly from the USB port of the PC. The default setting of the jumper is for the Agni to receive the power from the USB port of your computer (USB PWR). If it is necessary to power the controller from external sources, move the jumper toward the EXT power side (EXT PWR). The optional power and Ground inputs are at the bottom right of the controller. Note a removable, 2 pin, green connector. Required voltage is 5 VDC. The voltage of the external power of the Agni controller shall not exceed 6 VDC.

2. Connecting Agni to the Laser or CNC machine:
  - 2.1 X, Y, Z, and cylindrical axis motors
  - 2.2 The Agni controller generates Step (sometimes called Pulse) and Direction pulses for each of the axis. Maximum step rate is 125,000 per second.
  - 2.3 Ground and +5 VDC connections are available along with step and direction commands for the connections to step motors managing different axis.
  - 2.4 There may not be a need for all four connections. In fact, some step motor drivers require a step, direction, and either ground or +5 VDC connections. Use whatever is necessary to make connections to the step motor drivers.
  - 2.5 If the machine is equipped with servo motors, please, make sure that the servo motor drivers are capable of accepting step and direction commands.
  - 2.6 The Agni controller is equipped to connect up to 7 outputs and one PWM (pulse width modulation) output for laser power control. Out of the 7 outputs, 4 are connected to the LinkMotion driver settings. If and when required, additional outputs can be made available.
    - Output 1 is for laser ON/OFF
    - Output 2 is for red indicator diode control
    - Output 3 is for water control
    - Output 4 is for positive air pressure for laser head

Output 1 and 2 turn on at the beginning of every shape to be lased and turn off at the end of the shape. While output 3 and 4 turn on at the beginning of a job and stay on throughout the job. Sometimes, users do not use output 4 to control water. It may not be desirable to turn off

the water at the end of a job when the laser tube mat still is hot and may require additional cooling. Some users just turn on the water pump at the beginning of a day and leave it on until the end of the shift.

Invert PWM capability is available from Linkmotion V4.27 onwards with a following line in the Linkmotion.INI file under each machine related settings.

**InvertPWM=0 or 1**

The default value is 0(zero) and the user can change it 1 if required. Change is effective after saving the INI file and Re-launch Linkmotion.

PWM output will generate a tickle pulse (if turned on) as well as generate the power levels while modulating the width at the frequency set up in the LinkMotion settings. There is a clear point of connection for the PWM output from the controller to the RF metal laser tubes. It is also possible to take advantage of the PWM and frequency settings in the LinkMotion to achieve better results while controlling the Chinese style glass tubes with its appropriate power supply. (Please, refer to our separate document on the subject.)


- 2.7 The Home switch connections are self-explanatory. Appropriate settings are available in the LinkMotion software configuration.
- 2.8 The controller is equipped with soft Control Pad that shows up on the PC screen with many useful features. Please, refer to our main document, the LinkMotion USB for laser machines. In addition, Solustan provides additional connections for hardware Control Pad that may be required for installing it right on the laser or CNC machine. Please, contact us for protocol information as well as command strings.
- 2.9 Often overlooked, but the important part is the wiring between the controller and the rest of the laser machine. This ounce of prevention will go a long way. All the signals going in and out of the controllers are just that, signals.
  - You do not need thicker than 22 gauge of wire.
  - Twisted and shielded pairs of wires are the best way to go.
  - If possible, use three twisted wires in a shield for each of the step motor connections.
  - If possible, use a twisted pair of wires in a shield for each of the I/O's, and home switches.
  - Use multistrand copper wires.
  - Connect the shield to a ground on only one side of the wire cluster, preferably on the machine side.
  - The laser machine shall be connected to the earth ground, if not already.
  - When you reduce the effect of the electrical noise on the controller, you are going to have fewer problems with step accuracy, sensing of home, and better performance of the system.



With the above information in mind, let us take a look at the ways to connect the controller to the outside world. The outside world includes step motor drivers for up to 6 axes, either output including PWM, and the following inputs:

- Home/Limit switches for axis X, Y, Z, and C (cylindrical axis).
- Cycle start
- Probe
- E-Stop
- Hardware Pause

3. Here is a circuit of all the outputs:

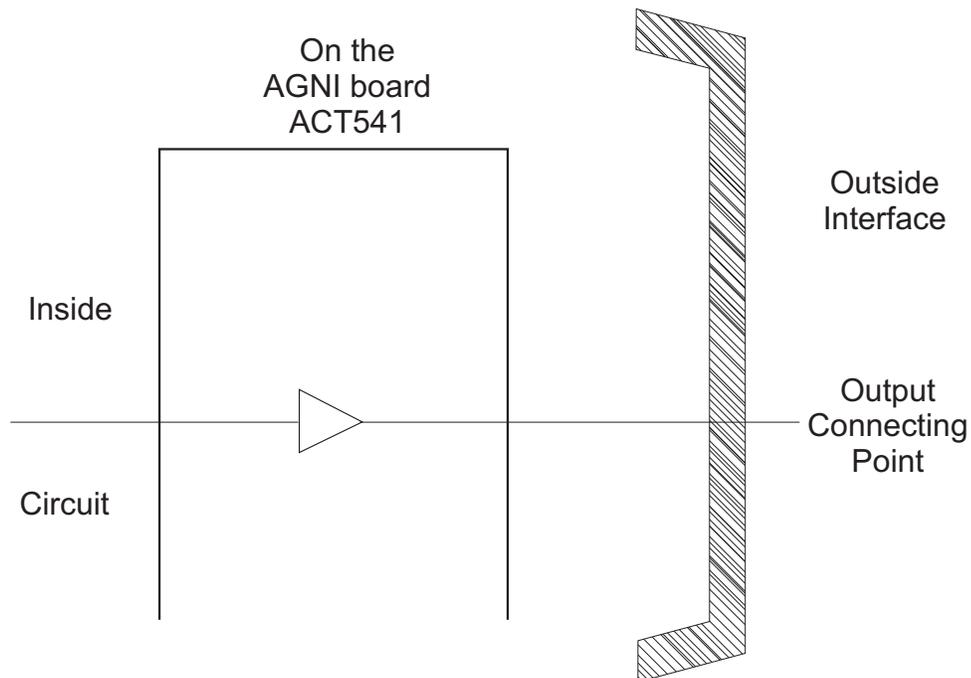


The controller is equipped with output line drivers IC's ACT541. Each line is capable of **sourcing or sinking 20 milliamps**. This makes it very nice to directly connect to step motor drivers. An output can connect directly to a solid state relay for controlling the heavy load.

The output connections are;  
Step X, Y, Z, A, B, and C  
Direction X, Y, Z, A, B, and C  
Output 1, 2, 3, 4, 5, 6, 7, and PWM

Both, ground as well as 5 VDC output pins are made available along with step and direction commands for the step motor drivers. Step motor drivers may require either ground pin or 5 VDC pin for completing the circuit.

4. Here is a circuit of all the inputs:

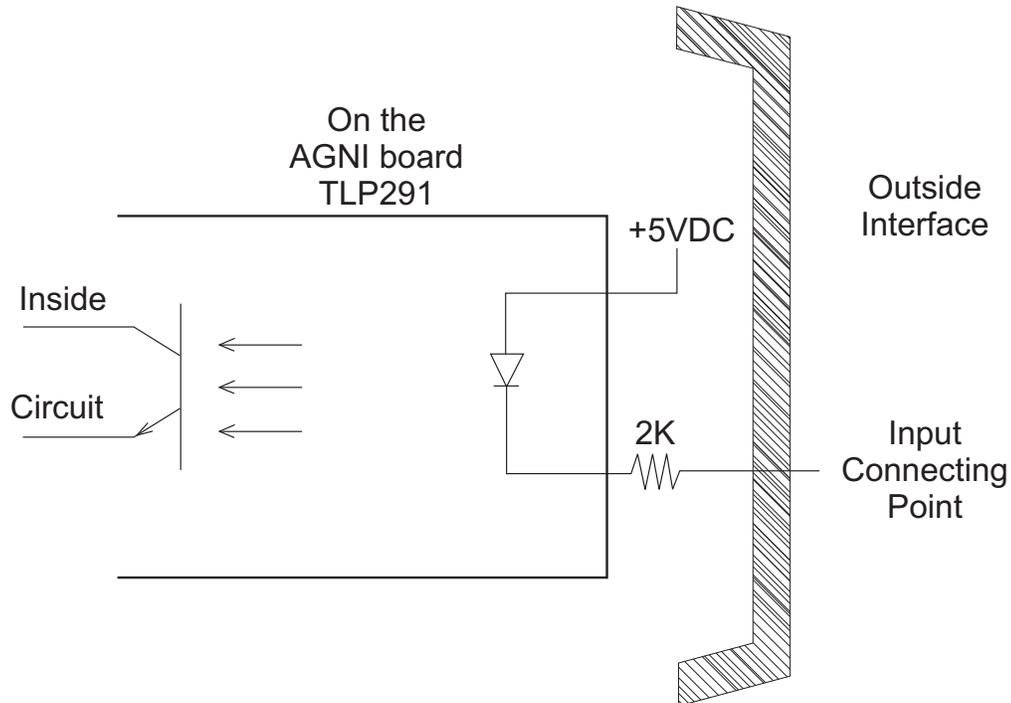


All the inputs are optically isolated with a 2K resistor to limit the current flowing through the diode. Each of the inputs is equipped with the above circuit.

Note that the optoisolator part of the circuit is equipped with its own internal 5 VDC. The outside connections require a signal and a reference ground line. This is totally adequate for either passive Home/Limit switches or active switches that require 5 VDC to operate.

Here is the cool part. If the machine is equipped with active Home/Limit switches that require and use higher than 5 VDC, switch the position of jumper JP1. Apply the appropriate voltage to the optional input power switch at the top left pin on the input side of the connections and its associated ground line to the next pin. The same voltage will be applied to the Home/Limit switch circuit with optoisolation for proper operation. Most of the popular active switches work anywhere from 5 VDC to 24 VDC. **It is important to note that the Optional Input Voltage for Home/Limit switches shall be limited to 24 VDC. Higher voltage may damage the circuits on the controller board.**

To further illustrate a possible circuit connection using an active switch, we studied and created a circuit for an Omron EE-SH3 active switch. Here is a possible circuit:

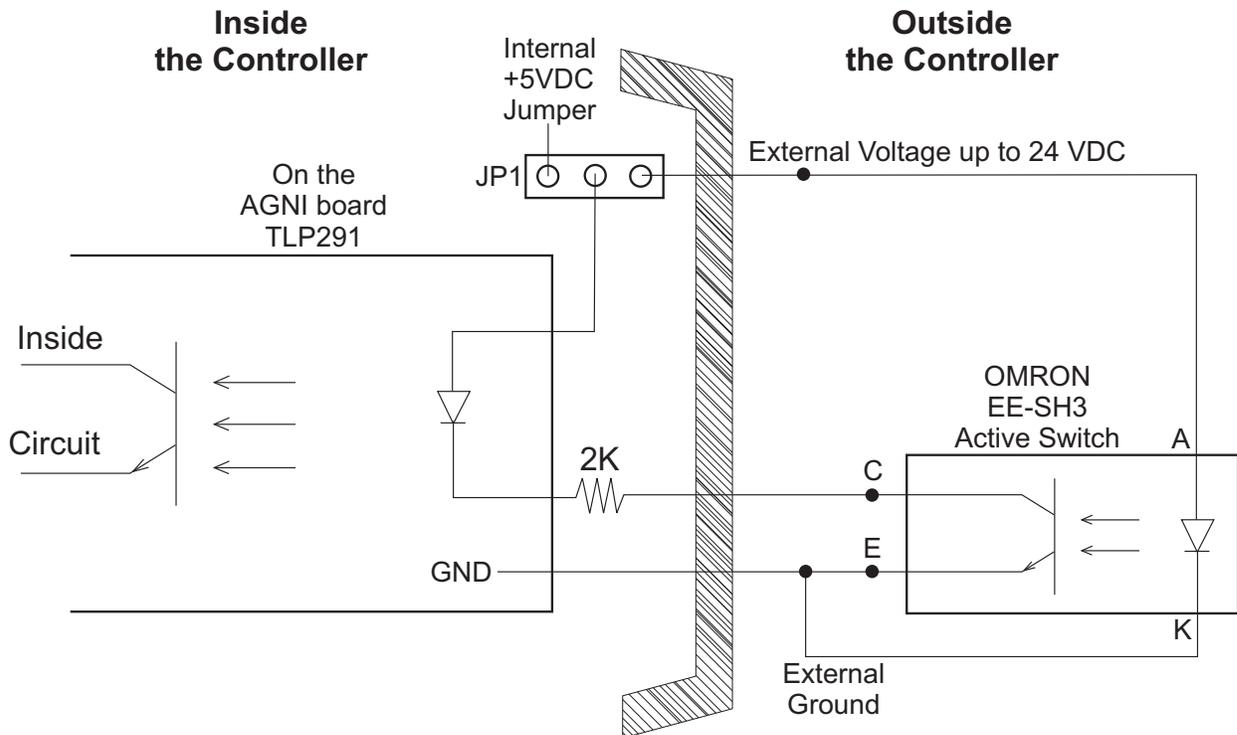

**It is important to understand that the AGNI controller board contains sensitive electronic circuits. Proper care must be taken to handle the controller board. It is recommended that the person handling and/or wiring the AGNI controller shall use the ground strap and necessary precautions to keep the static voltage away from the controller. Static electricity can easily damage the controller.**

### E-Stop Switch settings:

1. By default, the LinkMotion software is shipped with E-Stop sensing disabled with an entry in the LinkMotion.INI file.  
To change the default, search for the line EStop=-1 in the section of the INI file matching the name of the machine you selected when installing.  
EStop=-1 disables the function.  
EStop=0 enables the emergency stop function for a normally open E-Stop switch.  
EStop=1 enables the emergency stop function for a normally closed E-Stop switch.
2. On sensing a signal on the E-Stop line, the controller will halt any motion in progress, display a message on the PC screen, and terminate any profile that is running on the controller. You will need to reset and restart LinkMotion and then prepare and send the job again.

Laser machines have many safety switches to make sure that all the doors of the cabinets are closed before the laser power turns ON. All of these safety switches must be connected to the E-Stop pin of the controller.

If all switches are normally closed, the switches must be connected in series. Any switch activated will break the circuit and the E-Stop line will become active, stopping laser operations.

If all switches are normally open, the switches need to be connected in parallel. Any switch activated will close the circuit and the E-Stop line will become active, stopping laser operations.

3. There is one jumper on the board. The sensing voltage for the home switches and E-Stop are normally limited to +5 VDC (TTL logic). The controller requires only +5 VDC for its operations. However, home switch sensing may need a voltage higher than +5 VDC.

An external voltage is required for switches that are designed to use higher than 5 VDC. In no case, higher than 24 VDC shall be applied.

The jumper needs repositioning in addition to applying the external voltage for higher voltage.

The jumper position is normally set to the two pins away from the connector 2. For using higher voltages, move the jumper to the pins closest to the DB-25, connector 2. The higher voltage shall be connected to pin 13 on connector 2. The return or the ground for the higher voltage shall be connected to any of the ground lines on connector 2, pin 14-23.

4. There is one jumper on the Agni controller. The jumper is the tallest component of the controller board. When the jumper is in place Agni takes its power from the USB port of the PC. If it is required to provide external power connect it to the +5 VDC power connector on the breakout board, the jumper should be removed before powering the controller. It is very important to make sure that the Agni controller is not powered from both sources: the USB port of a PC and the external +5 VDC power supply.

5. Many Chinese laser tube power supplies accept linear as well as PWM input for power control. Agni generates PWM commands. Please refer to the last part of this document for proper connection details for laser power. The title of this part is – Ways to connect the Chinese CO2 glass tube power supply and Agni controller.

### **Explanation of the important feature of generating power directly from the Control Pad while depressing the I/O 1 key for testing purposes only.**

To generate and check out the operation of the laser tube, LinkMotion allows generation of PWM when the Laser key (I/O 1) is depressed. The key is protected with a latch to prevent generation of power by mistake. LinkMotion is organized with the concern for safety such that along with the PWM, it is necessary to generate proper logic level on pin 1 of connector 3 to enable the power supply.

### **Following procedure explains how to test for laser power using LinkMotion for Co2**

#### **Laser:**

1. Check the Enable Laser box in the Machine Properties tab.
2. Select the power level of your choice (1 to 100 percent) against the black color in the Materials Properties tab. For this testing purpose, the maximum power value selected in the Materials Properties Tab is ignored.
3. Hold down the I/O 1 key in the Control Pad
4. Click on the OK button with an arrow of your mouse to Unlock the latch when asked.
5. The power will be generated as long as you hold down the I/O 1 key.
6. The power will be shut off as soon as you take the finger off the key.

**This section will be updated continuously as we get the reports of Agni connecting to various old and new Laser machines:**

**List of Laser Machines upgraded with AGNI Controller:**

**Emission Technology Laser Machine  
 GCC Laser Machine  
 Leetro 6515/6535 Controllers  
 Model K40 12x8 Shenhui  
 Planes Mart Laser  
 Trotec Laser Machine**

Please contact Solustan for more information for upgrading your laser machine.

**Upgrade Leetro 6515/6535 Controllers:**

1. Agni controller is used for replacing the Leetro 6515/6535 controllers. Leetro controllers are equipped with connectors where the bare wires, after removing the insulation, are inserted into the connectors and are tightened using screws. The breakout board for the Agni controller is equipped with DB-25 style female connectors. Matching male connectors are required to connect the laser machine wiring into the Agni controller. These connectors are commonly available all over the world. They are reliable, easily available, and inexpensive. Simple tools are required to prepare the connectors.
2. For the OEM manufacturer of laser machine, it is easy to prepare the cable harnesses with male DB-25 connectors for a reliable and error-free assembly. It is also easy to connect and disconnect the controllers from the machine.
3. Agni controller does not need 24 VDC power supply. Agni controller’s default configuration is to be powered from the USB port of a PC using +5 VDC. It can easily be reconfigured to receive the power from externally supplied +5 VDC.
4. You may have up to 4 step motor drivers for the X, Y, Z, and cylindrical axis. The step motor drivers need a step (pulse), direction, and either +5 VDC or ground connections.

For X axis location, find location Y5 on 6515 and X axis location on 6535 controller. Transfer connection as follows:

<b>Connector 1 on AGNI-I</b>	<b>AGNI-IIP or II</b>	<b>Signal</b>	<b>6515/6535 controller</b>
Pin 1	STP X	Step/Pulse	Pin 1
Pin 2	DIR X	Direction	Pin 2
Pin 13	(5V If required)	+5 VDC (If required)	Pin 3
Pin 14 – 25	(GND If required)	Ground (If required)	Pin 4

For Y axis location, find location Y4 on 6515 and Y axis location on 6535 controller. Transfer connection as follows:

<b>Connector 1 on AGNI-I</b>	<b>AGNI-IIP or II</b>	<b>Signal</b>	<b>6515/6535 controller</b>
Pin 1	STP X	Step/Pulse	Pin 1
Pin 2	DIR X	Direction	Pin 2
Pin 13	(5V If required)	+5 VDC (If required)	Pin 3
Pin 14 – 25	(GND If required)	Ground (If required)	Pin 4

For Z axis location, find location Y3 on 6515 and Z axis location on 6535 controller. Transfer connection as follows:

<b>Connector 1 on AGNI-I</b>	<b>AGNI-IIP or II</b>	<b>Signal</b>	<b>6515/6535 controller</b>
Pin 1	STP X	Step/Pulse	Pin 1
Pin 2	DIR X	Direction	Pin 2
Pin 13	(5V If required)	+5 VDC (If required)	Pin 3
Pin 14 – 25	(GND If required)	Ground (If required)	Pin 4

For cylindrical axis location, find location (?) on 6515 and on 6535 controller. Transfer connection as follows:

<b>Connector 1 on AGNI-I</b>	<b>AGNI-IIP or II</b>	<b>Signal</b>	<b>6515/6535 controller</b>
Pin 11	STP C or STP CYL	Step/Pulse	Pin 1
Pin 12	DIR C or DIR CYL	Direction	Pin 2
Pin 13	(5V If required)	+5 VDC (If required)	Pin 3
Pin 14 – 25	(GND If required)	Ground (If required)	Pin 4

5. Many machines have Limit switches at both ends of the axis in all three axes. LinkMotion treats Limit switches as Home switches to find a Home position.

If the user is going to always have a specific location as the home position, only relevant switches can be wired into the Agni controller to bring the machine to the home position. An example would be as follows:

Many Leetro 6515 controller based laser machines use top right as the starting position. In this case, the limit switch that may activate in the X-axis when the X-axis moves to the right-hand side of the working area as well as the limit switch that may activate in the Y axis when the Y axis moves to the top side of the working area only need to be connected to the X and Y axis home pins on the Connector 2 of the Agni controller.

If on the other hand, it is required to change the home position, LinkMotion will allow the change in the configuration. In such a case, both the limit switches on either side of the axis should be connected to the Agni controller for the Home position sensing. Typically, if the switches have normally open configuration, they should be connected in a parallel configuration. However, if the switches have normally closed configuration, they should be connected in series before bringing the connections to the Agni controller.

Agni controller is equipped to handle passive type or active type switches if it requires only +5 VDC. The controller does not need external voltage if the limit switches are workable from +5 VDC.

Manufacturers may use active switches that may require +12 or +15 or +24 VDC for proper operation. In this case, it is necessary to apply an external voltage to the Agni controller only for the purpose of handling the limit switches. Transfer the wires from 6515/6535 to Agni as follows:

For X axis limit switch, find location X5 on 6515 and X-axis location on 6535 controllers. Transfer connection as follows:

<b>Connector 2 on AGNI-I</b>	<b>AGNI-IIP or II</b>	<b>Signal</b>	<b>6515/6535 controller</b>
------------------------------	-----------------------	---------------	-----------------------------

Pin 7	HOME X	X Home	Pin 3
Pin 14 – 23	GND	Ground	Pin 4

For Y axis location, find location X4 on 6515 and Y axis location on 6535 controller. Transfer connection as follows:

<b>Connector 2 on AGNI-I</b>	<b>AGNI-IIP or II</b>	<b>Signal</b>	<b>6515/6535 controller</b>
Pin 8	HOME Y	Y Home	Pin 3
Pin 14 – 23	GND	Ground	Pin 4

For Z axis location, find location X3 on 6515 and Z axis location on 6535 controller. Transfer connection as follows:

<b>Connector 2 on AGNI-I</b>	<b>AGNI-IIP or II</b>	<b>Signal</b>	<b>6515/6535 controller</b>
Pin 9	HOME Z	Z Home	Pin 3
Pin 14 – 23	GND	Ground	Pin 4

For external power for home switches, if higher than +5 VDC, bring the appropriate voltage by switching jumper and connect as follows:

<b>Connector 2 on AGNI-I</b>	<b>AGNI-IIP or II</b>	<b>Signal</b>	<b>6515/6535 controller</b>
Pin 13	OPT INPUT SW	PWR	External voltage
Pin 14 – 23	GND	Ground	

There are a jumper JP1 on the Leetro 6515 controller. The position of the jumper will indicate the type of voltage required for the configuration. If Pin 1 and Pin 2 of the jumper are connected, the Home switch configuration requires 24 VDC. If Pin2 and Pin 3 of the jumper are connected, the Home switch configuration requires 5 VDC. If, however, the jumper is removed, the home switches are not connected to the system.

6. Other important PWM connections for AGNI-I:  
(AGNI-IIP and II has PWM and GND shown on the board)

<b>Connector 3 on AGNI-I</b>	<b>Signal</b>	<b>Typical Co2 Laser Power Supply</b>
Pin 9	PWM power	Pin 6 (H or HL)
Pin 14 – 25	Ground	Pin 3 (GND.)
		Connect Pin 1(5VDC) to Pin 2 (IN)
		The water flow sensing and safety
		Switches sensing on Pin 4 (P or WP)
		Shall be preserved.

A. PWM connection for laser power control – PWM is a lot more accurate than the analog power control. However, the laser power source should be capable of accepting the PWM pulses. PWM stands for Pulse Width Modulation. Agni also generates a Tickle pulse on the same connection. Many laser power sources require tickle pulse when the power is applied to the machine but no job processing is taking place. The tickle pulse is specified by the manufacturer of the laser tube. Typically, the specification of the tickle pulse calls for a narrow width of a pulse at a particular frequency (e.g. 1-microsecond pulse at 5000 Hz). The pulses should be wide enough to keep the laser tube in a ready state in order to fire almost instantaneously. However, the pulse should be narrow enough not to generate any power.

There is a jumper JP2 on the Leetro 6515 controller. If the jumper is removed, the laser system is configured for analog laser power control. On the other hand, if the jumper is present, the laser machine is configured for PWM for power control.

For PWM power control of the laser, find location Y2 on 6515 and appropriate location on 6535 controllers. For proper connections, please, refer to the last part of this document - Ways to connect the Chinese CO2 glass tube power supply and Agni controller.

- B. The e-stop connection is available at Pin 2, Connector 2 on AGNI-I and ESTOP for AGNI-IIP or II along with ground if required. All of the safety switches that require pausing of laser operations can be wired through the E-Stop connection. Safety switches for door locks and other protections from laser radiation can be wired for E-Stop. It is best to use all of the switches in normally open or all of them in normally closed configuration. Proper wiring (serial or parallel) will guarantee that tripping of any of the switches will shut down the laser power generation and pause the motor motion operations. E-Stop can be configured for non-presence or normally high or normally low positions.

Whenever the E-Stop switch is activated, LinkMotion will present a message on the PC screen while shutting down the Laser operations. E-Stop is considered to be a serious enough problem where LinkMotion simply kills the job. The user is required to reset the material and restart the job.

- C. The explanation for the remaining connections on Connector 2 on AGNI-I or AGNI-IIP or II. Solustan will make available I2C serial communication protocol on pins 24 and 25 of the Connector 2 of AGNI-I or GND, DATA, and CLK on AGNI-IIP or II. When available, the machine can also be equipped physical Control Pad in addition to the PC based Control Pad. The Laser machine based Control Pad is likely to have following sets of commands:
- Pause
  - E-Stop
  - Cycle start/Repeat
  - Commands for jogging, seeking Home, controlling I/O's, etc.
  - Starting an SD memory card resident job
  - Yellow, Red, and Blue LED's for the feedback on Controller operations
- D. There are four I/O's present on Connector 3 of AGNI-I and 7 outputs on AGNI-IIP and II. These are;
- On/Off Laser power
  - Red Pointer
  - Water Control
  - Positive air pressure control for the lens assembly

All laser machines do not have On/Off controls for the laser. Generally, PWM controls the generation of power. However, there are designs out there that need a command to open the shutter for the lens or other safety measures that may require a logic level present throughout the duration of the laser operation. This is where On/Off output comes in handy. It can also be used if a warning light needed to be turned ON while a laser operation is taking place. It is important to note that the laser power will be turned off in between processing shapes. Whenever laser power is Off, the signal will also change its logic level.

Red Pointer does the same thing as the laser on/off output for the red pointer diode.

The Chinese glass tubes require water cooling. This output, when checked, will change the logic level when the job starts and will reset to the original logic level when the job is complete.

Many lenses used for focusing the laser beam are housed inside an assembly with a small opening at the lowest end. This is designed to repel the dirt and dust from clogging up the lens. A slight film of dust could rob significant power of the focused laser beam. Newer assemblies are also designed with a small positive air pressure to further repel the dust particles. This output can be connected to the generation of the positive air pressure. This output, when checked, will change the logic level when the job starts and will reset to the original logic level when the job is complete.

## **What are the ways to connect and control the laser power output from a Chinese CO2 glass tube using AGNI controller?**

Most Chinese CO2 laser tubes come with appropriate power supplies. Generally, the power supply is designed to generate very high voltages for relatively small currents required to generate the laser power.

Agni controller provides the following control points for connecting to the laser power supplies.

1. On/Off laser power
2. PWM controls and generation
3. Signal ground connections

The typical laser power units have the following connection points:

1. 5 VDC out
2. IN – Analog power levels from 0 to 5 VDC for 0 to 100 percent power. It will also accept PWM (pulse width modulated string of pulses at a selected frequency) and will convert to an analog signal with a simple RC circuit.
3. G – Ground connection
4. P or WP – Water sensing and other protections like open doors can be connected to this pin. If anything is not proper like water is not present or a lid is open, the laser will not fire.
5. L or TL – Logic Lo on this pin will allow the power to be generated.
6. H or TH – Logic Hi on this pin will allow the laser power to be generated.

Here is the preferred way to connect the Agni controller to the glass tube power supply to generate the power most appropriately:

- A. A. First of all, the P or WP line is not controlled by Agni. It is connected directly to the water pressure sensor, lids, and other safety situations. This is somewhat akin to Emergency Stop controls on CNC machines. One can connect E-Stop switch also into this location and in series with all the

other safety measures. If anyone of them is false, no power will be generated by the laser tube. In other words, the laser tube shall not generate power if the water cooling is not present. Without the water cooling, the glass tube will be destroyed in a hurry.

- B. B. Only, either H (HL) or L (TL) line is required to be used. Either L to be low or H to be high can be used for the power to be generated. If either one is not true, no power will be generated by the laser tube.

This brings us to suggest ways to connect the Agni controller to the laser power supply unit.

### **Steps:**

1. 1. Connect a jumper from +5 VDC out connection on the laser power supply to IN connection. Both connections are next to each other on the laser power supply module. This guarantees full power level at +5 VDC.
2. Connect a ground wire from the Agni controller to the G (ground pin) on the laser power supply.
3. Connect PWM line from the Agni controller to H (HL) connection. The frequency of the pulses and the width of each pulse will determine the power ON time for the selected frequency. The H line will modulate the full power by turning it off and on many times in a second. The average power will be determined by the width of the pulse. Different frequency will generate a different intensity of the laser power beam to allow it to affect the material properly and for a proper job.
4. Although the On/Off laser power line is not connected to the laser power supply unit, it is still functional. If Enable Laser in the Material Properties Tab is not checked in the user interface, it will not generate power and will act as an additional safety measure.

### **Advantages are:**

Modulating the laser power at appropriate frequencies tend to generate sharper power peaks and may do a better job on the material at relatively lower power curves. Many materials react differently to different frequencies. This setting allows actual varying of the frequencies for the material. Also, this is possible while using the standard Chinese glass laser tubes and accompanying power supplies.

As always, please, provide us the feedback. Getting feedback from actual users is the best way for us to continue to improve our products.

# Frequently Asked Questions:

## Section I - Microsoft Windows configuration and computer-related questions:

### 1. What is the minimum configuration required for the PC?

Windows 10, 8, 7 64 or 32-bit operating system or

Windows XP operating system with Service Pak 2 or higher and Microsoft .NET 2.0 or higher Framework installed and USB 2.0 port,

Processor speed of at least 800 Mhz, minimum RAM memory 4 GB or more preferred specifically for raster work.

40 MB of Hard drive free space, Screen resolution of at least 800 x 600.

Service Pak and .NET 2.0 Framework are (free) downloadable from Microsoft's website.

CD-ROM drive is not required if the driver software was downloaded from the website.

CD-ROM drive is necessary if the software was received on a CD.

### 2. How to check if I have installed Service Pak2 or higher on my computer?

Go to the **Start** button. Select **Control Panel**. Select **System**. Now in **General** menu, it should show if **Service Pak 2** is installed. Also, you can install and uninstall by windows standard Add/Remove program procedure. Make sure you install LinkMotion after you install windows operating system related update first.

### 3. How to check if I have installed .NET Framework 2.0 or higher on my computer?

Go to the **Start** button. Select **Control Panel**. Select **Add/Remove programs**. Here you should see if you have installed the **.NET Framework 2.0** of Microsoft. **This is required to work with our new version of LinkMotion.**

### 4. How can I check the processor speed and RAM memory on my PC?

**Go to the Start button on the System Tray on the bottom left and select Control Panel. Select System from the Control panel. Here you should see information for the version of your operating system and under Computer, you should see the processor speed and the RAM memory installed on your computer.**

### 5. How to see hidden files and folders in Windows XP?

**Go to the Start button. Select Control Panel. Select Tools Menu and select Folder option. Click on the View menu. You should see a folder called Hidden files and folders. Here select the button for Show hidden files and folders. Click on the Apply button. Now you will see all the folders. This is useful to see the configuration file name LinkMotion.INI for LinkMotion driver application.**

## **6. How to see hidden files and folders in Windows 10, 8 or 7?**

**Go to Control Panel and click on the Appearance and Personalization. Under folder, Options Click on the Show Hidden files and folders. Here check the button for Show hidden files, folders and drives in the middle section under Hidden files and folders. Click on the Apply button. Click on the OK button. This is useful to see the configuration file name LinkMotion.INI for LinkMotion driver application.**

## **7. How to setup under Windows 10, 8 or 7 for viewing the LinkMotion icon in the systems tray at the bottom right?**

**Go to Control Panel of windows from the Start button. Click on the Appearance and Personalization. Click on the Taskbar and Start Menu. Click on the Customize icons on the taskbar. Here make the selection of Always show all icons and notifications on the taskbar. Click on the OK button.**


## **8. How can I tell if my computer has USB 2.0 or 1.1? What is the difference?**

This is necessary to check only for older Windows XP computer. Newer computers always come with USB 2.0 ports. USB 1.1 transfers data around at 12mbps, with each new device, added to your system taking up progressively more of the available transfer pipe until you hit a point where your USB gets overloaded. USB 2.0 is a massive speed increase to 480mbps, which leaves plenty of room for most device operations.

Finding out if you have USB 1.1 or 2.0 is complicated because some motherboards don't accurately identify your device as USB 2.0. To find out which version you have, open the Device Manager by right-clicking My Computer and choosing Properties (or with Windows key + Pause/Break on the keyboard). Click the Hardware tab and then click on the Device Manager. Scroll down until you locate the Universal Serial Bus controllers and expand the list of controllers. If you have a USB 2.0 controller on your computer, the word Enhanced will be listed somewhere in one of those names. In some cases, it might say USB2 and some other case it might say Enhanced as well. The word Enhanced may appear without any reference to USB2 or USB 2.0. If it says Enhanced, it doesn't matter what additional details are included along with it. It's also important to make sure you know which USB ports on your computer is connected to the USB 2.0 transfer bus. You may have a computer with USB ports on the front which interface with USB 1.1 and transfer data slowly compared to the USB ports on the back of the computer, which is USB 2.0.

## **9. How to use a laptop computer with numeric keys for LinkMotion Control Pad?**

Laptop computers mostly do not have a numeric keypad like desktop computer's keyboard. The user can observe the regular keyboard and as shown on the following picture they have numeric keys printed in blue color along with regular keys like 7, 8, 9, U, I, O, P, J, K, L etc.

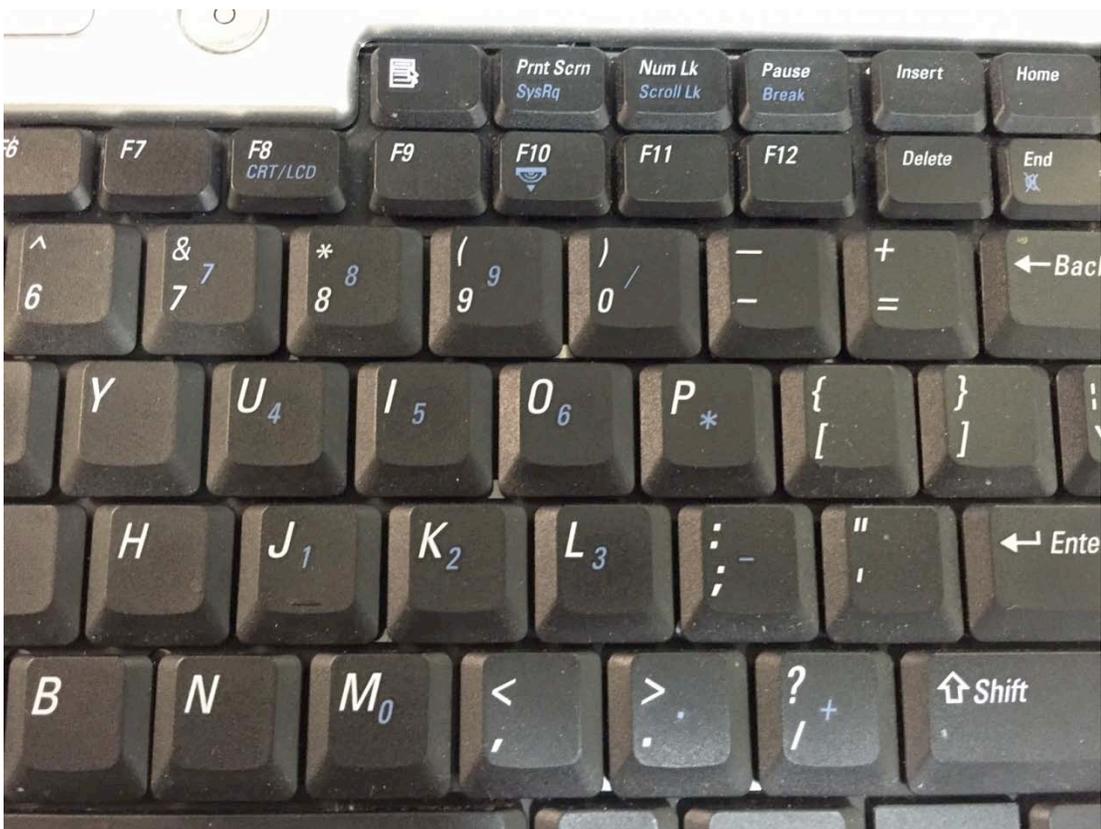

These keys are available to use in NumLock mode. Either pressing Num Lock (NumLk or Num) key by itself or using the shift key + Num Lock key brings that numeric mode. The Numeric mode also can be confirmed in most computers by a display of a light with a lock symbol and number '9' in it. Now, to use these numeric keys user will have to press Fn key along with any one of the numeric keys. Fn key is located on the left side of the keyboard near the Ctrl and Alt keys.

**Remember to disable Num Lock key by pressing it again to use regular functions of your computer when you are done using it with LinkMotion Control Pad.**

**Using numeric key like one for I/O 1 for laser testing it will require special handling since a mouse click is necessary on the Ok button of the message on the screen for it to work properly.**

## Section II - LinkMotion Driver Software:

### 1. Do I need to access LinkMotion driver software once loaded?

Generally, you simply deal with your job design software and your machine. We do provide an accompanied settings application. This application can be invoked from its icon in the System Tray area. This application will allow you to choose a few settings by going to different tabs (menu) like Material Properties, Machine parameters, Origin setup and Motion Control Boards. Make all selections, click on the apply button and then start the design application.

### 2. How do I know if my LinkMotion is installed properly?

**Windows 10, 8.1 or 8 requires Disable driver signature requirement procedure just prior to installing LinkMotion. LinkMotion driver will not be installed properly if it was not followed properly.**

When you launch LinkMotion applet does it show the title “**LinkMotion for My Machine-USB for CO2 Laser – Ver. X.XX**” (Version). If this is not proper you may have installed the wrong machine. You need to **uninstall and re-install LinkMotion again** by windows standard uninstall procedure.

The Installation also requires you to install **AGNI USB Controller driver**. This can be checked under Windows device manager to confirm if it is installed properly by following the instructions under installation from the **LMUSB-Laser.PDF** manual.

If you had a trial version you need to purchase the full working version.

### 3. How to see the file name LinkMotion.INI with configuration settings for my machine?

This file is named **LinkMotion.INI** and user can locate the file from the following location:

#### Under Windows 10, 8 or 7:

C:\ProgramData > Solustan > LinkMotion> LinkMotion.INI

#### Under Windows XP:

C:\ > Documents and Settings > All Users > Solustan > LinkMotion > LinkMotion.INI

This file has all your machine related settings. You can save this file under a different name as well as reload this file from where you might have saved this file.

### 4. How to see LinkMotion generated the G-Code file name temp.txt?

The last job sent by using a Prints command from your design application will generate a G-Code file and it is saved as temp.txt under following location: (This file is always re-written when next job is printed.)

#### Under Windows 10, 8 or 7:

C:\ProgramData > Solustan > LinkMotionUSB > Tempfiles > temp.txt

**Under Windows XP:**

C:\ > Documents and Settings > All Users > Solustan > LinkMotionUSB > Tempfiles > temp.txt

## **5. How to see LinkMotion generated BMP file for raster work?**

**The Following location will have the LinkMotion generated BMP file for your job:**

**Windows 10, 8, 7 32/64:**

C:\ProgramData > Solustan > LinkMotion > 1.BMP, 2.BMP... (more files if more than one BMP is generated)

**Windows XP:**

C:\Document and Settings > All Users > Solustan > LinkMotion > 1.BMP (more files if more than one BMP is generated)

## **6. How to setup proper margin for a Raster job?**

Raster Margins for travel of X-Axis is controlled by a line in the LinkMotion.INI file under each machine related settings:

**BMPMarginMultiple=5**

The Default value is 5 and it creates 1inch margin on both sides. Increasing this number adds additional 0.2 inches. Remember to save the INI file and relaunch LinkMotion for the newer value to be effective.

Detail explanation for setting up the Raster Margin value along with proper Raster Acceleration number is explained later in this section under raster acceleration explanation.

## **7. LinkMotion is installed but the lights on Control Pad are red, Why?**

There are three lights on the Control Pad of LinkMotion under Solustan logo.

**USB connection, SD memory, and Emergency stop.**

**USB Connection** light remains red until the USB controller and LinkMotion will establish a proper connection by loading the driver for USB Controller. The User needs to follow instructions from the document name **Install USB Controller driver**.

**SD Memory card** needs to be plugged in and the light should be green.

**Emergency stop** light should be green if the proper wiring is done for the switch and it should be red when you press the emergency switch. Please refer to the **LMUSB-Laser.PDF** for more detail explanation.

There are also three more lights on the Control Pad of LinkMotion next to the X, Y and Z axis counter on the top section. These lights are for home(limit) switches of your machine. Check if you see all three lights to be green. Home switches are available by using normally open or normally closed mode. Origin setup of LinkMotion has the selection available for both the modes. You can try reversing this mode click on the Apply button and see if home switches lights changed from red to green. You can temporarily disable them by checking the check mark for the disable home switches under Origin Setup of LinkMotion. Please refer to the **LMUSB-Laser.PDF** for more detail explanation.

## **8. When I connect the cable from USB Controller card to my computer's USB connection it gives me a message that I have USB 1.1 and it will not work. I know that I have USB 2.0 connection on my computer. Why?**

Even though you have USB 2.0 connection on your computer but if you are using any hub or extension devices to have more USB ports they can bring you USB connection down to 1.1 level. It is extremely important to plug this cable directly into your computer's USB 2.0 connection. Some wireless devices like wireless mouse or keyboard may have this kind of effect also so you need to check and make sure that you have proper devices.

## **9. LinkMotion for USB working with USB Controller is not moving any of the axes. Why?**

**First important thing to check is all of your cable connections.** Make sure nothing is loose. Second thing is to check if SD card is plugged into the USB controller board properly. **The Third problem can be Emergency Stop may be activated. Control Pad of LinkMotion also shows you three green lights if all three are properly recognized. These lights may be red if anyone has a problem and you need to correct this to make it work properly. Activate Disable home switches check button in Origin setup and click on the apply button. Now see if your axis moves.** Please read and understand from the manual [LMUSB-Laser.PDF](#) file.

## **10. When I launch LinkMotion it is telling me that I do not have proper firmware. What should I do?**

We keep improving the AGNI USB controller board with rich features regularly. We also improve LinkMotion capability to take advantage of those features. This is why you may be required to update the firmware. This is generally available with the newest version of LinkMotion and the firmware update is included. Instruction on how to update the firmware is given at the end of the installation section of the manual.

## **11. What are the G-Codes supported with LinkMotionUSB?**

Please refer to the manual where we have listed all the G-Codes compatible with this USB Controller board and LinkMotion working together. EMC2 G-Codes are supported. Raster engraving uses special g-code.

## **12. LinkMotionUSB behaves in a strange way if I have not used it for a while and come back to my computer. Why?**

Power saver and Screen Saver mode on your computer should be turned off. **This can cause problems in recognizing the USB connection on a continuous basis. If the USB controller board is powered by the PC's USB port power supply it may be necessary to unplug and plug it back again the USB cable every time you turn on the computer and re-launch LinkMotion.**

## **13. I want to design in millimeters and not inches. How do I change?**

Simply go to the **General Options** tab and change from **inches** to **mm** by clicking on the scroll down arrow and then **click on the Apply button**. Similarly, you can change to cm also. It is that easy.

## **14. I am sending the file for printing and nothing is happening. What am I doing wrong?**

This situation may occur due to any of the following:

**(A) There are three lights on the Control Pad** of LinkMotion under Solustan logo. USB connection, SD memory, and Emergency stop. Check if you see all three lights to be green on the Control Pad screen of LinkMotion. If any of the lights are red the job will not go out. Please refer to the help section or LMUSB-Laser.PDF for more detail explanation.

**(B) There are also three more lights on the Control Pad** of LinkMotion next to the X, Y and Z axis counter on the top section. These lights are for home(limit) switches of your machine. Check if you see all three lights to be green. You can temporarily disable them by checking the check mark for disabling home switches under Origin Setup of LinkMotion. If any of the lights are red the job will not go out. Please refer to the help section or LMUSB-Laser.PDF for more detail explanation.

**(C)** Check if you have given the Print command from your design application.

**(D)** Check the print queue for any extraneous documents and remove them.

**(E)** Check the job feed rates and other settings to make sure that they are all correct.

**(F) A Printer driver installed on your machine may not have been selected as DEFAULT DRIVER.** Please check in **Control Panel>Printers and Faxes>Your Machine Driver (this should be selected as default driver)**.

**(G) You might have selected thick outline or filled object** in your design for cutting (vector) job. **White fill is also not proper to send the job to a machine. Use the Hairline for any job you design with graphics or text. If you sent the file for print by mistake with a thick line or the filled object go to the print spooler and make sure you delete the file properly before sending the new corrected file. Raster job is supported for LinkMotion Laser software only.**

**(H) If Service Pak 2** was not installed on your **Windows XP operating system** you may see the problem of LinkMotion not sending anything to the machine. You need to **uninstall the LinkMotion** and then **install the Service Pak 2** and **re-install the LinkMotion driver**.

**(J)** Make sure to design the job within the size of plotting area available with your machine table size.

**(K)** If you are using Windows operating system under different language you need to check the settings. Go to Control Panel> Regional and Language Options>  
Refer to the installation section of the manual for more details.

## **15. Can I preset or change the values for the speeds of operation for different materials? Where and How?**

Launch LinkMotion from Systems Tray. Go to Material Properties. Set values for **Cut (Vector) Speed** of operation for different materials. Click Apply and then send the file again to the machine. Read more details in the chapter **Using LinkMotion or LMUSB-Laser.PDF**.

## **16. I have set up and customized LinkMotion for my needs. Now, you sent me information on a new version of LinkMotion. How can I preserve my settings while upgrading to a new version?**

It is very easy. Remember to first save your older configuration file and then uninstall. Follow the uninstall instruction (from the end of the document) from installation instructions. Now install the new version and bring back your older configuration file from General Options tab by Load button. Re-Launch LinkMotion driver one time and then work with your new version. Sometimes if we have added major features then it is safe to use new INI file and change all the numbers for your machine related settings manually.

## **17. Under Windows XP using LinkMotion version 2.93A or lower, Checking the button for Design using Plate size function under Material properties of LinkMotion and file output is not proper, what should I do?**

Design using Plate size function allows you to design your job in Corel draw with page size same as the plate size declared in LinkMotion under Material Properties. If this function is not checked user needs to design the job with page size to be the same as table size declared in Machine properties of LinkMotion.

If you check the button for Design using Plate size function, make sure to use following method to output the file.

First, make sure that LinkMotion USB printer driver has proper setup in the following location:  
Go to the **Start button** and **Printer and Faxes**.

Here you should see your **LinkMotion USB printer driver with your machine name**.

Click on that printer driver with the right mouse button and select **Properties**.

Click on the **Advanced Tab**.

Click on the **Printing Default button**.

Here make sure **Portrait or Landscape** is selected depending on your machines table size declared in under Machine properties.

If X-Axis is larger than Y Axis it should be Landscape and if Y-Axis is larger than X Axis it should be Portrait mode.

Click **OK** until it is saved and close all the tabs.

Now launch LinkMotion and go to the **Material properties**.

Check the selection **Design using material size**. Enter the **width** and **height** of the material you are planning to use. It should be smaller than the table size declared in Machine properties.

Click on the **Apply button** and Click **OK**.

If you had your printer driver in Portrait mode and your plate size in landscape mode then you will see the following message:

**“Printer Orientation does not match one or more document pages. Adjust printer automatically?”**

Similarly, if your machine’s table size has portrait dimensions and you have checked **portrait mode for printer driver and your plate design is landscape mode** then follow the same instructions from above before the **clicking on the final Print button**.

## **18. How to set acceleration for raster work in laser machines?**

There are at least three types of major structural designs for CO2 type laser machines.

1. Laser machines with stationery mounted laser tube and cleverly mounted mirrors to bring the laser beam to the optical head. The optical head is very light in weight and is designed to traverse back and forth at high speeds for raster work. More often than not, the head moving mechanism consists of belt and pulley to move the head at high speeds (20 to 50 inches per second or 500 to 1,250 mm per second). These types are also known as flying head machines.
2. Laser machines with gantry mounted laser tube eliminating the need for mirrors arrangements. However, the weight of the gantry may prohibit the head to move at high speeds for raster work. These machines, typically, are designed for cutting work and are not optimized for raster work.
3. Laser machines are designed with Galvanometric motors for extremely high-speed operations operating in a working area less than 200 mm. AGNI controller is not designed to work with Galvanometric motors and hence, this option is outside the scope of this note.

The driver software that comes with the AGNI controller is called LinkMotion.

The case of laser tubes mounted on the gantry:

In this particular type, the gantry weight is likely to be quite high and may not be well suited for high speed traversing across from left to right for quick raster work. The acceleration settings for the X-axis for both, vector and raster work, are likely to be similar.

**There is a larger population of the first kind - stationery mounted laser tubes. The following calculations can be applied to any type of machine design for laser work.**

Three settings are available for proper acceleration and raster work under the control of AGNI laser controller.

1. The minimum distance setting to accelerate the traversing axis (X-axis) to bring it up to the desired velocity. This is known as a BMPMarginMultiple setting in INI file. It is declared as numbers 1 or higher. The distance is equal to the declared number multiplied by 0.2 inches.
2. Desired velocity (engrave or raster speed)

This is declared as inches or mm per second in the Materials Properties Tab.

3. Appropriate raster acceleration setting

This is declared as inches or mm per second per second in the Motor Parameters Tab.

It is always nice if the manufacturer of the mechanical part of the laser machine specifies the maximum velocity and acceleration the machine is designed to withstand. The chances are that you are not going to get these numbers!


Let us start with the following assumptions:

Velocity or speed = 500 mm/sec

Acceleration = 5000 mm/sec/sec

We will use the above numbers to calculate the distance required for accelerate to achieve the velocity of

500 mm/sec and decelerate to stop to zero velocity and then reverse the direction. LinkMotion likes to engrave the job both ways, traveling from left to right as well as from right to left. The declared BMPMarginMultiple distance is used on both the sides of the job. Look at the graphics to understand the operation by visualizing timing and velocity relationship.

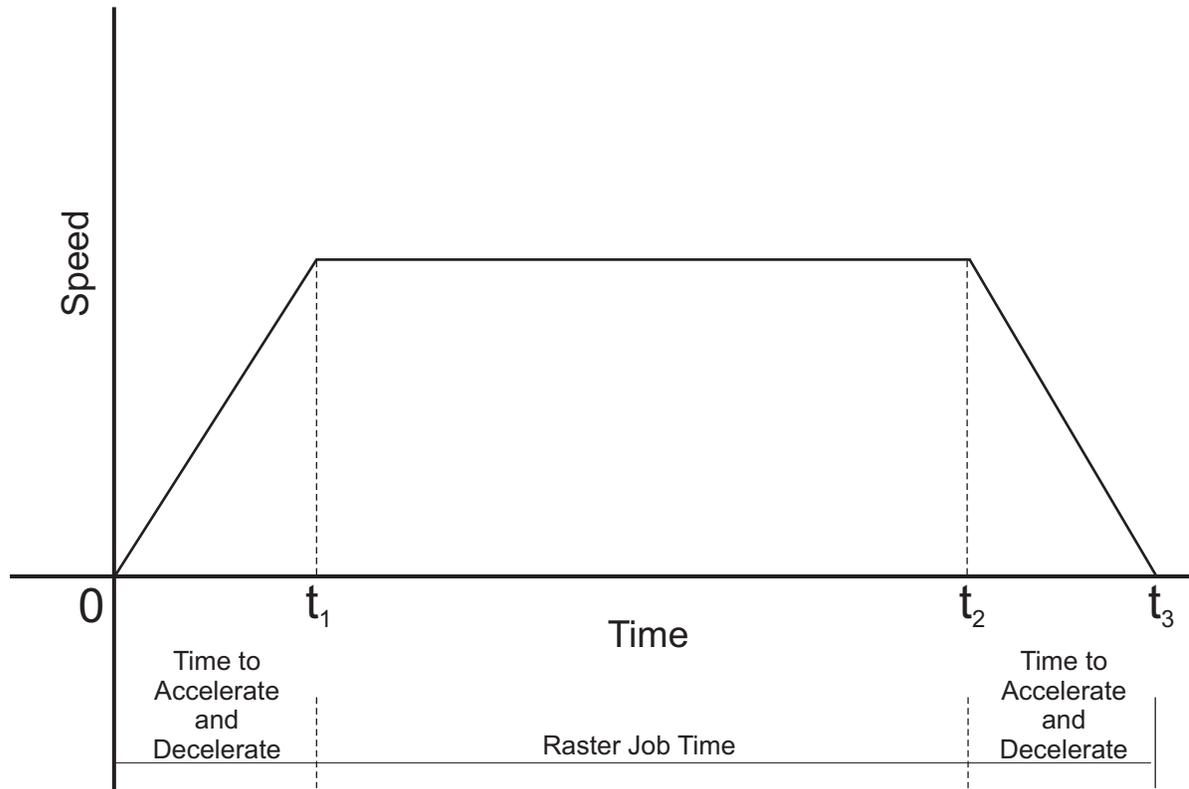

$V_0$  = Velocity at time zero

$A$  = Acceleration

$t$  = Time required to reach the velocity of the prescribed acceleration

For our purposes,  $V_0$  is always zero. We are starting out from a standstill position. Let us plug in the numbers,

$$500 = 5000 (t)$$

or

$$t = 500/5000 \text{ or } 1/10 \text{ second or } 0.1 \text{ second.}$$

If it is going to take 0.1 seconds to achieve the desired velocity, how much distance will be traveled in that time. This is the distance we will declare in the BMPMarginMultiple variable.

**Equation number 2 is;**

$$D = V_0t + (1/2) A (t^2)$$

Where  $D$  = Distance required achieving the desired velocity

$A$  = Acceleration or 5000

$t$  = Time to reach the velocity or 0.1 sec

We know that  $V(0)$  is zero. This will simplify the equation,

$$D = (1/2) 5000 (0.1) (0.1)$$

or

$$D = 25 \text{ mm or approximately } 1 \text{ inch}$$

Therefore, we can declare the `BMPMarginMultiple` to be 5 (5 times 0.2 inch will be 1 inch).

This means that if your job is 400 mm in width, the total distance required for the carriage to move will be 450 mm to raster the job properly. You should also be able to calculate where the job will appear on the material. If the machine does not have a clearance of 25 mm each to the left and the right, the following action or actions are required:

- A. Reduce the size of the width of the job
- B. Increase the acceleration to reduce the `BMPMarginMultiple` distance.
- C. Reduce the velocity to reduce the `BMPMarginMultiple` distance.

If the desired output is not created on the material, it is possible that either the declared velocity or acceleration is outside the mechanical capabilities of the machine.

## **19. How to set acceleration for vector work using LinkMotion? (Cutting for CNC and Laser machines)**

There are simple relations among the settings of velocity (speed), acceleration, maximum RPM settings for the step motors, and the performance of the machine.

Solustan controllers and the software settings are designed to work with many different types of engraving, CNC, and laser machines. We will work with the following assumptions to start the understanding of the settings.

1. CNC machines have the heaviest gantries and the machines need to move slower, perhaps in the range of 30 to 60 inches per minute.
2. Engraving machines have lighter gantries compared to CNC machines and these machines could move faster, perhaps in the range of 60 to 120 inches per minute.
3. Typical laser machines optimized for cutting and engraving (raster) work have the lightest gantries to achieve high speeds for raster work. The laser machines could move in the range of 30 to 300 inches per minute for cutting work and up to 3,000 inches per minute for engraving (raster) work.
4. Step motors are designed to generate near constant torque below a certain speed (RPM). If and when the speed exceeds the RPM limit, a reduction in torque will take place. As long as the step motor speeds are below that critical RPM limit, it will generate desired torque to move the machine. Step motor manufacturers provide this information. The default settings for the maximum RPM in LinkMotion is 2,500 RPM.

5. Default settings in LinkMotion for the acceleration are conservative numbers for cutting work. These settings can be changed based on the design conditions and the selection of step motors for the job.
6. The calculations for the acceleration and speeds for the raster work are treated separately in a different application note.

Unless the manufacturer of the machine provided proper settings numbers, it is most desirable to start with the default numbers to establish proper working of the machine. Once the machine is working properly with the Solustan provided controller, you can fine tune in the following manner:

- A. If the speed of cutting is increased and the acceleration numbers were left alone, the lower acceleration numbers will take longer to achieve the desired speed and hence, it will be slower throughput. Slower speeds will be particularly obvious along the curves.
- B. If the acceleration numbers are also increased along with the speed, it will take less time for the step motors to achieve the desired speed and the throughput will increase accordingly.
- C. If either or both the numbers are increased significantly, it is possible that the step motors may fail to either start due to not being able to start to move the machine under high acceleration or lose steps and hence, accuracy due to step motors not being able to achieve the desired speed. This could cause degradation in the quality of output.
- D. The trick is to increase the numbers critically. Optimum numbers will generate the output with optimum quality and speed for your machine's mechanical design.
- E. LinkMotion is also designed with an additional safeguard. If the speed number is increased excessively, the internal calculations will detect the problem and LinkMotion will present a message on the screen with the maximum allowable federate (speed). LinkMotion will not allow setting of the speed higher than the maximum allowable speed.

The User may find that an increase in RPM of the step motor may allow higher setting of the speed. Maximum motor RPM can be increased in Motor Parameters Tab. Warning: Increase in RPM may result in degradation of torque generated by the step motors. This may be, perhaps, an unhealthy situation. If the available torque from the step motor is more than necessary for the job, the user will still be pleased with the results. On the other hand, if the step motors are critically selected for the job for generating just enough torque to do the job, the user may find losing of steps and ultimately, unacceptable job results.

- F. The cutting speed setting takes place in the Materials Tab.
- G. The acceleration setting takes place in the Motor Parameters Tab.
- H. The step motor RPM setting takes place in the Motor Parameters Tab.
- J. A well maintained, clean, properly serviced, and the lubricated machine will go a long way in producing acceptable results.

## **20. How to report a problem with LinkMotion?**

LinkMotion is a very reliable driver software with many features.

It allows users to work with many powerful but off-the-shelf design application programs. Solustan encourages users to try new applications and tell us about your experiences.

90 days free support is available to all new customers (First-time buyers).  
30 Days free support is available for an upgrade version of the LinkMotion software.  
There will be a charge after the above-mentioned free period expires for all customers.

When you find a problem, you need to provide as much information as possible to Solustan. If we can reproduce the error here, we can solve the problem quickly. More details are better than less.

The following details can be very useful in resolving the problem:

**1. What type of Linkmotion application are you using?**

LinkMotion for Laser, LinkMotion for CNC/Engraving, LinkCAM or LinkLite.

**2. Provide the LinkMotion version number you are using.**

The version is always shown on the top end of the Control Pad of LinkMotion.

**3. Provide the Serial number and Firmware version.**

Serial number and Firmware version are shown under the Solustan Logo on the Control Pad of LinkMotion.

**4. Which version of the Windows operating system are you using?**

Win10-64bit, Win10-32bit, Win8-64bit, Win8-32bit, Win7-64bit, Win7-32bit, Win XP

**5. In case of a problem with the raster job, tell us how much RAM memory you have on your computer.**

**6. Name of your design application and the version no?**

**7. Send us your design file that creates the problem.**

Send us the screen picture of your design. In case of Corel save it in X3 version and send it.

**8. Explanation of the problem in as much detail as possible.**

How often it happens. Error message if any.

Screen pictures in case of any messages and Picture of the problem(output) are very useful.

**9. Send us the installed LinkMotion.INI file when a problem occurs from the following location:**

Windows 10, 8, 7 32/64:

C:\ProgramData > Solustan > LinkMotion > LinkMotion.INI

Windows XP:

C:\Document and Settings > All Users > Solustan > LinkMotion > LinkMotion.INI

**10. Send us the last generated gcode file name temp.txt from the following location:**

Windows 10, 8, 7 32/64:

C:\ProgramData > Solustan > LinkMotionUSB > TempFile > Temp.txt

Windows XP:

C:\ Document and Settings > All Users > Solustan > LinkMotionUSB > TempFile > Temp.txt

## Section III - LinkMotion and AGNI USB Controller:

### 1. What are the functions of AGNI controller board lights?

There are three LED lights available to attach to the Agni Controller board – Blue, Amber, and Red. These lights behave in the following manner when connections are made and the board is powered:

**Blue LED Flashing Slowly** – No USB Connection

**Blue LED Steady** – USB powered up and ready

**Amber LED Flashing Slowly** – Waiting for firmware update

**Amber LED Flashing Fast** – No SD (Memory) card

**Amber LED Steady** – USB ready for SD card

**Red LED** – Turns on when the board is powered. It turns off when it makes a proper connection with LinkMotion. It also turns on every time when any machine motion is detected.

**Red LED Flashing** – If hardware switch for Repeat is installed on the Laser/Agni controller and LinkMotion.INI file is set up properly, then, Red LED starts flashing after a job is processed one time. Pressing the Repeat switch will send the job again to the machine. After a job is processed one time it is ready to repeat the last job using the repeat button on the USB controller as many times as user wishes.

### 2. What is the function of the SD memory on AGNI Controller?

LinkMotion generated job is transferred to the SD memory. AGNI controller then takes over to process this job. Approximately 1 minute of machine operation uses 1MB of SD memory for vector work. This controller supports up to 4GB Memory. If you are using LinkMotion version 3.5 or higher, you could use either SD or SDHC memory cards.

Memory chips tested and working with this controller: Sandisk (1 GB, 512 MB, 256 MB), Topram 1gb, PNY 1gb, PNY 4gb SDHC, Samsung 1gb, Transcend 1gb and 'Made in China Generic' 1gb.

Memory chips found not working with this controller: Kingston 2gb (not SDHC) and 4gb SDHC.

**Do not format or use formatted SD memory for this controller.**

### 3. How to use Cycle Start and Hardware Pause function with LinkMotion?

**Activating the HardwarePause switch also requires activating the CycleStart switch for it to work properly. Only Hardware pause switch will not work properly by itself.** If the hardware Pause switch is activated, it will pause the job immediately but Z axis does not lift up. Now activating the CycleStart switch will allow for the job to continue. Do not press the Enter/Repeat Key on the keyboard to continue to finish the job when it was paused using the HardwarePause switch. Enter/Repeat key pressed at this point sends the full job again from this Pause position.

Activating the CycleStart switch allows the user to either continue the job after the user has paused the job using the HardwarePasuse switch or Start or Repeat the previously sent job. This switch can be activated by itself.

Once the Cycle start switch is activated it will prohibit the automatic starting of a job when 'Printed' from a job design software. The job will be transferred to the SD memory card on the Agni controller. However, the job will not start until the Cycle start switch is pressed or activated.

## **How to setup LinkMotion for not starting the job when Print command from the job design software is used without the hardware switch for Cycle Start?**

User should setup CycleStart=3 (default is -1 means not active) in the Linkmotion.INI file under their machine related settings, save the file and Re-Launch the LinkMotion application. Now the Printed job from the design application will be transferred to the SD memory. The user will see the USB controller's red light flashing. REPEAT/Enter Key on the Control Pad can start the job, if and when required.

### **4. How to use E-Stop switch with LinkMotion?**

1. Normally, the LinkMotion software is shipped with E-Stop sensing disabled via the INI file. Search for the line EStop= -1 in the section of the INI file for your machine (Name of the machine you selected when installing).

EStop= -1 disables the function.

EStop= 0 enables emergency stop function for the normally open E-Stop switch.

EStop= 1 enables emergency stop function for the normally close E-Stop switch.

**IMPORTANT:** Laser machines have many safety switches to make sure that all doors and other openings are closed before turning ON the laser power. All the wiring of the safety switches and the wiring of the E-Stop switch must be connected to the E-Stop connection. Any break in the switch circuits will disable the generation of the laser power.

2. Additionally, when the LinkMotion Control Pad is displayed you will see a green or a red light to the right of the control buttons indicating the status of the E-Stop.

3. E-Stop wiring information is printed on the newer new AGNI boards.

4. The sensing voltage must be limited to +5 VDC when connecting lines to the E-Stop pin on our controller. Applying higher voltage will damage the controller.

5. The New version of 32-bit AGNI boards are optoisolated using optoisolation circuits and a jumper is provided to use either internally available +5 VDC or externally provided a higher voltage.

Maximum allowable external voltage is 24 VDC.

6. On sensing the fault on the E-Stop line, the controller will halt any motion in progress, display a red light for Emergency Stop on the Control Pad screen, terminate any profile that is running in the controller.

Using new 32-bit AGNI Controller user needs to first deactivate the Estop switch, home the machine and send the job again.

The Job will never be processed if Estop is active showing the red light on the LinkMotion Control Pad.

Firmware 3074(32bit controller) and LinkMotion version 4.20 and higher allows you to see the Light for Estop becoming green when Estop switch is not pressed(Released). The user can jog the machine and home the machine for starting a new job without relaunching LinkMotion. A Previous version of the all the firmware (prior to 3074 for the 32-bit controller) and LinkMotion required for the user to Re-launch Linkmotion before it allowed you to jog and home the machine.

7. There is no internal circuit designed to take the power off of the AC to DC power supply. The step motor will still be powered. However, there will be no movement.

## **5. How to prevent from losing a job when there is a power outage while processing the job?**

### **Possible solution if you have AGNI USB controller card from Solustan:**

**A:** Get a UPS that is good for about 10 minutes for your system and the PC.

**B:** Power the AGNI USB controller with external +5V DC.

**C:** In a resting state, AGNI USB controller consumes less than 40ma. Connect a lithium ion battery to the power input point of the AGNI USB controller.

**D:** When you loose the main power, UPS will give you the time to Pause the job with LinkMotion Control pad. Once paused, turn off the System. However, the AGNI Controller will be powered by the Lithium ion battery and keep it in the Pause mode.

**E:** After the power is restored, select to continue the job in LinkMotion.

## **Section IV - LinkMotion and Design Applications:**

### **1. My machine moves properly with Control Pad of LinkMotion but when I send the job I have a problem. Why?**

You need to make sure that your page size in the design application is same as the machine (table) size declared in the machine properties of LinkMotion. Printer driver selection from your application should be for LinkMotion driver installed for your machine name. Shapes in your design should have **hair line, thinnest line or zero width line** selected for vector output. **Shapes cannot be filled for vector output.**

Please refer to the most recent document LMUSB-Laser.PDF and LM & Popular applications.

### **2. Can you tell me briefly the settings I should make sure of in Corel Draw! version 11 or 12 to make Corel and LinkMotion compatible with each other?**

Yes, we suggest that you take a look at the HELP section and read the chapter on LinkMotion and popular applications. We have listed a number of settings and suggestions. Check the website for latest updates LMUSB-Laser.PDF and LM&Popular applications.

### **3. How can I change starting positions of a job?**

**Starting position is controlled by your design application as well as what you have** selected in Start Position under Origin Setup of LinkMotion. Please read and understand functions of both applications from their help section before using it.

### **4. Why is my job being cut goes back and forth all over the machine?**

Most design applications generally will output jobs in the order that it was designed. If you wish to see a different order then you need to use sorting available from the Design Application. Please check your design application functions. **LinkMotion manual and specific Design Application** document has more detail explanation.

### **5. How can I design a job in different colors or layers?**

These functions are available from the design Applications. Please check the documentation of your design application or the document name **LinkMotion with popular applications**.

### **6. How can I duplicate my design to cut several times?**

These functions are available from the design Applications. Please check the documentation of your design application or the document name **LinkMotion with popular applications**. **Repeat** function of LinkMotion will also allow you to resend the job as many times as you wish.

### **7. Can I cut the same job again since it was not cut all the way (depth) properly?**

The user should always do preliminary testing for proper depth and then send the job for production. Following conditions will allow you to cut the job again.

Check the box under **Origin setup** for **Return to 0,0 after job**. This allows your tool to be parked back in the same position as before.

Make sure to make changes in the **depth** selection of **Material Properties**, Click on the **Apply button** for it to be effective.

Now you can select the object or the shapes that did not cut properly and send it again to the machine. Make sure to look at the preview before you create the file for proper location of the output.

Make sure that proper M & G-Code is generated.

### **8. Can I cut any part of the job again without sending a complete job again?**

Yes, Follow the same procedure as in answer no. 5 from above.

### **9. Can I use any design applications to save my job?**

Yes, you can use other applications as long as the design application is capable of sending a vector output file. Design application should allow you to design shapes using the thinnest line or hairline or zero line width and no fill. Word processing type applications are not capable of sending the vector output. Please check with your supplier for more information. We document the one we do testing with.

### **10. What can I do to get more help?**

Support is freely available by email – [support@solustan.com](mailto:support@solustan.com)